

Appendix G3
LAX SPECIFIC PLAN AMENDMENT STUDY

Hazardous Materials

July 2012

Prepared for:

Los Angeles World Airports
One World Way
Los Angeles, California 90045

Prepared by:

CDM
111 Academy, Suite 150
Irvine, CA 92617

Attachments

Attachment 1 EDR Report


List of Figures

Figure 1 EDR Map

Table of Contents (continued)

This page intentionally left blank.


Figure 1
EDR Map

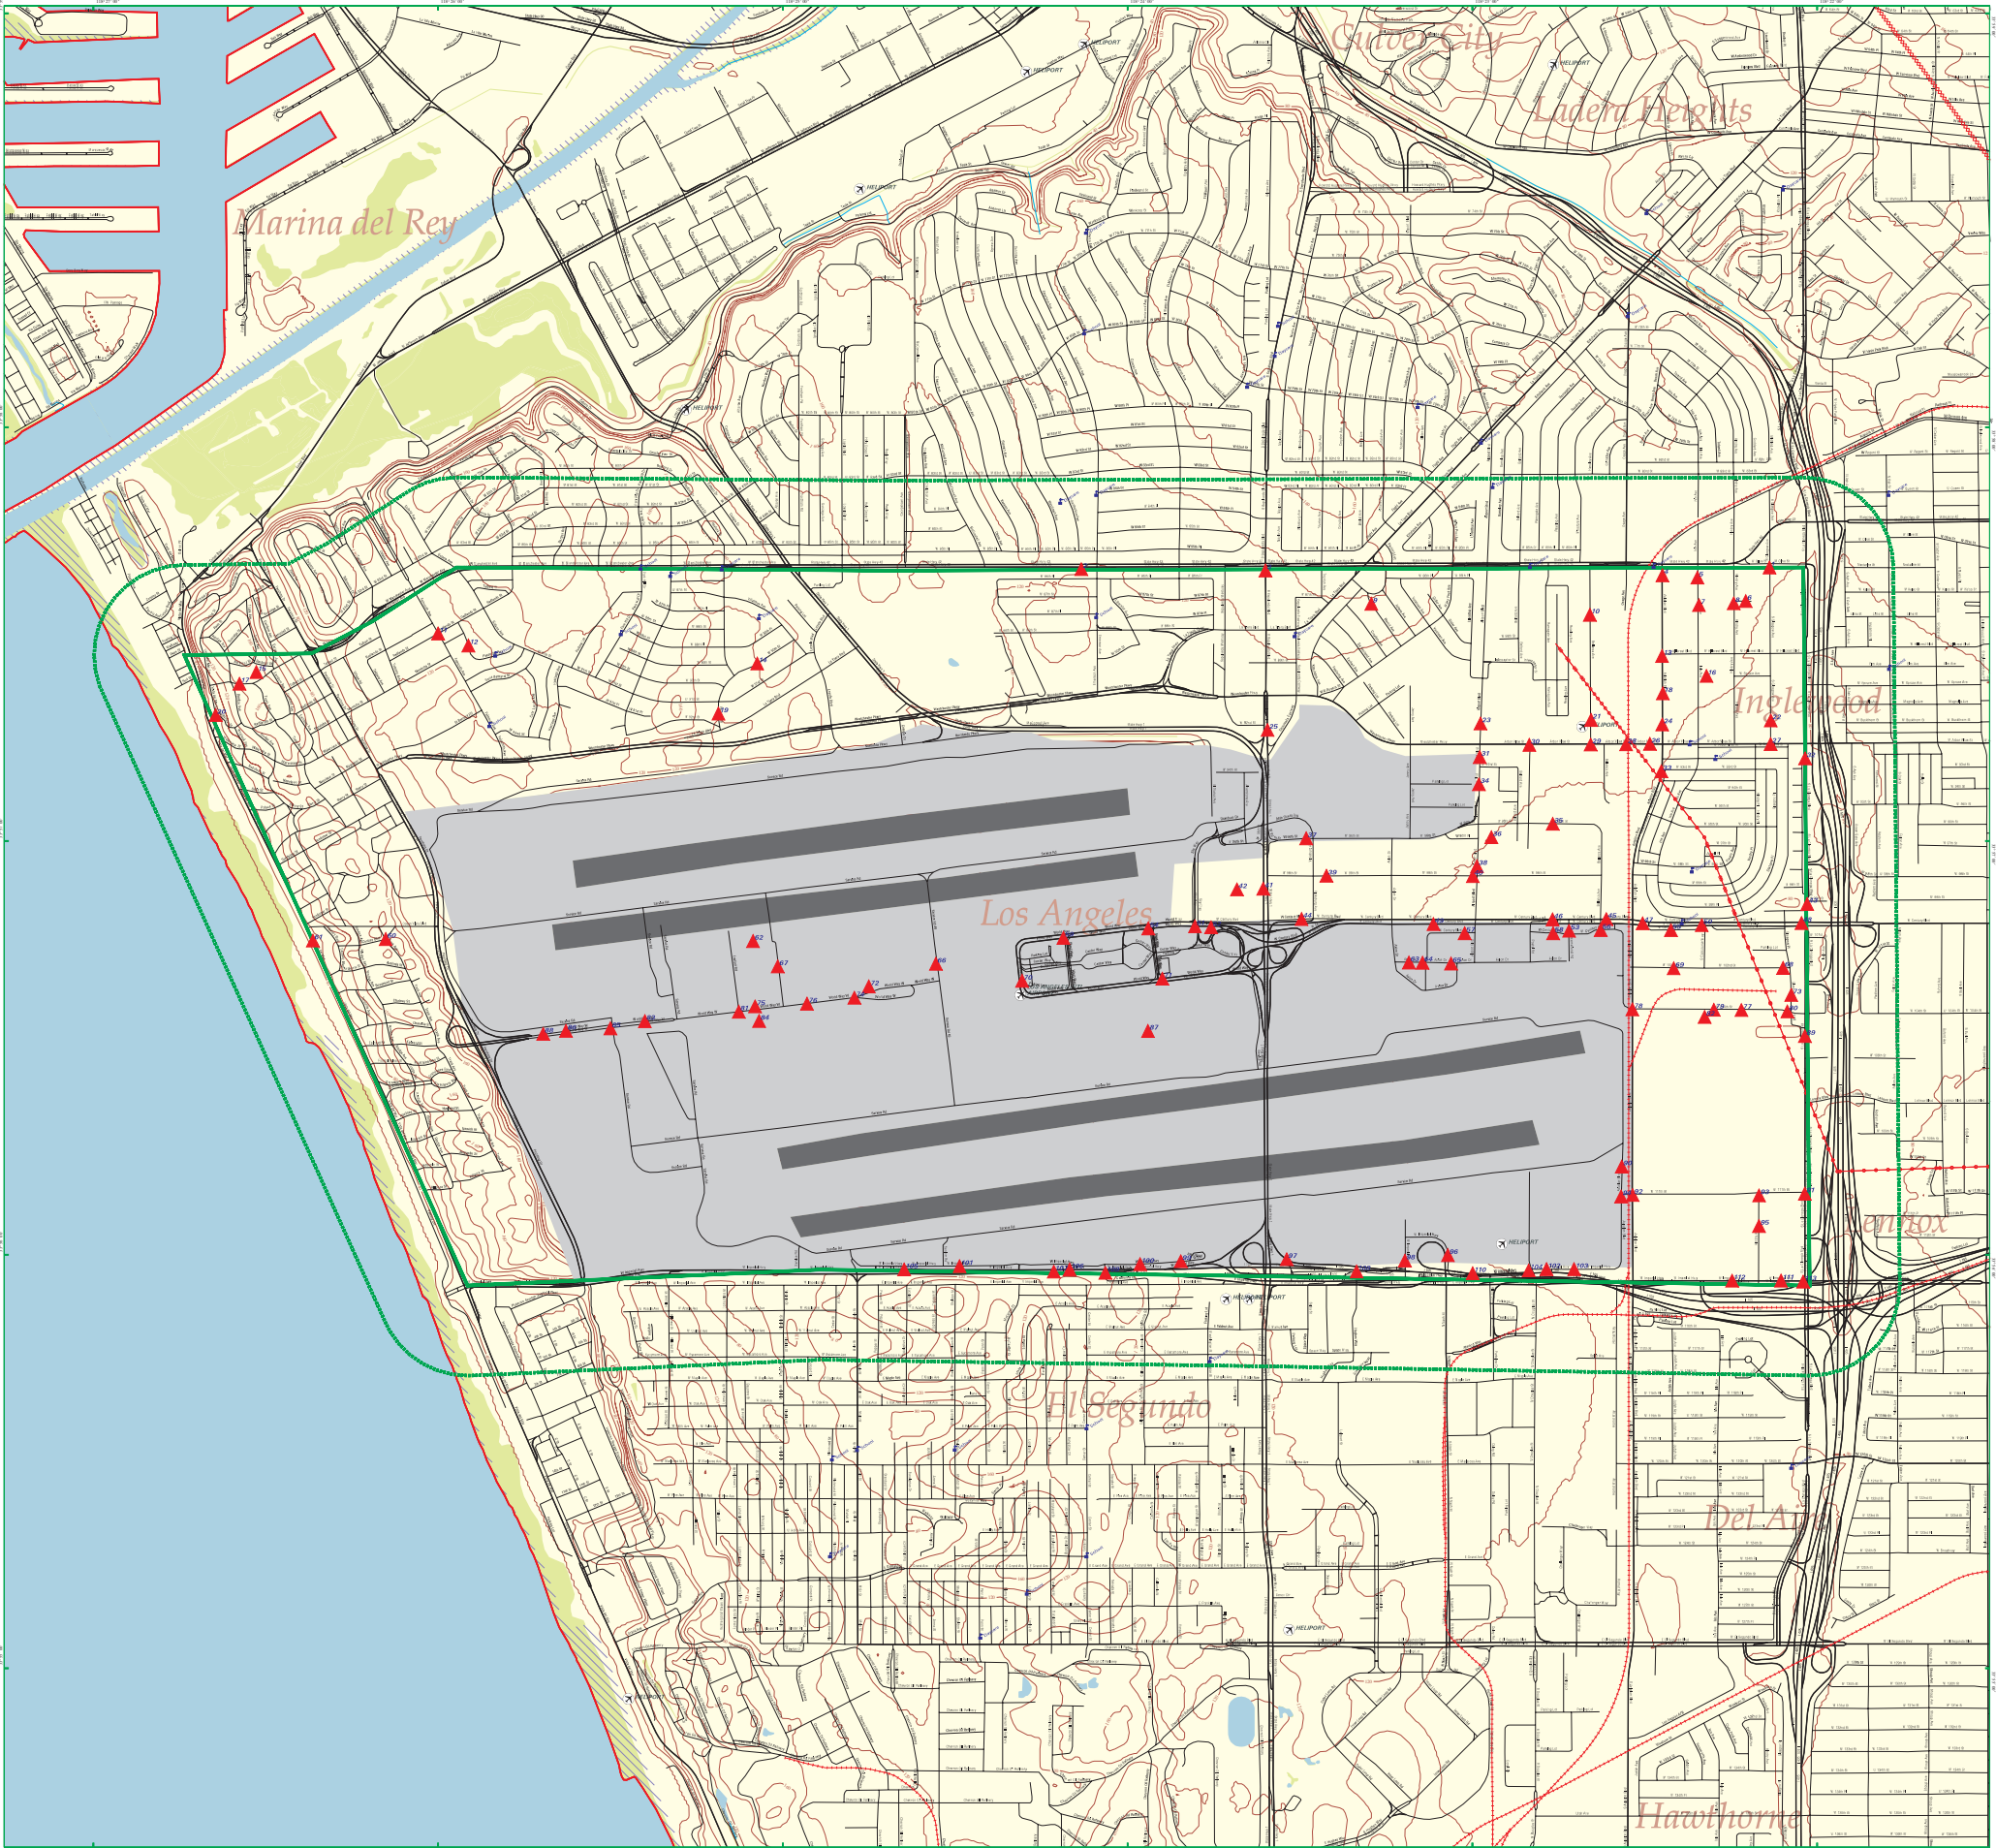

EDR DataMap®
Area Study

LAX SPAS

- ▲ Listed Sites
- Earthquake Epicenters (Richter 5 or greater)
- ▬ Search Boundary
- ▬ Roads
- ▬ Major Roads
- ▬ Waterways
- ▬ Railroads
- ▬ Contour Lines
- ▬ Pipelines
- ▬ Powerlines
- ▬ Fault Lines
- Water
- Superfund Sites
- 100-Yr Flood Zones
- National Wetland Inventory

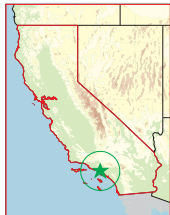

Los Angeles, CA



Scale in Miles



Attachment 1
EDR Report

LAX SPAS

Los Angeles, CA 90045

Inquiry Number: 3139641.1s
August 09, 2011

EDR DataMap™ Area Study



Environmental Data Resources Inc

440 Wheelers Farms Road
Milford, CT 06461
Toll Free: 800.352.0050
www.edrnet.com

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2006 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission. EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

TARGET PROPERTY INFORMATION

ADDRESS

LOS ANGELES, CA 90045
LOS ANGELES, CA 90045

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable") government records within the requested search area for the following databases:

FEDERAL RECORDS

NPL..... National Priority List
Proposed NPL..... Proposed National Priority List Sites
NPL LIENS..... Federal Superfund Liens
LIENS 2..... CERCLA Lien Information
US BROWNFIELDS..... A Listing of Brownfields Sites
CONSENT..... Superfund (CERCLA) Consent Decrees
UMTRA..... Uranium Mill Tailings Sites
ODL..... Open Dump Inventory
DEBRIS REGION 9..... Torres Martinez Reservation Illegal Dump Site Locations

STATE AND LOCAL RECORDS

HIST Cal-Sites..... Historical Calsites Database
SCH..... School Property Evaluation Program
Toxic Pits..... Toxic Pits Cleanup Act Sites
MCS..... Military Cleanup Sites Listing
VCP..... Voluntary Cleanup Program Properties

TRIBAL RECORDS

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land
INDIAN VCP..... Voluntary Cleanup Priority Listing

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in **bold italics** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

TC3139641.1s EXECUTIVE SUMMARY 1

EXECUTIVE SUMMARY

FEDERAL RECORDS

CERCLIS: The Comprehensive Environmental Response, Compensation and Liability Information System contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

A review of the CERCLIS list, as provided by EDR, and dated 02/25/2011 has revealed that there is 1 CERCLIS site within the searched area.

Site	Address	Map ID	Page
TRANSPORTATION SECURITY ADMINI	5757 W. CENTURY BLVD	46	138

CORRACTS: CORRACTS is a list of handlers with RCRA Corrective Action Activity. This report shows which nationally-defined corrective action core events have occurred for every handler that has had corrective action activity.

A review of the CORRACTS list, as provided by EDR, and dated 03/09/2011 has revealed that there are 3 CORRACTS sites within the searched area.

Site	Address	Map ID	Page
TTM PRINTED CIRCUIT GROUP INC	8636 AVIATION BL	4	6
RHO-CHEM CORP	425 ISIS AVE	7	20
FANSTEEL PRECISION SHEET METAL	5235 W 104TH ST	80	229

ERNS: The Emergency Response Notification System records and stores information on reported releases of oil and hazardous substances. The source of this database is the U.S. EPA.

A review of the ERNS list, as provided by EDR, and dated 04/05/2011 has revealed that there are 88 ERNS sites within the searched area.

Site	Address	Map ID	Page
INTERSECTION / MANCHESTER AND	INTERSECTION / MANCHEST	2	4
INTERSECTION / MANCHESTER AND	INTERSECTION / MANCHEST	2	4
STATION 2365 8600 AVIATION	STATION 2365 8600 AVIAT	6	11
UNOCAL SERVICE STATION 8600 AV	UNOCAL SERVICE STATION	6	12
SERVICE STATION 2365 8600 AVIA	SERVICE STATION 2365 86	6	12
SERVICE STATION 2365 8600 AVIA	SERVICE STATION 2365 86	6	12
431 SOUTH ISIS AVE	431 SOUTH ISIS AVE	7	15
425 ISIS AVE.	425 ISIS AVE.	7	17
425 ISIS AVE	425 ISIS AVE	7	17
425 ISIS AVE	425 ISIS AVE	7	17
425 ISIS AVE	425 ISIS AVE	7	18
425 ISIS AVE	425 ISIS AVE	7	18
425 ISIS AVE	425 ISIS AVE	7	20
425 ISIS AVE	425 ISIS AVE	7	20
RHO CHEM	RHO CHEM	7	20
425 ISIS AVENUE	425 ISIS AVENUE	7	20

TC3139641.1s EXECUTIVE SUMMARY 2

EXECUTIVE SUMMARY

Site	Address	Map ID	Page
8732 BLERIOT AVE	8732 BLERIOT AVE	9	41
FALMOUTH AVE & REDLANDS ST	FALMOUTH AVE & REDLANDS	11	44
7800 PASEO DEL RAY	7800 PASEO DEL RAY	12	44
7263 WEST 90TH STREET	7263 WEST 90TH STREET	14	48
640 ISIS	640 ISIS	16	50
9110 SOUTH RAYFORD DRIVE	9110 SOUTH RAYFORD DRIV	54	19
7341 VISTA DEL MAR LANE	7341 VISTA DEL MAR LANE	20	55
901 ARBOR VITAE	901 ARBOR VITAE	27	84
5630 ARBORVITAE ST	5630 ARBORVITAE ST	29	91
6221 W. 96TH STREET	6221 W. 96TH STREET	37	117
9775 AIRPORT BLVD	9775 AIRPORT BLVD	38	128
9851 SEPULVADA BLVD 1ST FLOOR	9851 SEPULVADA BLVD 1ST	42	133
GATE 119 - LAX	GATE 119 - LAX	45	135
GATE 123 LAX AIRPORT	GATE 123 LAX AIRPORT	45	135
LAX AIRPORT, GATE 123	LAX AIRPORT, GATE 123	45	135
RUNWAY 25 RIGHT AT LAX	RUNWAY 25 RIGHT AT LAX	45	135
FEDERAL EXPRESS LAX HUB	FEDERAL EXPRESS LAX HUB	45	136
LAX SERVICE RD POST 2	LAX SERVICE RD POST 2	45	136
FEDERAL EXPRESS LAX HUB 5927 W	FEDERAL EXPRESS LAX HUB	45	136
AREA-10 HANGER/Delta LAX	AREA-10 HANGER/Delta LA	45	136
GATE 105 AT LAX TERMINAL	GATE 105 AT LAX TERMINA	45	136
EASTERN REFUELING AREA/@ LAX.	EASTERN REFUELING AREA/	45	137
TAXIWAY A2 SPOT 6 LAX	TAXIWAY A2 SPOT 6 LAX	45	137
ICC SPOT TEN LAX AIRPORT	ICC SPOT TEN LAX AIRPOR	45	137
PAC OCEAN/END LAX RUNWAY TO S.	PAC OCEAN/END LAX RUNWA	45	137
LAX AIRPORT/TAXIWAY-K-32	LAX AIRPORT/TAXIWAY-K-3	45	137
LAX, SATELLITE-3,GATE-34	LAX, SATELLITE-3,GATE-3	45	138
10MI OFFSHORE/270 DEGREES FROM	10MI OFFSHORE/270 DEGRE	45	138
5552 WEST CENTURY BLVD, SERVIC	5552 WEST CENTURY BLVD,	47	141
1 WORLD WAY	1 WORLD WAY	51	164
5700 W. CENTURY BLVD.	5700 W. CENTURY BLVD.	53	171
5758 CENTURY BLVD	5758 CENTURY BLVD	58	176
LOS ANGELES AIRPORT, SATELLITE	LOS ANGELES AIRPORT, SA	62	183
LOS ANGELES INTERNATIONAL AIRP	LOS ANGELES INTERNATION	62	183
LOS ANGELES INTERNATIONAL AIRP	LOS ANGELES INTERNATION	62	183
FEDERAL EXPRESS HUB LA INTL	FEDERAL EXPRESS HUB LA	62	183
TWA GATE 31/LOS ANGELES INTL A	TWA GATE 31/LOS ANGELES	62	183
LOS ANGES INTERNATIONAL AIRPO	LOS ANGES INTERNATIONAL	62	184
ADJACENT TO TERMINAL 2 LA INTL	ADJACENT TO TERMINAL 2	62	184
LOS ANGELES AIRPORT	LOS ANGELES AIRPORT	62	184
LOS ANGELES INTL AIRPORT GATE	LOS ANGELES INTL AIRPO	62	184
LOS ANGELES INTL AIRPORT GATE	LOS ANGELES INTL AIRPORT	62	184
USCG SUPPORT CENTER SAN PEDRO	USCG SUPPORT CENTER SAN	67	194
700 WORLD WAY LAX - TERMINAL #	700 WORLD WAY LAX - TER	71	198
7001 WORLD WAY WEST/GATE 121	7001 WORLD WAY WEST/GATE	72	199
7001 WORLD WAY WEST	7001 WORLD WAY WEST	75	211
7001 WORLD WAY WEST	7001 WORLD WAY WEST	75	211
7001 WORLD WAY WEST	7001 WORLD WAY WEST	75	213
7001 WORLD WAY WEST (IN HANGER	7001 WORLD WAY WEST (IN	75	213
5341 W 104 TH ST	5341 W 104 TH ST	77	221
5220 W. 104 TH STREET	5220 W. 104 TH STREET	80	230
9900 LAX FUEL ROAD	9900 LAX FUEL ROAD	81	231
9900 LAX FUEL ROAD	9900 LAX FUEL ROAD	81	233
9900 LAXFUEL RD	9900 LAXFUEL RD	81	237
9900 LAXFUEL RD	9900 LAXFUEL RD	81	238
9900 LAXFUEL RD	9900 LAXFUEL RD	81	238

EXECUTIVE SUMMARY

Site	Address	Map ID	Page
Not reported	5927 WEST IMPERIAL HIGH	96	275
Not reported	5927 WEST IMPERIAL HWY	96	275
Not reported	5927 WEST IMPERIAL HIGH	96	276
Not reported	5927 WEST IMPERIAL HIGH	96	276
Not reported	5927 W IMPERIAL HWY	96	276
Not reported	5927 WEST IMPERIAL HIGH	96	276
Not reported	5927 W IMPERIAL HIGHWAY	96	277
Not reported	5927 WEST IMPERIAL HIGH	96	277
Not reported	5927 WEST IMPERIAL HIGH	96	277
Not reported	5927 W. IMPERIAL HIGHWA	96	277
Not reported	5927 IMPERIAL HWY	96	278
Not reported	5927 WEST IMPERIAL HIGH	96	278
Not reported	5927 WEST IMPERIAL HIGH	96	278
Not reported	5927 WEST IMPERIAL HIGH	96	278
Not reported	5927 WEST IMPERIAL HIGH	96	278
Not reported	5927 WEST IMPERIAL HIGH	96	279
5927 W. IMPERIAL HWY	5927 W. IMPERIAL HWY	96	279
Not reported	5927 W IMPERIAL HWY	96	279
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	279
Not reported	5927 WEST IMPERIAL HIGH	96	280
Not reported	5927 WEST IMPERIAL HWY	96	280
Not reported	5927 W IMPERIAL HIGHWAY	96	280
Not reported	5927 WEST IMPERIAL HIGH	96	280
Not reported	5927 W IMPERIAL HIGHWAY	96	281
Not reported	5927 WEST IMPERIAL HIGH	96	281
Not reported	5927 WEST IMPERIAL HIGH	96	281
Not reported	5927 WEST IMPERIAL HIGH	96	281
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	282
Not reported	5927 W IMPERIAL HWY	96	282
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	282
Not reported	5927 IMPERIAL HWY	96	282
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	283
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	283
Not reported	5927 W IMPERIAL HWY	96	283
Not reported	5927 W IMPERIAL HWY	96	283
Not reported	5927 WEST IMPERIAL HWY	96	284
Not reported	5927 W IMPERIAL HIGHWAY	96	284
Not reported	5927 WEST IMPERIAL HIGH	96	284
Not reported	5927 WEST IMPERIAL HWY	96	285
Not reported	5927 W IMPERIAL HIGHWAY	96	285
Not reported	5927 W IMPERIAL HWY	96	285
Not reported	5927 WEST IMPERIAL HIGH	96	285
Not reported	5927 WEST IMPERIAL HWY	96	286
Not reported	5927 W IMPERIAL HWY	96	286
Not reported	5927 WEST IMPERIAL HIGH	96	286
Not reported	5927 WEST IMPERIAL HWY	96	286

EXECUTIVE SUMMARY

Site	Address	Map ID	Page
9900 LAXFUEL RD	9900 LAXFUEL RD	81	238
9900 LAXFUEL RD	9900 LAXFUEL RD	81	240
9900 LAXFUEL RD	9900 LAXFUEL RD	81	240
7300 WORLD WAY WEST	7300 WORLD WAY WEST	85	253
7300 WORLD WAY WEST	7300 WORLD WAY WEST	85	256
7401 WORLD WAY WEST	7401 WORLD WAY WEST	86	256
7401 WORLD WAY WEST	7401 WORLD WAY WEST	86	259
7401 WORLD WAY WEST	7401 WORLD WAY WEST	86	259
11101 S AVIATION BLVD	11101 S AVIATION BLVD	94	272
6555 W IMPERIAL HWY	6555 W IMPERIAL HWY	102	312
5721 W. IMPERIAL HWY	5721 W. IMPERIAL HWY	102	321
5761 W IMPERIAL HWY LAX AIRPOR	5761 W IMPERIAL HWY LAX	102	325
5761 W IMPERIAL HWY LAX AIRPOR	5761 W IMPERIAL HWY LAX	102	325
5761 WEST IMPERIAL HWY	5761 WEST IMPERIAL HWY	102	325
5811 IMPERIAL HWY	5811 IMPERIAL HWY	104	325

HMIRS: The Hazardous Materials Incident Report System contains hazardous material spill incidents reported to the Department of Transportation. The source of this database is the U.S. EPA.

A review of the HMIRS list, as provided by EDR, and dated 12/31/2010 has revealed that there are 196 HMIRS sites within the searched area.

Site	Address	Map ID	Page
Not reported	5500 WEST CENTURY BLVD	55	174
Not reported	5500 WEST CENTURY BLVD	55	174
Not reported	5500 WEST CENTURY BLVD	55	175
Not reported	5500 WEST CENTURY BLVD	55	175
Not reported	5500 W CENTURY BLVD	55	175
Not reported	5500 WEST CENTURY BLVD	55	175
Not reported	5500 W CENTURY BLVD	55	175
Not reported	5500 WEST CENTURY BLVD	55	176
Not reported	5628 W CENTURY BLVD	56	176
Not reported	5628 W CENTURY BLVD	56	176
Not reported	5932 W CENTURY BLVD	57	176
300 WORLD WAY	300 WORLD WAY	59	177
Not reported	300 WORLD WAY TERMINAL	59	178
Not reported	5950 AVION DR	65	193
Not reported	5950 AVION DR	65	193
400 WORLD WAY WEST	400 WORLD WAY WEST	70	196
400 WORLD WAY LAX	400 WORLD WAY LAX	70	196
Not reported	400 WORLD WAY	70	196
Not reported	400 WORLD WAY	70	196
400 WORLD WAY LOS ANGELES CA	400 WORLD WAY LOS ANGEL	70	197
Not reported	10501 LA CIENEGA	89	269
11001 AVIATION BLVD. LA CA	11001 AVIATION BLVD. LA	90	269
Not reported	11101 AVIATION AVE	92	270
Not reported	11221 S HINDRY AVE	95	272
Not reported	5927 WEST IMPERIAL HIGH	96	274
Not reported	5927 WEST IMPERIAL HWY	96	274
Not reported	5927 WEST IMPERIAL HIGH	96	274
Not reported	5927 IMPERIAL HWY	96	275
Not reported	5927 W IMPERIAL HWY	96	275
Not reported	5927 WEST IMPERIAL HIGH	96	275

EXECUTIVE SUMMARY

Site	Address	Map ID	Page
Not reported	5927 WEST IMPERIAL HWY	96	286
Not reported	5927 WEST IMPERIAL HIGH	96	287
Not reported	5927 IMPERIAL HWY	96	287
Not reported	5927 WEST IMPERIAL HIGH	96	287
Not reported	5927 W IMPERIAL HWY	96	287
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	287
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	288
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	288
Not reported	5927 WEST IMPERIAL HIGH	96	288
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	288
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	288
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	289
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	289
5927 W IMPERIAL HIGHWAY	5927 W. IMPERIAL HIGHWA	96	289
5927 W. IMPERIAL HWY.	5927 W. IMPERIAL HWY.	96	289
Not reported	5927 W IMPERIAL HIGHWAY	96	289
Not reported	5927 W IMPERIAL HIGHWAY	96	290
Not reported	5927 WEST IMPERIAL HWY.	96	290
Not reported	5927 W IMPERIAL HWY	96	290
Not reported	5927 W IMPERIAL HIGHWAY	96	290
Not reported	5927 WEST IMPERIAL HIGH	96	290
Not reported	5927 WEST IMPERIAL HIGH	96	291
Not reported	5927 W IMPERIAL HIGHWAY	96	291
Not reported	5927 WEST IMPERIAL HIGH	96	291
Not reported	5927 W. IMPERIAL HWY	96	291
Not reported	5927 WEST IMPERIAL HIGH	96	291
Not reported	5927 IMPERIAL HIGHWAY	96	292
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	292
Not reported	5927 WEST IMPERIAL HIGH	96	292
Not reported	5927 W. IMPERIAL HWY	96	292
5927 W. IMPERIAL HWY	5927 W. IMPERIAL HWY	96	292
Not reported	5927 WEST IMPERIAL HIGH	96	293
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	293
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	293
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	293
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	293
Not reported	5927 WEST IMPERIAL HIGH	96	294
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	294
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	294
Not reported	5927 WEST IMPERIAL HWY	96	294
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	295
Not reported	5927 WEST IMPERIAL HWY	96	295
Not reported	5927 WEST IMPERIAL HIGH	96	295
Not reported	5927 WEST IMPERIAL HIGH	96	295
Not reported	5927 WEST IMPERIAL HWY	96	296
Not reported	5927 WEST IMPERIAL HWY	96	296
Not reported	5927 WEST IMPERIAL HIGH	96	296
Not reported	5927 WEST IMPERIAL HIGH	96	297
Not reported	5927 WEST IMPERIAL HWY	96	297
Not reported	5927 IMPERIAL HWY	96	297
Not reported	5927 IMPERIAL HWY	96	297
5927 W. IMPERIAL HWY	5927 W. IMPERIAL HWY	96	297

EXECUTIVE SUMMARY

Site	Address	Map ID	Page
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	298
Not reported	5927 WEST IMPERIAL HWY	96	298
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	298
Not reported	5927 WEST IMPERIAL HIGH	96	298
Not reported	5927 W IMPERIAL HWY	96	298
Not reported	5927 W IMPERIAL HIGHWAY	96	299
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	299
Not reported	5927 IMPERIAL HIGHWAY	96	299
Not reported	5927 WEST IMPERIAL HWY	96	299
Not reported	5927 WEST IMPERIAL HIGH	96	299
Not reported	5927 WEST IMPERIAL HIGH	96	300
Not reported	5927 W IMPERIAL HWY	96	300
Not reported	5927 WEST IMPERIAL HIGH	96	300
Not reported	5927 WEST IMPERIAL HIGH	96	301
Not reported	5927 WEST IMPERIAL HIGH	96	301
5927 W IMPERIAL HWY	5927 W IMPERIAL HWY	96	301
Not reported	5927 W IMPERIAL HWY	96	301
Not reported	5927 WEST IMPERIAL HIGH	96	301
Not reported	5927 WEST IMPERIAL HIGH	96	302
Not reported	5927 WEST IMPERIAL HWY	96	302
Not reported	5927 W IMPERIAL HIGHWA	96	302
Not reported	5927 W IMPERIAL HIGHWA	96	302
Not reported	5927 IMPERIAL HWY	96	303
Not reported	5927 WEST IMPERIAL HWY	96	303
Not reported	5927 W IMPERIAL HWY	96	303
Not reported	5927 W IMPERIAL HWY	96	303
Not reported	5927 W IMPERIAL HWY	96	303
Not reported	5927 WEST IMPERIAL HIGH	96	304
Not reported	5927 WEST IMPERIAL HIGH	96	304
Not reported	5927 WEST IMPERIAL HIGH	96	304
Not reported	5927 IMPERIAL HIGHWAY	96	305
Not reported	5927 WEST IMPERIAL HIGH	96	305
Not reported	5927 W IMPERIAL HWY	96	305
Not reported	5937 WEST IMPERIAL HIGH	96	305
Not reported	5937 WEST IMPERIAL HIGH	96	305
6041 WEST IMPERIAL HWY SUITE C	6041 WEST IMPERIAL HWY	98	310
6041 W IMPERIAL HWY	6041 W IMPERIAL HWY	98	310
Not reported	6555 WEST IMPERIAL HWY	100	312
Not reported	6555 WEST IMPERIAL HWY	100	312
Not reported	5721 W IMPERIAL HWY	102	322
Not reported	5721 W IMPERIAL HWY	102	324
5721 W IMPERIAL HIGHWAY	5721 W IMPERIAL HIGHWA	102	324
Not reported	5729 W IMPERIAL HWY	102	324
Not reported	5729 IMPERIAL HWY	102	324
5625 W IMPERIAL HWY	5625 W IMPERIAL HWY	103	325
Not reported	5927 W IMPERIAL	105	328
Not reported	5927 WEST IMPERIAL DR	106	329
Not reported	5927 WEST IMPERIAL FREE	106	329
Not reported	5924 W IMPERIAL HWY	107	329
Not reported	5247 W IMPERIAL HWY	111	340
Not reported	5427 W IMPERIAL HWY	112	341
Not reported	5429 W IMPERIAL HWY	112	341
Not reported	5429 W IMPERIAL HWY	112	342

TC3139641.1s EXECUTIVE SUMMARY 7

EXECUTIVE SUMMARY

HIST CORTESE: The sites for the list are designated by the State Water Resource Control Board [LUST], the Integrated Waste Board [SWF/LS], and the Department of Toxic Substances Control [CALSITES].

A review of the HIST CORTESE list, as provided by EDR, and dated 04/01/2001 has revealed that there are 51 HIST CORTESE sites within the searched area.

Site	Address	Map ID	Page
AIRPORT BUSINESS CENTER	315 GLASGOW AVE S	1	2
SPRING CLEANERS	8611 SEPULVEDA BLVD	3	6
PRINCE CHRYSLER PLYMOUTH	1030 MANCHESTER	7	14
RHO-CHEM CORP	425 ISIS AVE	7	20
FRITO-LAY, INC	8731 BELLANCA AVE	10	41
YOUR MAN TOURS, INC	8831 AVIATION BLVD	13	44
WESTERN FARM SERVICE	256 MANCHESTER	17	50
SHELL	255 MANCHESTER	17	50
CHEVRON	256 MANCHESTER	17	51
MERLE NORMAN COSMETICS	9130 BELLANCA AVE	21	56
HERTZ RENT-A-CAR	9029 AIRPORT BLVD	23	64
HARRY'S AIRPORT GARAGE	9131 AVIATION	24	72
COLLINS TRUST	9121 AVIATION BLVD	24	72
COLLINS TRUST PROPERTY FORMER	9117-9121 AVIATION BLVD	24	75
KING DELIVERY, INC	5600 ARBOR VITAE ST W	28	84
NEUTROGENA FACILITY	5800 ARBOR VITAE AVE	30	93
AVIS RENT-A-CAR	9217 AIRPORT BLVD	31	95
NATIONAL CAR RENTAL	9419 AIRPORT BLVD	34	103
BUDGET RENT-A-CAR-LAX	9775 AIRPORT BLVD	38	127
ALLIED-SIGNAL INC. (PARK	9851 SEPULVEDA	42	133
76 PRODUCTS STATION #3272	5552 CENTURY	47	141
TEXACO	5551 CENTURY	47	144
BP WEST COAST PRODUCTS LLC 000	5201 CENTURY BLVD	48	152
DELTA AIRLINES	6150 CENTURY	49	152
THRIFTY CAR RENTAL	5440 CENTURY	50	161
FAA LAX CONTROL TOWER	1 WORLD	51	164
LAX TERMINAL 2	200 WORLD WY	54	172
SHELL SVC STATION S A P NO 129	304 CENTURY	60	180
UNITED AIRLINES	6020 AVION DRIVE	64	187
LAX FUEL CORP	6900 WORLD	74	203
AMERICAN AIRLINES INCORPORATED	7000 WORLD WAY WEST	75	206
AMERICAN AIRLINES, INC.	7000 WORLD WAY W	75	206
LAX FUEL-DFSF	7265 WORLD	75	215
ARCO DAY STORAGE FACILITY	6950 WORLD	76	219
FANSTEEL INC	5235 104TH	80	226
LAX FUEL CORP	7259 WORLD	83	241
LAX FUEL CORP	7261 WORLD	83	241
LAX FUEL CORP	7253 WORLD	83	242
ALLIED AVIATION SERVICE O	7251 WORLD	83	242
CONTINENTAL AIRLINES - LOS ANG	7300 WORLD WAY WEST	85	251
TERMINAL 6 LAX	600 WORLD WY	87	264
INTERNATIONAL FUELS CORP	7451 WORLD	88	269
FLYING TIGERS FREIGHT	5927 IMPERIAL	96	300
GARRETT AIRESEARCH	6201 IMPERIAL	97	307
MERCURY SERVICES/LAX	6851 IMPERIAL	101	319
KOREAN AIRLINES FREIGHT	6101 IMPERIAL	108	337
SO. BAY PETROLEUM	5899 IMPERIAL	110	339
CATRANS SAND/SALT FACILIT	5885 IMPERIAL	110	339
FAA	5885 IMPERIAL	110	340
SHELL	5201 IMPERIAL	113	342
CHEVRON #9-7795	5201 IMPERIAL	113	342

TC3139641.1s EXECUTIVE SUMMARY 9

EXECUTIVE SUMMARY

Department of Transportation, Office of Pipeline Safety Incident and Accident data.

A review of the DOT OPS list, as provided by EDR, and dated 01/12/2011 has revealed that there is 1 DOT OPS site within the searched area.

Site	Address	Map ID	Page
Not reported	300 WORLD WAY	59	178

FUDS: The Listing includes locations of Formerly Used Defense Sites Properties where the US Army Corps Of Engineers is actively working or will take necessary cleanup actions.

A review of the FUDS list, as provided by EDR, and dated 12/31/2009 has revealed that there are 2 FUDS sites within the searched area.

Site	Address	Map ID	Page
EL SEGUNDO BATTERY SITE		15	48
LOS ANGELES MUNICIPAL AIRPORT		82	240

STATE AND LOCAL RECORDS

WMUDS/SWAT: The Waste Management Unit Database System is used for program tracking and inventory of waste management units. The source is the State Water Resources Control Board.

A review of the WMUDS/SWAT list, as provided by EDR, and dated 04/01/2000 has revealed that there is 1 WMUDS/SWAT site within the searched area.

Site	Address	Map ID	Page
LOS ANGELES INTERNATIONAL AIRP	ALONG SEPULVEDA	66	193

Cortese: The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste Board (SWF/LS), and the Department of Toxic Substances Control (Cal-Sites). This listing is no longer updated by the state agency.

A review of the Cortese list, as provided by EDR, and dated 07/01/2011 has revealed that there are 3 Cortese sites within the searched area.

Site	Address	Map ID	Page
COLLINS TRUST	9121 AVIATION BLVD	24	72
LOS ANGELES MUNICIPAL AIRPORT	1 WORLD WAY	52	168
TETRA GRAPHICS SITE	10310 GLASGOW PLACE	73	199

TC3139641.1s EXECUTIVE SUMMARY 8

EXECUTIVE SUMMARY

LUST: The Leaking Underground Storage Tank Incident Reports contain an inventory of reported leaking underground storage tank incidents. The data come from the State Water Resources Control Board Leaking Underground Storage Tank Information System.

A review of the LUST list, as provided by EDR, and dated 06/20/2011 has revealed that there are 60 LUST sites within the searched area.

Site	Address	Map ID	Page
AIRPORT BUSINESS CENTER	315 GLASGOW AVE S	1	2
Status: Completed - Case Closed			
WORLD SERVICE	8611 SEPULVEDA BLVD	3	5
RHO-CHEM CORP	425 ISIS AVE	7	20
FRITO-LAY, INC	8731 BELLANCA AVE	10	41
Status: Open - Inactive			
YOUR MAN TOURS, INC	8831 AVIATION BLVD	13	44
Status: Completed - Case Closed			
ALAMO	9020 AVIATION BLVD.	18	53
Status: Completed - Case Closed			
MERLE NORMAN COSMETICS	9130 BELLANCA AVE	21	56
Status: Completed - Case Closed			
BARNES WHOLESALE INC	740 S GLASGOW AVE	22	58
Status: Open - Verification Monitoring			
HERTZ CORPORATION	9000 AIRPORT BLVD.	23	59
Status: Open - Remediation			
HERTZ RENT-A-CAR	9029 AIRPORT BLVD	23	64
Status: Completed - Case Closed			
HARRY'S AIRPORT GARAGE	9131 AVIATION BLVD S	24	66
Status: Open - Remediation			
COLLINS TRUST	9121 AVIATION BLVD	24	72
Status: Completed - Case Closed			
COLLINS TRUST PROPERTY FORMER	9117-9121 AVIATION BLVD	24	75
Status: Completed - Case Closed			
FREIGHT FOREARDERS	9107 S AVIATION BLVD	24	78
AVON RENT-A-CAR	9220 SEPULVEDA BLVD	25	79
Status: Completed - Case Closed			
KING DELIVERY, INC	5600 ARBOR VITAE ST W	28	84
Status: Open - Assessment & Interim Remedial Action			
NEUTROGENA FACILITY	5800 ARBOR VITAE AVE	30	93
Status: Completed - Case Closed			
AVIS RENT-A-CAR	9217 AIRPORT BLVD	31	95
Status: Open - Remediation			
NATIONAL CAR SALES	9204 S AIRPORT BLVD	31	99
Status: Open - Remediation			
Status: Open - Remediation			
AVIS/FORMER NATIONAL CAR RENTA	9419 AIRPORT BLVD	34	103
Status: Open - Verification Monitoring			
BUDGET RENT-A-CAR	9775 AIRPORT BLVD	38	120
Status: Open - Remediation			
RESORT RENT A CAR	6151 W 98TH ST	39	128
Status: Open - Site Assessment			

TC3139641.1s EXECUTIVE SUMMARY 10

EXECUTIVE SUMMARY

Site	Address	Map ID	Page
HONEYWELL, INC. 76 PRODUCTS STATION #3272 Status: Completed - Case Closed	9851 SEPULVEDA BLVD 5552 CENTURY BLVD W	41 47	131 141
TEXACO SVC STA Status: Completed - Case Closed	5551 W CENTURY	47	144
ARCO #0003 Status: Open - Site Assessment	5201 CENTURY BLVD W	48	146
DELTA AIRLINES THRIFTY CAR RENTAL Status: Open - Remediation	6150 CENTURY 5440 CENTURY BLVD W	49 50	152 155
FAA LAX CONTROL TOWER Status: Completed - Case Closed	1 WORLD WAY	51	161
TERMINAL #1 LAX Status: Open - Site Assessment	100 WORLD WY	51	166
LOS ANGELES MUNICIPAL AIRPORT LAFD - FIRE STATION 95 Status: Open - Verification Monitoring	1 WORLD WAY 10010 S INTERNATIONAL R	52 53	168 171
LAX TERMINAL 2 Status: Completed - Case Closed	200 WORLD WY	54	172
DOCKWEILER BEACH SERVICE YARD Status: Completed - Case Closed	8255 VISTA DEL MAR PL	61	181
UNITED AIRLINES Status: Open - Site Assessment	6020 AVION DR	64	189
LOS ANGELES WORLD AIRPORTS Status: Completed - Case Closed	380 WORLD WAY WEST	70	197
LAX FUEL AMERICAN A/L Status: Completed - Case Closed	6900 WORLD WY W 7000 WORLD WY W	74 75	202 207
WORLDWIDE FLIGHT SERVICES Status: Open - Site Assessment	7000 WORLD WY W	75	210
LAX FUEL-DFSF LAX DAY STORAGE Status: Completed - Case Closed	7265 WORLD WY W 6950 WORLD WAY W	75 76	214 217
NATIONAL TECHNICAL SYSTEMS Status: Open - Inactive	5320 104TH STREET	77	220
FANSTEEL INC LAX FUEL CORP LAX FUEL LAX FUEL LAX FUEL CONTINENTAL AIRLINES INC Status: Open - Site Assessment	5235 W 104TH ST 7259 WORLD WY W 7261 WORLD WY W 7251 WORLD WY W 7253 WORLD WY W 7300 W WORLD WY	80 83 83 83 83 84	227 242 243 245 246 248
LAX - CONTINENTAL AIRLINES MAI CONTINENTAL AIRLINES - LOS ANG TERMINAL 6 LAX Status: Open - Site Assessment	7300 W WORLD WAY 7300 WORLD WAY WEST 600 WORLD WY	84 85 87	249 251 264
LAX FUEL GARRETT AIRESEARCH Status: Completed - Case Closed	7451 WORLD WY W 6201 IMPERIAL HWY E	88 97	267 307

TC3139641.16 EXECUTIVE SUMMARY 11

EXECUTIVE SUMMARY

Site	Address	Map ID	Page
HONEYWELL INTERNATIONAL CORP. WYNDHAM HOTEL Facility Status: Completed - Case Closed	9851 SEPULVEDA 6225 W. CENTURY BLVD	42 44	133 134
HYATT L A X DELTA AIRLINES Facility Status: Open - Verification Monitoring	6225 W CENTURY BLVD 6150 CENTURY	44 49	135 152
DELTA AIRLINES Facility Status: Completed - Case Closed	6150 CENTURY BOULEVARD	49	154
LOS ANGELES MUNICIPAL AIRPORT Facility Status: Open - Remediation	1 WORLD WAY	52	168
DELTA AIRLINES - AVION BLDG DELTA AIRLINES - AVION BLDG Facility Status: Open	6060 AVION 6060 AVION DR	63 63	186 186
UNITED AIRLINES MAINTENANCE OP Facility Status: Open - Site Assessment	6020 AVION DR.	64	188
LYNDEN AIR FREIGHT LAX FUEL Facility Status: Open - Remediation	5220 102ND 6900 WORLD WY W	68 74	194 202
LAXFUEL - DFSF Facility Status: Completed - Case Closed	7265 W. WORLD WY	75	213
LAX FUEL-DFSF Facility Status: Completed - Case Closed	7265 WORLD WY W	75	214
LAXFUEL - BFSF LAX FUEL-DFSF FANSTEEL INC LYNDEN AIR FREIGHT INC (SAME Facility Status: Open - Inactive Facility Status: Open - Site Assessment	7265 WORLD 7265 WORLD 5235 104TH 5235 WEST 104TH ST	75 75 80 80	215 215 226 229
LAXFUEL CORP Facility Status: Open - Site Assessment	9900 LAXFUEL RD	81	238
LAX FUEL CORP Facility Status: Open - Remediation	7259 WORLD WY W	83	242
LAX FUEL Facility Status: Open - Remediation	7261 WORLD WY W	83	243
LAX FUEL Facility Status: Open - Remediation	7251 WORLD WY W	83	245
LAX FUEL Facility Status: Open - Remediation	7253 WORLD WY W	83	246
LAX - CONTINENTAL AIRLINES MAI Facility Status: Open - Site Assessment	7300 W WORLD WAY	84	249
CONTINENTAL AIRLINES MAINTENAN Facility Status: Open - Assessment & Interim Remedial Action	7300 W. WORLD WY	84	250
CONTINENTAL AIRLINES - LOS ANG Facility Status: Open - Site Assessment	7300 WORLD WAY WEST	85	251
DOUGLAS AIRCRAFT CO Facility Status: Open - Site Assessment	7300 WORLD WAY WEST	85	253
LAX FUEL Facility Status: Open - Remediation	7451 WORLD WY W	88	267

TC3139641.16 EXECUTIVE SUMMARY 13

EXECUTIVE SUMMARY

Site	Address	Map ID	Page
PAN AMERICAN WORLD AIRWAYS, IN Status: Open - Remediation	6501 W IMPERIAL HWY	99	311
ATLANTIC AVIATION (FORMER MERC Status: Open - Remediation	6851 IMPERIAL HWY W	101	314
FAA Status: Open - Remediation	5885 IMPERIAL HWY W	107	329
SO. BAY PETROLEUM Status: Completed - Case Closed	5899 IMPERIAL HWY W	107	331
FLYING TIGERS FREIGHT Status: Completed - Case Closed	5927 IMPERIAL HWY W	107	333
KOREAN AIRLINES FREIGHT CHEVRON STATION 97795 Status: Open - Remediation	6101 IMPERIAL HWY E 5201 W IMPERIAL HWY	108 113	335 342

SLIC: SLIC Region comes from the California Regional Water Quality Control Board.

A review of the SLIC list, as provided by EDR, and dated 06/20/2011 has revealed that there are 53 SLIC sites within the searched area.

Site	Address	Map ID	Page
AIRPORT BUSINESS CENTER Facility Status: Open - Site Assessment	315 GLASGOW AVE S	1	2
PRINCE CHRYSLER PLYMOUTH RHO-CHEM CORP Facility Status: Open - Site Assessment	1030 MANCHESTER 425 ISIS AVE	7 7	14 20
AVAYA PROPERTY AVAYA PROPERTY Facility Status: Open - Site Assessment	400 HINDRY 400 S. HINDRY AVE	8 8	38 39
UNION BANK/ESTATE OF JOSEPH CO AVIATION INGLEWOOD (FORMERLY B Facility Status: Open - Site Assessment Facility Status: Open - Site Assessment	9007-9121 AVIATION 9007-9121 AVIATION BOUL	18 18	51 51
BODYCOTE HINDERLITER FREIGHT FORWARDERS Facility Status: Completed - Case Closed	9121 AVIATION 9107 S AVIATION BLVD	24 24	72 78
PRINCELAND PROPERTY Facility Status: Open - Assessment & Interim Remedial Action	1237 W. ARBOR VITAE ST	26	83
PRINCELAND PROPERTY PRINCELAND PROPERTIES Facility Status: Open	1237 ARBOR VITAE 1237 W ARBOR VITAE ST	26 26	84 84
HONEYWELL INTERNATIONAL CORP. HONEYWELL INTERNATIONAL CORP. Facility Status: Open - Site Assessment	9225 AVIATION 9225 AVIATION BOULEVARD	33 33	102 102
HONEYWELL INTERNATIONAL INC. (Facility Status: Open - Site Assessment	9851 SOUTH SEPULVEDA BL	41	131
HONEYWELL, INC. Facility Status: Open - Remediation	9851 SEPULVEDA BLVD	41	131

TC3139641.16 EXECUTIVE SUMMARY 12

EXECUTIVE SUMMARY

Site	Address	Map ID	Page
11105 LA CIENEGA PROPERTIES Facility Status: Open - Site Assessment	11105 S. LA CIENEGA BLV	91	269
RICHARD K. SQUIRE TRUST Facility Status: Open - Site Assessment	11100 HINDRY AVENUE	93	272
WATCH HOLDINGS, LLC Facility Status: Open - Site Assessment	11200 HINDRY AVENUE	95	273
WATCH HOLDINGS, LLC RAYTHEON C Facility Status: Open - Site Assessment	11200 HINDRY AVENUE	95	273
WATCH HOLDINGS, LLC FLYING TIGERS FREIGHT FLYING TIGERS Facility Status: Open	11200 HINDRY 5927 IMPERIAL 5927 W. IMPERIAL HWY	95 96 96	274 300 304
KOREAN AIRLINES FREIGHT Facility Status: Open - Site Assessment	6101 IMPERIAL HWY E	108	335
LAX - KOREAN AIRLINES Facility Status: Open - Site Assessment	6101 WEST IMPERIAL HIGH	108	337
LAX - KOREAN AIRLINES	6101 IMPERIAL	108	338

CHMIRS: The California Hazardous Material Incident Report System contains information on reported hazardous material incidents, i.e., accidental releases or spills. The source is the California Office of Emergency Services.

A review of the CHMIRS list, as provided by EDR, and dated 12/31/2010 has revealed that there are 58 CHMIRS sites within the searched area.

Site	Address	Map ID	Page
Not reported Date Completed: 25-JAN-89	452 S. ISIS AVENUE	7	12
Not reported Not reported Date Completed: 24-MAY-89	431 SOUTH ISIS AVE. 425 S ISIS AV	7 7	14 16
Not reported Date Completed: 25-JAN-88	425 S. ISIS	7	18
RHO-CHEM CORP Not reported Date Completed: 28-JUN-88	425 ISIS AVE 515 S HINDRY	7 8	20 37
Not reported Not reported Not reported Not reported Not reported Not reported Date Completed: 20-JUL-88	8732 BLERIOT AVE 7263 WEST 90TH ST 640 ISIS 7341 VISTA DEL MAR LANE 9000 AIRPORT BLVD HERTZ 9150 SOUTH SEPULVEDA BL 5630 ARBORVITAE ST ARBOR VITRE(ARID) LA CI	9 14 16 20 23 25 29 32	40 46 49 55 62 81 91 100
Not reported Not reported Not reported	9419 AIRPORT BLVD. 5780 WEST 96 TH ST 5735 96TH STREET	34 35 35	108 110 111

TC3139641.16 EXECUTIVE SUMMARY 14

EXECUTIVE SUMMARY

Site	Address	Map ID	Page
Not reported	5735 WEST 96TH ST	35	113
Not reported	5755 96TH STREET	35	114
Not reported	9620 SOUTH AIRPORT BLVD	36	115
Not reported	6221 W. 96TH ST	37	117
Not reported	6221 WEST 96TH STREET,	37	118
BUDGET RENT-A-CAR-LAX	9775 AIRPORT BLVD	38	127
Not reported	5900 WEST 98TH ST	40	129
Not reported	#3272 5552 WEST CENTURY	47	139
LAX AIR TRAFFIC CONTROL TOWER	1 WORLD WAY	51	163
FAA LAX CONTROL TOWER	1 WORLD	51	164
Not reported	LOS ANGELES INTERNATIONAL	59	177
Not reported	LAX-SATELLITE 9	62	185
Date Completed: 20-APR-90			
Not reported	5930 AVION DR.	65	191
Not reported	5510 W. 102ND ST.	69	194
Date Completed: 13-OCT-89			
Not reported	TERMINAL #7, LAX TERMIN	71	198
AMERICAN AIRLINES INC (EIS USE	7000 WORLD WAY WEST	75	203
Not reported	7000 WORLD WAY WEST LOS	75	209
Not reported	LAX, TWA MAINTENANCE BA	75	211
Not reported	7265 WORLD WAY WEST LAX	75	216
Not reported	104TH ST & AVIATION BL	78	221
Date Completed: 12-NOV-89			
Not reported	5400 WEST 104TH ST	79	223
PRO-TECH DESIGN & MFG INC	5220 WEST 104TH STREET	80	230
Date Completed: 28-APR-90			
Not reported	9900 LAX FUEL RD	81	232
Not reported	9900 LAX FUEL RD	81	233
Not reported	9900 LAXFUEL RD.	81	235
LAXFUEL CORP	9900 LAXFUEL RD	81	238
Not reported	LOS ANGELES AIRPORT 730	85	255
Not reported	LAX, 7401 WORLD WAY WES	86	256
Not reported	7401 WORLD WAY WEST	86	258
FEDERAL EXPRESS CORPORATION	7401 WORLD WAY WEST	86	260
Not reported	7401 WORLD WAY WEST FED	86	262
Not reported	600 WORLD WAY TERMINAL	87	266
Not reported	11101 SOUTH AVIATION BL	92	270
Not reported	6041 W. IMPERIAL HWY	98	309
Date Completed: 23-APR-90			
Not reported	6555 WEST IMPERIAL	100	312
Not reported	6851 WEST IMPERIAL	101	319
Not reported	5721 W. IMPERIAL HWY	102	321
Date Completed: 25-AUG-90			
Not reported	5721 W. IMPERIAL HIGHWA	102	322
Not reported	5811 IMPERIAL HWY	104	326
Not reported	5801 IMPERIAL HIGHWAY	104	327
Not reported	5600 W. IMPERIAL HWY	109	338

TC3139641.1s EXECUTIVE SUMMARY 15

EXECUTIVE SUMMARY

Please refer to the end of the findings report for unmapped orphan sites due to poor or inadequate address information.

TC3139641.1s EXECUTIVE SUMMARY 17

EXECUTIVE SUMMARY

RESPONSE: Identifies confirmed release sites where DTSC is involved in remediation, either in a lead or oversight capacity. These confirmed release sites are generally high-priority and high potential risk.

A review of the RESPONSE list, as provided by EDR, and dated 06/15/2011 has revealed that there is 1 RESPONSE site within the searched area.

Site	Address	Map ID	Page
TETRA GRAPHICS SITE	10310 GLASGOW PLACE	73	199

ENVIROSTOR: The Department of Toxic Substances Control's (DTSC's) Site Mitigation and Brownfields Reuse Program's (SMBRP's) EnviroStor database identifies sites that have known contamination or sites for which there may be reasons to investigate further. The database includes the following site types: Federal Superfund sites (National Priorities List (NPL)); State Response, including Military Facilities and State Superfund, Voluntary Cleanup, and School sites. EnviroStor provides similar information to the information that was available in CalSites, and provides additional site information, including, but not limited to, identification of formerly-contaminated properties that have been released for reuse, properties where environmental deed restrictions have been recorded to prevent inappropriate land uses, and risk characterization information that is used to assess potential impacts to public health and the environment at contaminated sites.

A review of the ENVIROSTOR list, as provided by EDR, and dated 06/15/2011 has revealed that there are 14 ENVIROSTOR sites within the searched area.

Site	Address	Map ID	Page
TYCO PRINTED CIRCUIT GRP. - IN	339 S. ISIS AVENUE	5	8
TYCO ELECTRONICS PRINTED CIRCU	339 ISIS AVE	5	9
Status: * Inactive			
RHO-CHEM CORP	425 ISIS AVE	7	20
Status: Refer: RCRA			
Status: Active			
ALAMO (SEE FILE #13957-2E)	9020 S AVIATION BLVD	18	52
Status: Refer: Other Agency			
LACEY 20 LLC	9920 LA CIENEGA BLVD	43	133
Status: * Inactive			
LOS ANGELES MUNICIPAL AIRPORT	1 WORLD WAY	52	168
Status: Active			
UNITED AIRLINES, LAXQ/LAX INT	6020 AVION DRIVE	64	187
Status: Refer: Other Agency			
TETRA GRAPHICS SITE	10310 GLASGOW PLACE	73	199
Status: Backlog			
HUGHES AIRCRAFT ARPT SITE	5340 W 104TH ST	77	219
Status: Refer: Other Agency			
MODERN PLATING COMPANY	5400 104TH STREET	79	224
Status: Active			
FANSTEEL INC	5235 W 104TH ST	80	227
Status: * Inactive			
AERO CALIFORNIA LAXMTO	7300 WORLD WAY WEST	85	254
Status: Refer: Other Agency			
GARRETT AVIATION SVCS. - CFC A	6201 W. IMPERIAL HIGHWA	97	306
INTERWEB	5251 W IMPERIAL HWY	111	340
Status: No Further Action			

TC3139641.1s EXECUTIVE SUMMARY 16

MAP FINDINGS SUMMARY

Database	Total Plotted
FEDERAL RECORDS	
NPL	0
Proposed NPL	0
NPL LIENS	0
CERCLIS	1
LIENS 2	0
CORRACTS	3
ERNS	88
HMIRS	196
DOT OPS	1
US BROWNFIELDS	0
FUDS	2
CONSENT	0
UMTRA	0
ODI	0
DEBRIS REGION 9	0
STATE AND LOCAL RECORDS	
HIST Cal-Sites	0
SCH	0
Toxic Pits	0
WMUDS/SWAT	1
Cortese	3
HIST CORTESE	51
LUST	60
SLIC	53
CHMIRS	58
MCS	0
VCP	0
RESPONSE	1
ENVIROSTOR	14
TRIBAL RECORDS	
INDIAN LUST	0
INDIAN VCP	0

NOTES:

Sites may be listed in more than one database

TC3139641.1s Page 1 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
1	AIRPORT BUSINESS CENTER 315 GLASGOW AVE S INGLEWOOD, CA 90391	HIST CORTESE LUST SLIC
CORTESE Region: CORTESE Facility County Code: 19 Reg By: LTNKA Reg Id: 903010025		S100683505 N/A
LUST: Region: STATE Global Id: T0603701357 Latitude: 33.959301 Longitude: -118.372318 Case Type: LUST Cleanup Site Status: Completed - Case Closed Status Date: 1996-10-04 00:00:00 Lead Agency: LOS ANGELES RWQCB (REGION 4) Case Worker: YR Local Agency: LOS ANGELES COUNTY RB Case Number: 903010025 LOC Case Number: Not reported File Location: Not reported Potential Media Affect: Soil Potential Contaminants of Concern: Waste Oil / Motor / Hydraulic / Lubricating Site History: Not reported		
Click here to access the California GeoTracker records for this facility:		
LUST: Global Id: T0603701357 Contact Type: Regional Board Caseworker Contact Name: YUE RONG Organization Name: LOS ANGELES RWQCB (REGION 4) Address: 320 W. 4TH ST., SUITE 200 City: Los Angeles Email: yrong@waterboards.ca.gov Phone Number: Not reported		
Global Id: T0603701357 Contact Type: Local Agency Caseworker Contact Name: JOHN AWUJO Organization Name: LOS ANGELES COUNTY Address: 900 S FREMONT AVE City: ALHAMBRA Email: Not reported Phone Number: 6264583507		
LUST: Global Id: T0603701357 Action Type: Other Date: 1950-01-01 00:00:00 Action: Leak Stopped		
Global Id: T0603701357 Action Type: Other Date: 1950-01-01 00:00:00 Action: Leak Discovery		

TC3139641.1s Page 2 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
	AIRPORT BUSINESS CENTER (Continued)	S100683505
Lat/Long: 33.9596362 / -1 Local Agency Staff: Not reported Beneficial Use: Not reported Priority: Not reported Cleanup Fund Id: Not reported Suspended: Not reported Assigned Name: Not reported Summary: OLD CASE #113090-09		
SLIC: Region: STATE Facility Status: Open - Site Assessment Status Date: 1998-02-09 00:00:00 Global Id: SLT4L7461863 Lead Agency: LOS ANGELES RWQCB (REGION 4) Lead Agency Case Number: Not reported Latitude: 33.95909463732 Longitude: -118.372342586517 Case Type: Cleanup Program Site Case Worker: TA Local Agency: Not reported RB Case Number: 0746 File Location: Not reported Potential Media Affected: Not reported Potential Contaminants of Concern: Not reported Site History: Not reported		
Click here to access the California GeoTracker records for this facility:		

2 **INTERSECTION / MANCHESTER AND EMERSON.** ERNS 90465887
INTERSECTION / MANCHESTER AND EMERSON. N/A
WESTCHESTER, CA

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

2 **INTERSECTION / MANCHESTER AND EMERSON.** ERNS 90179437
INTERSECTION / MANCHESTER AND EMERSON. N/A
WESTCHESTER, CA

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

TC3139641.1s Page 4 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
	AIRPORT BUSINESS CENTER (Continued)	S100683505
Global Id: T0603701357 Action Type: Other Date: 1950-01-01 00:00:00 Action: Leak Reported		
LUST REG 4: Region: 4 Regional Board: 04 County: Los Angeles facid: 903010025 Status: Case Closed Substance: Waste Oil Substance Quantity: Not reported Local Case No: Not reported Case Type: Soil Abatement Method Used at the Site: Excavate and Dispose Global Id: T0603701357 W Global ID: Not reported Staff: UNK Local Agency: 19000 Cross Street: OLIVE ST Enforcement Type: Not reported Date Leak Discovered: 8/15/1990 Date Leak First Reported: 9/17/1990 Date Leak Record Entered: 11/29/1990 Date Confirmation Began: Not reported Date Leak Stopped: 8/15/1990 Date Case Last Changed on Database: 2/24/1992 Date the Case was Closed: 10/4/1996 How Leak Discovered: Tank Closure How Leak Stopped: Not reported Cause of Leak: UNK Leak Source: UNK Operator: PENCE, J. BLAIR Water System: Not reported Well Name: Not reported Approx. Dist To Production Well (ft): 3012.5919411908955465355841436 Source of Cleanup Funding: UNK Preliminary Site Assessment Workplan Submitted: Not reported Preliminary Site Assessment Began: 9/17/1990 Pollution Characterization Began: Not reported Remediation Plan Submitted: Not reported Remedial Action Underway: 2/24/1992 Post Remedial Action Monitoring Began: Not reported Enforcement Action Date: Not reported Historical Max MTBE Date: Not reported Hist Max MTBE Conc in Groundwater: Not reported Hist Max MTBE Conc in Soil: Not reported Significant Interim Remedial Action Taken: Not reported GV Qualifier: Not reported Soil Qualifier: Not reported Organization: Not reported Owner Contact: Not reported Responsible Party: AIRPORT BUSINESS CENTER ASSOC. RP Address: 10201 S LA CIENEGA BLVD, LOS ANGELES, CA 90045 Program: LUST		

TC3139641.1s Page 3 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
3	WORLD SERVICE 8611 SEPULVEDA BLVD WESTCHESTER, CA 90045	LUST S102441378 N/A
LUST REG 4: Region: 4 Regional Board: 04 County: Los Angeles facid: 900450489 Status: Leak being confirmed Substance: 1 Substance Quantity: Not reported Local Case No: Not reported Case Type: Soil Abatement Method Used at the Site: Not reported Global Id: T0603701064 W Global ID: Not reported Staff: UNK Local Agency: 19050 Cross Street: Not reported Enforcement Type: Not reported Date Leak Discovered: Not reported Date Leak First Reported: 11/3/1995 Date Leak Record Entered: 9/25/1991 Date Confirmation Began: 9/25/1991 Date Leak Stopped: Not reported Date Case Last Changed on Database: 9/25/1991 Date the Case was Closed: Not reported How Leak Discovered: Not reported How Leak Stopped: Not reported Cause of Leak: Not reported Leak Source: Not reported Operator: Not reported Water System: Not reported Well Name: Not reported Approx. Dist To Production Well (ft): 9388.156913858291116402989194 Source of Cleanup Funding: Not reported Preliminary Site Assessment Workplan Submitted: Not reported Preliminary Site Assessment Began: Not reported Pollution Characterization Began: Not reported Remediation Plan Submitted: Not reported Remedial Action Underway: Not reported Post Remedial Action Monitoring Began: Not reported Enforcement Action Date: Not reported Historical Max MTBE Date: Not reported Hist Max MTBE Conc in Groundwater: Not reported Hist Max MTBE Conc in Soil: Not reported Significant Interim Remedial Action Taken: Not reported GV Qualifier: Not reported Soil Qualifier: Not reported Organization: Not reported Owner Contact: Not reported Responsible Party: BLANK RP RP Address: Not reported Program: LUST Lat/Long: 33.9571858 / -1 Local Agency Staff: PEJ Beneficial Use: Not reported Priority: Not reported		

TC3139641.1s Page 5 of 351

Map ID
Direction
Distance
Distance (ft.) Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

WORLD SERVICE (Continued)**S102441378**

Cleanup Fund Id: Not reported
Suspended: Not reported
Assigned Name: Not reported
Summary: 6/23/97 FAX 6/13/97/CALL 6/23/97 CPT. WILCOY LACFD CASE

3 **SPRING CLEANERS**
8611 SEPULVEDA BLVD
WESTCHESTER, CA 90045

HIST CORTESE **1001122719**
CAR000015529

CORTESE:
Region: CORTESE
Facility County Code: 19
Reg By: LTNKA
Reg Id: 900450489

4 **TTM PRINTED CIRCUIT GROUP INC - LOS ANGELES DIV**
8636 AVIATION BL
INGLEWOOD, CA 90301

CORRACTS **1000181709**
90301LCRT33

CORRACTS:

EPA ID: CAD008292005
EPA Region: 09
Area Name: AREAS 1 THRU 5
Actual Date: 02/26/1991
Action: CA075ME - CA Prioritization, Facility or area was assigned a medium corrective action priority
NAICS Code(s): 334412
Original schedule date: Bare Printed Circuit Board Manufacturing
Schedule end date: Not reported

EPA ID: CAD008292005
EPA Region: 09
Area Name: AREAS 1 THRU 5
Actual Date: 03/24/2003
Action: CA200 - RFI Approved
NAICS Code(s): 334412
Original schedule date: Bare Printed Circuit Board Manufacturing
Schedule end date: Not reported

EPA ID: CAD008292005
EPA Region: 09
Area Name: ENHANCED AREA 6
Actual Date: 04/03/2003
Action: CA200 - RFI Approved
NAICS Code(s): 334412
Original schedule date: Bare Printed Circuit Board Manufacturing
Schedule end date: Not reported

EPA ID: CAD008292005
EPA Region: 09
Area Name: AREAS 1 THRU 5
Actual Date: 04/03/2003

TC3139641.1s Page 6 of 351

Map ID
Direction
Distance
Distance (ft.) Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

TTM PRINTED CIRCUIT GROUP INC - LOS ANGELES DIV (Continued)**1000181709**

EPA Region: 09
Area Name: AREAS 1 THRU 5
Actual Date: 10/28/2003
Action: CA300 - CMS Workplan Approved
NAICS Code(s): 334412
Original schedule date: Bare Printed Circuit Board Manufacturing
Schedule end date: Not reported

EPA ID: CAD008292005
EPA Region: 09
Area Name: ENHANCED AREA 6
Actual Date: 11/02/2001
Action: CA150 - RFI Workplan Approved
NAICS Code(s): 334412
Original schedule date: Bare Printed Circuit Board Manufacturing
Schedule end date: Not reported

EPA ID: CAD008292005
EPA Region: 09
Area Name: AREAS 1 THRU 5
Actual Date: 12/14/2001
Action: CA150 - RFI Workplan Approved
NAICS Code(s): 334412
Original schedule date: Bare Printed Circuit Board Manufacturing
Schedule end date: Not reported

EPA ID: CAD008292005
EPA Region: 09
Area Name: ENHANCED AREA 6
Actual Date: 12/14/2001
Action: CA150 - RFI Workplan Approved
NAICS Code(s): 334412
Original schedule date: Bare Printed Circuit Board Manufacturing
Schedule end date: Not reported

5 **TYCO PRINTED CIRCUIT GRP. - INGLEWOOD**
339 S. ISIS AVENUE
INGLEWOOD, CA 90301

ENVIROSTOR **S110494400**
N/A

ENVIROSTOR:
Site Type: Tiered Permit
Site Type Detailed: Tiered Permit
Acres: Not reported
NPL: NO
Regulatory Agencies: NONE SPECIFIED
Lead Agency: NONE SPECIFIED
Program Manager: Not reported
Supervisor: Not reported
Division Branch: Cleanup Cypress
Facility ID: 71002176
Site Code: Not reported
Assembly: 51
Senate: 25
Special Program: Not reported

TC3139641.1s Page 8 of 351

Map ID
Direction
Distance
Distance (ft.) Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

TTM PRINTED CIRCUIT GROUP INC - LOS ANGELES DIV (Continued)**1000181709**

Action: CA200 - RFI Approved
NAICS Code(s): 334412
Original schedule date: Bare Printed Circuit Board Manufacturing
Schedule end date: Not reported

EPA ID: CAD008292005
EPA Region: 09
Area Name: AREAS 1 THRU 5
Actual Date: 07/31/2000
Action: CA150 - RFI Workplan Approved
NAICS Code(s): 334412
Original schedule date: Bare Printed Circuit Board Manufacturing
Schedule end date: Not reported

EPA ID: CAD008292005
EPA Region: 09
Area Name: AREAS 1 THRU 5
Actual Date: 10/07/2002
Action: CA150 - RFI Workplan Approved
NAICS Code(s): 334412
Original schedule date: Bare Printed Circuit Board Manufacturing
Schedule end date: Not reported

EPA ID: CAD008292005
EPA Region: 09
Area Name: ENHANCED AREA 6
Actual Date: 10/07/2002
Action: CA200 - RFI Approved
NAICS Code(s): 334412
Original schedule date: Bare Printed Circuit Board Manufacturing
Schedule end date: Not reported

EPA ID: CAD008292005
EPA Region: 09
Area Name: ENHANCED AREA 6
Actual Date: 10/07/2002
Action: CA150 - RFI Workplan Approved
NAICS Code(s): 334412
Original schedule date: Bare Printed Circuit Board Manufacturing
Schedule end date: Not reported

EPA ID: CAD008292005
EPA Region: 09
Area Name: ENHANCED AREA 6
Actual Date: 10/28/2003
Action: CA300 - CMS Workplan Approved
NAICS Code(s): 334412
Original schedule date: Bare Printed Circuit Board Manufacturing
Schedule end date: Not reported

EPA ID: CAD008292005

TC3139641.1s Page 7 of 351

Map ID
Direction
Distance
Distance (ft.) Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

TYCO PRINTED CIRCUIT GRP. - INGLEWOOD (Continued)**S110494400**

Status: Not reported
Status Date: Not reported
Restricted Use: NO
Site Mgmt. Req.: NONE SPECIFIED
Funding: Not reported
Latitude: 33.958764000000002
Longitude: -118.375798
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: NONE SPECIFIED
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: CAD008292005
Alias Type: EPA Identification Number
Alias Name: 71002176
Alias Type: Envirostor ID Number

Completed Info:
Completed Area Name: Not reported
Completed Sub Area Name: Not reported
Completed Document Type: Not reported
Completed Date: Not reported
Comments: Not reported

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

5 **TYCO ELECTRONICS PRINTED CIRCUIT GROUP - LA DIVISION**
339 ISIS AVE
INGLEWOOD, CA 90301

ENVIROSTOR **S107144549**
N/A

ENVIROSTOR:
Site Type: Corrective Action
Site Type Detailed: Corrective Action
Acres: 0
NPL: NO
Regulatory Agencies: SMBRP
Lead Agency: WM
Program Manager: Not reported
Supervisor: * Unknown
Division Branch: Cleanup Chatsworth
Facility ID: 80001546
Site Code: Not reported
Assembly: 51
Senate: 51
Special Program: Not reported
Status: * Inactive
Status Date: 2008-01-01 00:00:00
Restricted Use: NO
Site Mgmt. Req.: NONE SPECIFIED
Funding: Not reported

TC3139641.1s Page 9 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.)Site	Database(s)	EPA ID Number	
TYCO ELECTRONICS PRINTED CIRCUIT GROUP - LA DIVISION (Continued)			S107144549
Latitude: 33.95872972081598			
Longitude: -118.375668525596			
APN: 4126004010			
Past Use: NONE SPECIFIED			
Potential COC: NONE SPECIFIED			
Confirmed COC: NONE SPECIFIED			
Potential Description: NONE SPECIFIED			
Alias Name: 4126004010			
Alias Type: APN			
Alias Name: CAD008292005			
Alias Type: EPA Identification Number			
Alias Name: 80001546			
Alias Type: Envirostor ID Number			
Completed Info:			
Completed Area Name: PROJECT WIDE			
Completed Sub Area Name: Not reported			
Completed Document Type: Consent Order			
Completed Date: 1996-06-26 00:00:00			
Comments: Not reported			
Completed Area Name: Sites With No Operable Unit			
Completed Sub Area Name: Areas 1 thru 5			
Completed Document Type: RFI Workplan			
Completed Date: 2000-07-31 00:00:00			
Comments: Areas 1 thru 5			
Completed Area Name: Sites With No Operable Unit			
Completed Sub Area Name: Enhanced Area 6			
Completed Document Type: RFI Workplan			
Completed Date: 2001-11-02 00:00:00			
Comments: Enhanced Area 6			
Completed Area Name: Areas 1 thru 5, Enhanced Area 6			
Completed Sub Area Name: Not reported			
Completed Document Type: RFI Workplan			
Completed Date: 2001-12-14 00:00:00			
Comments: RFI for groundwater for both areas			
Completed Area Name: Sites With No Operable Unit			
Completed Sub Area Name: Areas 1 thru 5			
Completed Document Type: RFI Report			
Completed Date: 2003-03-24 00:00:00			
Comments: Not reported			
Completed Area Name: Areas 1 thru 5, Enhanced Area 6			
Completed Sub Area Name: Not reported			
Completed Document Type: RFI Report			
Completed Date: 2003-04-03 00:00:00			
Comments: Groundwater for both areas			
Completed Area Name: Areas 1 thru 5, Enhanced Area 6			
Completed Sub Area Name: Not reported			
Completed Document Type: Corrective Measures Study Workplan			
Completed Date: 2003-10-28 00:00:00			
Comments: Entire site			
Completed Area Name: Areas 1 thru 5, Enhanced Area 6			
TC3139641.1s			Page 10 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.)Site	Database(s)	EPA ID Number	
6	UNOCAL SERVICE STATION 8600 AVIATION BLVD UNOCAL SERVICE STATION 8600 AVIATION BLVD INGLEWOOD, CA	ERNS	96509621 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
6	SERVICE STATION 2365 8600 AVIATION SERVICE STATION 2365 8600 AVIATION INGLEWOOD, CA 90301	ERNS	90466122 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
6	SERVICE STATION 2365 8600 AVIATION SERVICE STATION 2365 8600 AVIATION INGLEWOOD, CA	ERNS	90187873 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
7	452 S. ISIS AVENUE INGLEWOOD, CA	CHMIRS	S100216764 N/A
CHMIRS:			
OES Incident Number: 8904559			
OES notification: Not reported			
OES Date: Not reported			
OES Time: Not reported			
Incident Date: 25-JAN-89			
Date Completed: 25-JAN-89			
Property Use: 700			
Agency Id Number: 19090			
Agency Incident Number: 89004711			
Time Notified: 1745			
Time Completed: 1912			
Surrounding Area: 700			
Estimated Temperature: 64			
Property Management: P			
Special Studies 1: Not reported			
Special Studies 2: Not reported			
Special Studies 3: Not reported			
Special Studies 4: Not reported			
Special Studies 5: Not reported			
Special Studies 6: Not reported			
More Than Two Substances Involved?: N			
Resp Agency Personnel # Of Decontaminated: 0			
Responding Agency Personnel # Of Injuries: 0			
TC3139641.1s			Page 12 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.)Site	Database(s)	EPA ID Number	
TYCO ELECTRONICS PRINTED CIRCUIT GROUP - LA DIVISION (Continued)			S107144549
Completed Sub Area Name: Not reported			
Completed Document Type: RFI Workplan			
Completed Date: 2002-10-07 00:00:00			
Comments: Offsite groundwater			
Completed Area Name: Sites With No Operable Unit			
Completed Sub Area Name: Enhanced Area 6			
Completed Document Type: RFI Report			
Completed Date: 2002-10-07 00:00:00			
Comments: Not reported			
Completed Area Name: PROJECT WIDE			
Completed Sub Area Name: Not reported			
Completed Document Type: Preliminary Assessment Report			
Completed Date: 1991-02-26 00:00:00			
Comments: Not reported			
Completed Area Name: PROJECT WIDE			
Completed Sub Area Name: Not reported			
Completed Document Type: Other Report			
Completed Date: 2010-02-02 00:00:00			
Comments: Not reported			
Completed Area Name: PROJECT WIDE			
Completed Sub Area Name: Not reported			
Completed Document Type: RCRA Facility Assessment Report			
Completed Date: 1989-09-19 00:00:00			
Comments: 17 SWMUs and 2 AOCs identified			
Future Area Name: Not reported			
Future Sub Area Name: Not reported			
Future Document Type: Not reported			
Future Due Date: Not reported			
Schedule Area Name: Not reported			
Schedule Sub Area Name: Not reported			
Schedule Document Type: Not reported			
Schedule Due Date: Not reported			
Schedule Revised Date: Not reported			
6	STATION 2365 8600 AVIATION STATION 2365 8600 AVIATION INGLEWOOD, CA 90301	ERNS	90188890 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
TC3139641.1s			Page 11 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.)Site	Database(s)	EPA ID Number	
(Continued)			S100216764
Responding Agency Personnel # Of Fatalities: 0			
Others Number Of Decontaminated: 0			
Others Number Of Injuries: 0			
Others Number Of Fatalities: 0			
Vehicle Make/year: Not reported			
Vehicle License Number: Not reported			
Vehicle State: Not reported			
Vehicle Id Number: Not reported			
CA/DOT/PUC/ICC Number: Not reported			
Company Name: Not reported			
Reporting Officer Name/ID: CAPTAIN PAUL MORGAN BADGE #13			
Report Date: 25-JAN-89			
Comments: Not reported			
Facility Telephone: 213 412-5356			
Waterway Involved: Not reported			
Waterway: Not reported			
Spill Site: Not reported			
Cleanup By: Not reported			
Containment: Not reported			
What Happened: Not reported			
Type: Not reported			
Measure: Not reported			
Other: Not reported			
Date/Time: Not reported			
Year: 88-92			
Agency: Not reported			
Incident Date: Not reported			
Admin Agency: Not reported			
Amount: Not reported			
Contained: Not reported			
Site Type: Not reported			
E Date: 02-MAY-90			
Substance: Not reported			
Quantity Released: Not reported			
BBLs: Not reported			
Cups: Not reported			
CUFT: Not reported			
Gallons: Not reported			
Grams: Not reported			
Pounds: Not reported			
Liters: Not reported			
Ounces: Not reported			
Pints: Not reported			
Quarts: Not reported			
Sheets: Not reported			
Tons: Not reported			
Unknown: Not reported			
Evacuations: Not reported			
Number of Injuries: Not reported			
Number of Fatalities: Not reported			
Description: Not reported			
TC3139641.1s			Page 13 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
7	PRINCE CHRYSLER PLYMOUTH 1030 MANCHESTER INGLEWOOD, CA 90301	HIST CORTESE SLIC S104404875 N/A
CORTSE: Region: CORTSE Facility County Code: 19 Reg By: LTNKA Reg Id: I-10847		
SLIC: Region: 4 Facility Status: No further action required SLIC: 0538E Substance: TPH/V Staff: Wendy Liu		

7	431 SOUTH ISIS AVE. INGLEWOOD, CA 90301	CHMIRS S105634993 N/A
CHMIRS: OES Incident Number: 3030 OES notification: Not reported OES Date: 7/8/1994 OES Time: 05:15:45 AM Incident Date: Not reported Date Completed: Not reported Property Use: Not reported Agency Id Number: Not reported Agency Incident Number: Not reported Time Notified: Not reported Time Completed: Not reported Surrounding Area: Not reported Estimated Temperature: Not reported Property Management: Not reported Special Studies 1: Not reported Special Studies 2: Not reported Special Studies 3: Not reported Special Studies 4: Not reported Special Studies 5: Not reported Special Studies 6: Not reported More Than Two Substances Involved?: Not reported Resp Agency Personnel # Of Decontaminated: Not reported Responding Agency Personnel # Of Injuries: Not reported Responding Agency Personnel # Of Fatalities: Not reported Others Number Of Decontaminated: Not reported Others Number Of Injuries: Not reported Others Number Of Fatalities: Not reported Vehicle Make/year: Not reported Vehicle License Number: Not reported Vehicle State: Not reported Vehicle Id Number: Not reported CA/DOT/PUC/ICC Number: Not reported Company Name: Not reported Reporting Officer Name/ID: Not reported Report Date: Not reported Comments: Not reported Facility Telephone: Not reported		

TC3139641.1s Page 14 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
7	425 S ISIS AV INGLEWOOD, CA 90301	CHMIRS S100274947 N/A
CHMIRS: OES Incident Number: 8906261 OES notification: Not reported OES Date: Not reported OES Time: Not reported Incident Date: 24-MAY-89 Date Completed: 24-MAY-89 Property Use: 962 Agency Id Number: 19090 Agency Incident Number: 29117 Time Notified: 1548 Time Completed: 1640 Surrounding Area: 600 Estimated Temperature: 70 Property Management: C Special Studies 1: Not reported Special Studies 2: Not reported Special Studies 3: Not reported Special Studies 4: Not reported Special Studies 5: Not reported Special Studies 6: Not reported More Than Two Substances Involved?: N Resp Agency Personnel # Of Decontaminated: 0 Responding Agency Personnel # Of Injuries: 0 Responding Agency Personnel # Of Fatalities: 0 Others Number Of Decontaminated: 0 Others Number Of Injuries: 0 Others Number Of Fatalities: 0 Vehicle Make/year: Not reported Vehicle License Number: Not reported Vehicle State: Not reported Vehicle Id Number: Not reported CA/DOT/PUC/ICC Number: Not reported Company Name: Not reported Reporting Officer Name/ID: GREG COLE Report Date: 24-MAY-89 Comments: Not reported Facility Telephone: 213 412-5350 Waterway Involved: Not reported Waterway: Not reported Spill Site: Not reported Cleanup By: Not reported Containment: Not reported What Happened: Not reported Type: Not reported Measure: Not reported Other: Not reported Date/Time: Not reported Year: 88-92 Agency: Not reported Incident Date: Not reported Admin Agency: Not reported Amount: Not reported Contained: Not reported Site Type: Not reported		

TC3139641.1s Page 16 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S105634993
Waterway Involved: NO Waterway: Not reported Spill Site: Not reported Cleanup By: Not reported Containment: Not reported What Happened: Not reported Type: VAPOR Measure: Not reported Other: Not reported Date/Time: Not reported Year: 1994 Agency: INGLEWOOD FD. Incident Date: 7/7/94 0916 Admin Agency: Not reported Amount: 100 LBS Contained: NO Site Type: OTHER E Date: Not reported Substance: CHLORYL DIFLORRYL METHANE Quantity Released: Not reported BBLs: Not reported Cups: Not reported CUFT: Not reported Gallons: Not reported Grams: Not reported Pounds: Not reported Liters: Not reported Ounces: Not reported Pints: Not reported Quarts: Not reported Sheen: Not reported Tons: Not reported Unknown: Not reported Evacuations: YES Number of Injuries: YES Number of Fatalities: NO Description: SEAL BROKE ON A PIPE AND CAUSED RELEASE.		

7	431 SOUTH ISIS AVE 431 SOUTH ISIS AVE INGLEWOOD, CA 90301	ERNS 94393403 N/A
---	---	-------------------------

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

TC3139641.1s Page 15 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S100274947
E Date: 11-MAY-90 Substance: Not reported Quantity Released: Not reported BBLs: Not reported Cups: Not reported CUFT: Not reported Gallons: Not reported Grams: Not reported Pounds: Not reported Liters: Not reported Ounces: Not reported Pints: Not reported Quarts: Not reported Sheen: Not reported Tons: Not reported Unknown: Not reported Evacuations: Not reported Number of Injuries: Not reported Number of Fatalities: Not reported Description: Not reported		

7	425 ISIS AVE. 425 ISIS AVE. INGLEWOOD, CA	ERNS 88464580 N/A
---	---	-------------------------

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

7	425 ISIS AVE 425 ISIS AVE INGLEWOOD, CA 90301	ERNS 91467274 N/A
---	---	-------------------------

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

7	425 ISIS AVE 425 ISIS AVE INGLEWOOD, CA	ERNS 91237207 N/A
---	---	-------------------------

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

TC3139641.1s Page 17 of 351

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
7	425 ISIS AVE 425 ISIS AVE INGLEWOOD, CA 90301	ERNS	91240259 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
7	425 ISI AVE 425 ISI AVE INGLEWOOD, CA 90301	ERNS	93333922 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
7	425 ISIS AVE 425 ISIS AVE INGLEWOOD, CA 90301	ERNS	93342524 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
7	425 S. ISIS INGLEWOOD, CA	CHMIRS	S100215537 N/A
CHMIRS:			
OES Incident Number: 8800040			
OES notification: Not reported			
OES Date: Not reported			
OES Time: Not reported			
Incident Date: 25-JAN-88			
Date Completed: 25-JAN-88			
Property Use: 600			
Agency Id Number: 19090			
Agency Incident Number: 4763			
Time Notified: 500			
Time Completed: 510			
Surrounding Area: 600			
Estimated Temperature: 62			
Property Management: P			
Special Studies 1: Not reported			
Special Studies 2: Not reported			
Special Studies 3: Not reported			
Special Studies 4: Not reported			
Special Studies 5: Not reported			
Special Studies 6: Not reported			
More Than Two Substances Involved?: N			
Resp Agency Personnel # Of Decontaminated: 0			
Responding Agency Personnel # Of Injuries: 0			
TC3139641.1s Page 18 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
7	425 ISIS AVE 425 ISIS AVE INGLEWOOD, CA	ERNS	90168818 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
7	425 ISIS AVE 425 ISIS AVE INGLEWOOD, CA	ERNS	8667721 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
7	RHO CHEM RHO CHEM INGLEWOOD, CA	ERNS	8857067 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
7	425 ISIS AVENUE 425 ISIS AVENUE INGLEWOOD, CA 90301	ERNS	90170229 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
7	RHO-CHEM CORP 425 ISIS AVE INGLEWOOD, CA 90301	CORRACTS HIST CORTESE LUST SLIC CHMIRS ENVIROSTOR	1000138536 CAD008364432
CORRACTS:			
EPA ID: CAD008364432			
EPA Region: 09			
Area Name: ENTIRE FACILITY			
Actual Date: 01/01/1901			
Action: CA021OP			
NAICS Code(s): 562211 562112			
Hazardous Waste Treatment and Disposal			
Hazardous Waste Collection			
TC3139641.1s Page 20 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
(Continued)		S100215537	
Responding Agency Personnel # Of Fatalities: 0			
Others Number Of Decontaminated: 0			
Others Number Of Injuries: 0			
Others Number Of Fatalities: 0			
Vehicle Make/year: Not reported			
Vehicle License Number: Not reported			
Vehicle State: Not reported			
Vehicle Id Number: Not reported			
CA/DOT/PUC/ICC Number: Not reported			
Company Name: Not reported			
Reporting Officer Name/ID: CAPT. PAUL MORGAN / BARGE #13			
Report Date: 02-FEB-88			
Comments: Y			
Facility Telephone: 213 412-5356			
Waterway Involved: Not reported			
Waterway: Not reported			
Spill Site: Not reported			
Cleanup By: Not reported			
Containment: Not reported			
What Happened: Not reported			
Type: Not reported			
Measure: Not reported			
Other: Not reported			
Date/Time: Not reported			
Year: 88-92			
Agency: Not reported			
Incident Date: Not reported			
Admin Agency: Not reported			
Amount: Not reported			
Contained: Not reported			
Site Type: Not reported			
E Date: Not reported			
Substance: Not reported			
Quantity Released: Not reported			
BBLs: Not reported			
Cups: Not reported			
CUFT: Not reported			
Gallons: Not reported			
Grams: Not reported			
Pounds: Not reported			
Liters: Not reported			
Ounces: Not reported			
Pints: Not reported			
Quarts: Not reported			
Sheen: Not reported			
Tons: Not reported			
Unknown: Not reported			
Evacuations: Not reported			
Number of Injuries: Not reported			
Number of Fatalities: Not reported			
Description: Not reported			
TC3139641.1s Page 19 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
RHO-CHEM CORP (Continued)			1000138536
Original schedule date: Not reported			
Schedule end date: Not reported			
EPA ID: CAD008364432			
EPA Region: 09			
Area Name: ENTIRE FACILITY			
Actual Date: 01/10/1994			
Action: CA140 - RFI Workplan Notice Of Deficiency Issued			
NAICS Code(s): 562211 562112			
Hazardous Waste Treatment and Disposal			
Hazardous Waste Collection			
Original schedule date: Not reported			
Schedule end date: Not reported			
EPA ID: CAD008364432			
EPA Region: 09			
Area Name: ENTIRE FACILITY			
Actual Date: 02/23/1994			
Action: CA150 - RFI Workplan Approved			
NAICS Code(s): 562211 562112			
Hazardous Waste Treatment and Disposal			
Hazardous Waste Collection			
Original schedule date: Not reported			
Schedule end date: Not reported			
EPA ID: CAD008364432			
EPA Region: 09			
Area Name: SOIL			
Actual Date: 04/09/1992			
Action: CA150 - RFI Workplan Approved			
NAICS Code(s): 562211 562112			
Hazardous Waste Treatment and Disposal			
Hazardous Waste Collection			
Original schedule date: Not reported			
Schedule end date: Not reported			
EPA ID: CAD008364432			
EPA Region: 09			
Area Name: GROUNDWATER			
Actual Date: 04/09/1992			
Action: CA150 - RFI Workplan Approved			
NAICS Code(s): 562211 562112			
Hazardous Waste Treatment and Disposal			
Hazardous Waste Collection			
Original schedule date: Not reported			
Schedule end date: Not reported			
TC3139641.1s Page 21 of 351			

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.)Site	Database(s)	EPA ID Number	
RHO-CHEM CORP (Continued)			1000138536
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	PHASE I RESIDENTIAL SOIL VAPOR		
Actual Date:	04/14/2005		
Action:	CA150 - RFI Workplan Approved		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	05/03/1991		
Action:	CA100 - RFI Imposition		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	05/06/1999		
Action:	CA750NO - Migration of Contaminated Groundwater under Control, Unacceptable migration of contaminated groundwater is observed or expected		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	05/06/1999		
Action:	CA725NO - Current Human Exposures Under Control, Current human exposures are NOT under control		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	05/08/2000		
Action:	CA725NO - Current Human Exposures Under Control, Current human exposures are NOT under control		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		

TC3139641.1s Page 22 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.)Site	Database(s)	EPA ID Number	
RHO-CHEM CORP (Continued)			1000138536
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	09/01/1988		
Action:	CA049PA		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	09/01/1988		
Action:	CA029ST		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	09/02/1992		
Action:	CA225IN - Stabilization Measures Evaluation, This facility is not amenable to stabilization activity because of a lack of technical data. An evaluation has been completed, but further data is necessary to determine stabilization measures, feasibility or appropriateness. This status should be changed when data becomes available		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	09/02/1992		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	09/02/1992		
Action:	CA225IN - Stabilization Measures Evaluation, This facility is not amenable to stabilization activity because of a lack of technical data. An evaluation has been completed, but further data is necessary to determine stabilization measures, feasibility or appropriateness. This status should be changed when data becomes available		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		

TC3139641.1s Page 24 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.)Site	Database(s)	EPA ID Number	
RHO-CHEM CORP (Continued)			1000138536
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	05/08/2000		
Action:	CA750NO - Migration of Contaminated Groundwater under Control, Unacceptable migration of contaminated groundwater is observed or expected		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	06/03/2005		
Action:	CA150 - RFI Workplan Approved		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	GROUNDWATER		
Actual Date:	06/30/2005		
Action:	CA150 - RFI Workplan Approved		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	PHASE I RESIDENTIAL SOIL VAPOR		
Actual Date:	06/30/2006		
Action:	CA200 - RFI Approved		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	09/01/1988		
Action:	CA075ME - CA Prioritization, Facility or area was assigned a medium corrective action priority		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		

TC3139641.1s Page 23 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.)Site	Database(s)	EPA ID Number	
RHO-CHEM CORP (Continued)			1000138536
Area Name:	ENTIRE FACILITY		
Actual Date:	09/02/1992		
Action:	CA075H - CA Prioritization, Facility or area was assigned a high corrective action priority		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	09/14/1988		
Action:	CA070YE - RFA Determination Of Need For An RFI, RFI is Necessary		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	09/14/1988		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	09/14/1988		
Action:	CA050 - RFA Completed		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	09/14/1988		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	ENTIRE FACILITY		
Actual Date:	09/14/1988		
Action:	CA050RF - RFA Completed, Assessment was an RFA		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		
Area Name:	SOIL		
Actual Date:	12/27/2005		
Action:	CA725YE - Current Human Exposures Under Control, Yes, Current Human Exposures Under Control has been verified		
NAICS Code(s):	562211 562112		
	Hazardous Waste Treatment and Disposal		
	Hazardous Waste Collection		
Original schedule date:	Not reported		
Schedule end date:	Not reported		
EPA ID:	CAD008364432		
EPA Region:	09		

TC3139641.1s Page 25 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
RHO-CHEM CORP (Continued)		1000138536
Area Name:	ENTIRE FACILITY	
Actual Date:	12/27/2005	
Action:	CA725YE - Current Human Exposures Under Control, Yes, Current Human Exposures Under Control has been verified	
NAICS Code(s):	562211 562112	
	Hazardous Waste Treatment and Disposal	
	Hazardous Waste Collection	
Original schedule date:	Not reported	
Schedule end date:	Not reported	
EPA ID:	CAD008364432	
EPA Region:	09	
Area Name:	GROUNDWATER	
Actual Date:	12/27/2005	
Action:	CA725YE - Current Human Exposures Under Control, Yes, Current Human Exposures Under Control has been verified	
NAICS Code(s):	562211 562112	
	Hazardous Waste Treatment and Disposal	
	Hazardous Waste Collection	
Original schedule date:	Not reported	
Schedule end date:	Not reported	
CORTESE:		
Region:	CORTESE	
Facility County Code:	19	
Reg By:	LTNKA	
Reg Id:	I-9991	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	I-9991	
Status:	Pollution Characterization	
Substance:	Solvents	
Substance Quantity:	Not reported	
Local Case No.:	Not reported	
Case Type:	Groundwater	
Abatement Method Used at the Site:	Not reported	
Global ID:	T0603704505	
W Global ID:	Not reported	
Staff:	TOX	
Local Agency:	19000	
Cross Street:	Not reported	
Enforcement Type:	Not reported	
Date Leak Discovered:	Not reported	
Date Leak First Reported:	11/18/1983	
Date Leak Record Entered:	12/31/1986	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	6/16/2000	
Date the Case was Closed:	Not reported	
How Leak Discovered:	Not reported	
How Leak Stopped:	Not reported	
Cause of Leak:	UNK	
Leak Source:	UNK	

TC3139641.1s Page 26 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
RHO-CHEM CORP (Continued)		1000138536
OES Date:	9/17/1993	
OES Time:	01:34:27 PM	
Incident Date:	Not reported	
Date Completed:	Not reported	
Property Use:	Not reported	
Agency Id Number:	Not reported	
Agency Incident Number:	Not reported	
Time Notified:	Not reported	
Time Completed:	Not reported	
Surrounding Area:	Not reported	
Estimated Temperature:	Not reported	
Property Management:	Not reported	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	Not reported	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DOIT/PUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	YES	
Waterway:	Not reported	
Spill Site:	Not reported	
Cleanup By:	R/P DID CLEANUP	
Containment:	Not reported	
What Happened:	Not reported	
Type:	CHEMICAL	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	1993	
Agency:	SOUTHBOUND ENVIROMENTAL SYSTEMS	
Incident Date:	09/17/93 1110	
Admin Agency:	Not reported	
Amount:	55 GAL DRUM	
Contained:	NO	
Site Type:	PL	
E Date:	Not reported	
Substance:	UNKNOWN	
Quantity Released:	Not reported	
BBLs:	Not reported	
Cups:	Not reported	

TC3139641.1s Page 28 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
RHO-CHEM CORP (Continued)		1000138536
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	3876.9895349611718847999769547	
Source of Cleanup Funding:	UNK	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	6/16/2000	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	BLANK RP	
RP Address:	Not reported	
Program:	SLIC	
Lat/Long:	33.9577782 / -1	
Local Agency Staff:	Not reported	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	SUSPECTED SOURCE IS SURFACE SPILLAGE - TANKS TESTED TIGHT. 1/18/00 CLASS I PERMIT	
SLIC:		
Region:	STATE	
Facility Status:	Open - Site Assessment	
Status Date:	2000-06-18 00:00:00	
Global ID:	T0603704505	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Lead Agency Case Number:	Not reported	
Latitude:	33.9577782	
Longitude:	-118.3754143	
Case Type:	Cleanup Program Site	
Case Worker:	DDD	
Local Agency:	LOS ANGELES COUNTY	
RB Case Number:	I-9991	
File Location:	Not reported	
Potential Media Affected:	Aquifer used for drinking water supply	
Potential Contaminants of Concern:	* Solvents	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
CHMIRS:		
OES Incident Number:	60398	
OES notification:	Not reported	

TC3139641.1s Page 27 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
RHO-CHEM CORP (Continued)		1000138536
CUFF:	Not reported	
Gallons:	Not reported	
Grams:	Not reported	
Pounds:	Not reported	
Liters:	Not reported	
Ounces:	Not reported	
Pints:	Not reported	
Quarts:	Not reported	
Sheen:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	
Evacuations:	NO	
Number of Injuries:	NO	
Number of Fatalities:	NO	
Description:	CHEMICAL REACTION INSIDE OF A 55 GAL DRUM, SMALL AMOUNT SPILLED ONTO THE GROUND WITHIN THE CONTAINMENT AREA.	
OES Incident Number:	99-2127	
OES notification:	5/18/199910:41:39 AM	
OES Date:	Not reported	
OES Time:	Not reported	
Incident Date:	Not reported	
Date Completed:	Not reported	
Property Use:	Not reported	
Agency Id Number:	Not reported	
Agency Incident Number:	Not reported	
Time Notified:	Not reported	
Time Completed:	Not reported	
Surrounding Area:	Not reported	
Estimated Temperature:	Not reported	
Property Management:	Not reported	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	Not reported	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DOIT/PUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	No	
Waterway:	Not reported	
Spill Site:	Not reported	

TC3139641.1s Page 29 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
RHO-CHEM CORP (Continued)		1000138536
Cleanup By:	None Required	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	1999	
Agency:	Ro-Chem Inc	
Incident Date:	5/18/1999 12:00:00 AM	
Admin Agency:	Inglewood Fire Department	
Amount:	Not reported	
Contained:	Yes	
Site Type:	Merchant/Business	
E Date:	Not reported	
Substance:	Bromo Phiohene	
Quantity Released:	Not reported	
BBLs:	0	
Cups:	0	
CUFF:	0	
Gallons:	0	
Grams:	0	
Pounds:	0	
Liters:	0	
Ounces:	1	
Pints:	0	
Quarts:	0	
Sheen:	0	
Tons:	0	
Unknown:	0	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	Lab pac of material taken in and one inner container was open and when the drum was open the substance was released to the air	
ENVIROSTOR:		
Site Type:	Historical	
Site Type Detailed:	* Historical	
Acres:	Not reported	
NPL:	NO	
Regulatory Agencies:	NONE SPECIFIED	
Lead Agency:	NONE SPECIFIED	
Program Manager:	Not reported	
Supervisor:	Referred - Not Assigned	
Division Branch:	Cleanup Chatsworth	
Facility ID:	15290198	
Site Code:	Not reported	
Assembly:	51	
Senate:	25	
Special Program:	Not reported	
Status:	Refer: RCRA	
Status Date:	1995-08-25 00:00:00	
Restricted Use:	NO	
Site Mgmt. Req.:	NONE SPECIFIED	
Funding:	Not reported	
Latitude:	33.957856882556698	

TC3139641.1s Page 30 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
RHO-CHEM CORP (Continued)		1000138536
Potential COC:	HAZARDOUS WASTE TREATMENT, LABORATORIES- CHEMICAL, MANUFACTURING - CHEMICALS, RECYCLING - DRUM, RECYCLING - OTHER, ABOVE GROUND STORAGE TANKS, DISTRIBUTOR - CHEMICAL, TRANSFER STATION, HAZARDOUS WASTE STORAGE - TANKS/CONTAINERS, HAZARDOUS WASTE TREATMENT, LABORATORIES- CHEMICAL, MANUFACTURING - CHEMICALS, UNDERGROUND STORAGE TANKS	
Confirmed COC:	30003, 30012, 30026, 30027, 30028, 30246, 30272, 30276, 30336, 30364, 30550, 30022, 30026, 30027, 30028, 30246, 30550, 30593	
Potential Description:	IA, OTH, SED, SOIL, SV, OTH, SOIL, SV	
Alias Name:	4126003020	
Alias Type:	APN	
Alias Name:	CAD008364432	
Alias Type:	EPA Identification Number	
Alias Name:	300226	
Alias Type:	Project Code (Site Code)	
Alias Name:	19290198	
Alias Type:	Envirostor ID Number	
Alias Name:	80001571	
Alias Type:	Envirostor ID Number	
Completed Info:		
Completed Area Name:	Sites With No Operable Unit	
Completed Sub Area Name:	ENTIRE FACILITY	
Completed Document Type:	* Historical Operating Permit Authority	
Completed Date:	1991-05-03 00:00:00	
Comments:	Not reported	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	* Historical Operating Permit Authority	
Completed Date:	1990-11-26 00:00:00	
Comments:	Not reported	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Consent Order	
Completed Date:	2002-11-25 00:00:00	
Comments:	Not reported	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Correspondence	
Completed Date:	2010-02-02 00:00:00	
Comments:	Completed, additional work under SVE IM	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Correspondence - Received	
Completed Date:	2009-03-27 00:00:00	
Comments:	Not reported	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Other Report	
Completed Date:	2009-04-15 00:00:00	
Comments:	Not reported	

TC3139641.1s Page 32 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
RHO-CHEM CORP (Continued)		1000138536
Longitude:	-118.37579418707401	
APN:	4126003020	
Past Use:	NONE SPECIFIED	
Potential COC:	10009, 10065, 10199, 30018, 30153	
Confirmed COC:	NONE SPECIFIED	
Potential Description:	NONE SPECIFIED	
Alias Name:	AMERICAN BETTER CHEMICALS CORPORATION	
Alias Type:	Alternate Name	
Alias Name:	4126003020	
Alias Type:	APN	
Alias Name:	CAD008364432	
Alias Type:	EPA Identification Number	
Alias Name:	15290198	
Alias Type:	Envirostor ID Number	
Completed Info:		
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	* Discovery	
Completed Date:	1990-03-20 00:00:00	
Comments:	FACILITY IDENTIFIED IW SURVEY QUESTIONNAIRE 12580 QUESTIONNAIRE RECEIVED. >1000GAL/YR WAST FLAMMABLE LIQ WASTE DISP AT BKK. STILL BOTTOMS DISP AT PV LANDFILL	
Future Area Name:	Not reported	
Future Sub Area Name:	Not reported	
Future Document Type:	Not reported	
Future Due Date:	Not reported	
Schedule Area Name:	Not reported	
Schedule Sub Area Name:	Not reported	
Schedule Document Type:	Not reported	
Schedule Due Date:	Not reported	
Schedule Revised Date:	Not reported	
Site Type:	Corrective Action	
Site Type Detailed:	Corrective Action	
Acres:	0.75	
NPL:	NO	
Regulatory Agencies:	SMBRP	
Lead Agency:	WM	
Program Manager:	RICHARD ALLEN	
Supervisor:	Rita Kamat	
Division Branch:	Cleanup Chatsworth	
Facility ID:	80001571	
Site Code:	300226	
Assembly:	51	
Senate:	25	
Special Program:	Not reported	
Status:	Active	
Status Date:	2008-01-01 00:00:00	
Restricted Use:	NO	
Site Mgmt. Req.:	NONE SPECIFIED	
Funding:	Not reported	
Latitude:	33.957795389580397	
Longitude:	-118.37589383125299	
APN:	4126003020	
Past Use:	ABOVE GROUND STORAGE TANKS, DEGREASING FACILITY, TRANSFER STATION, HAZARDOUS WASTE HAULER, HAZARDOUS WASTE STORAGE - TANKS/CONTAINERS,	

TC3139641.1s Page 31 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
RHO-CHEM CORP (Continued)		1000138536
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	RFI Workplan	
Completed Date:	2009-09-01 00:00:00	
Comments:	Not reported	
Completed Area Name:	Sites With No Operable Unit	
Completed Sub Area Name:	ENTIRE FACILITY	
Completed Document Type:	RFI Workplan	
Completed Date:	2005-06-03 00:00:00	
Comments:	Site wide shallow vadose zone soil gas investigation.	
Completed Area Name:	GROUNDWATER, SOIL	
Completed Sub Area Name:	Not reported	
Completed Document Type:	RFI Workplan	
Completed Date:	1992-04-09 00:00:00	
Comments:	Not reported	
Completed Area Name:	Sites With No Operable Unit	
Completed Sub Area Name:	PHASE I RESIDENTIAL SOIL VAPOR	
Completed Document Type:	RFI Report	
Completed Date:	2005-06-30 00:00:00	
Comments:	Focused RFI - Residential Soil Vapor Survey. EI required	
Completed Area Name:	Sites With No Operable Unit	
Completed Sub Area Name:	GROUNDWATER	
Completed Document Type:	RFI Workplan	
Completed Date:	2005-06-30 00:00:00	
Comments:	RCRA facility investigation for on and off-site groundwater.	
Completed Area Name:	Sites With No Operable Unit	
Completed Sub Area Name:	PHASE I RESIDENTIAL SOIL VAPOR	
Completed Document Type:	RFI Workplan	
Completed Date:	2005-04-14 00:00:00	
Comments:	PHASE I RESIDENTIAL INDOOR AIR	
Completed Area Name:	ENTIRE FACILITY, PHASE I RESIDENTIAL SOIL VAP	
Completed Sub Area Name:	Not reported	
Completed Document Type:	RFI Workplan	
Completed Date:	1994-02-23 00:00:00	
Comments:	Not reported	
Completed Area Name:	Sites With No Operable Unit	
Completed Sub Area Name:	ENTIRE FACILITY	
Completed Document Type:	Preliminary Assessment Report	
Completed Date:	1988-09-01 00:00:00	
Comments:	Not reported	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	RFI Workplan	
Completed Date:	2009-09-08 00:00:00	
Comments:	Not reported	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	RFI Report	

TC3139641.1s Page 33 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
RHO-CHEM CORP (Continued)		1000138536
Completed Date:	2011-02-01 00:00:00	
Comments:	Not reported	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Technical Report	
Completed Date:	2009-10-15 00:00:00	
Comments:	Not reported	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Monitoring Report	
Completed Date:	2010-01-13 00:00:00	
Comments:	Complete, accepted as routine deliverable	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Monitoring Report	
Completed Date:	2010-01-13 00:00:00	
Comments:	Complete, Routine report accepted without DTSC approval	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Monitoring Report	
Completed Date:	2010-01-13 00:00:00	
Comments:	Completed, routine report no approval necessary	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Monitoring Report	
Completed Date:	2009-01-13 00:00:00	
Comments:	completed, routine document no approval needed by DTSC	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Monitoring Report	
Completed Date:	2010-01-13 00:00:00	
Comments:	completed, no DTSC approval required	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Monitoring Report	
Completed Date:	2010-01-13 00:00:00	
Comments:	Complete, no DTSC approval required	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Monitoring Report	
Completed Date:	2010-01-13 00:00:00	
Comments:	Complete, routine document no approval necessary	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Monitoring Report	
Completed Date:	2010-01-13 00:00:00	
Comments:	Completed, No DTSC approval Necessary	

TC3139641.1s Page 34 of 351

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Distance	
Distance (ft.)	Site	Database(s)	
EPA ID Number			
RHO-CHEM CORP (Continued)		1000138536	
Completed Area Name:	PROJECT WIDE		
Completed Sub Area Name:	Not reported		
Completed Document Type:	Other Report		
Completed Date:	2010-08-02 00:00:00		
Comments:	Status report in an Information only document that does not require DTSC approval		
Completed Area Name:	PROJECT WIDE		
Completed Sub Area Name:	Not reported		
Completed Document Type:	Pilot Study/Treatability Workplan		
Completed Date:	2010-12-28 00:00:00		
Comments:	Not reported		
Completed Area Name:	PROJECT WIDE		
Completed Sub Area Name:	Not reported		
Completed Document Type:	RFI Report		
Completed Date:	2011-02-16 00:00:00		
Comments:	Not reported		
Completed Area Name:	PROJECT WIDE		
Completed Sub Area Name:	Not reported		
Completed Document Type:	Technical Report		
Completed Date:	2010-10-07 00:00:00		
Comments:	Groundwater Monitoring report, no comments required		
Completed Area Name:	PROJECT WIDE		
Completed Sub Area Name:	Not reported		
Completed Document Type:	RFI Report		
Completed Date:	2011-02-16 00:00:00		
Comments:	Document approved; no revision required		
Completed Area Name:	PROJECT WIDE		
Completed Sub Area Name:	Not reported		
Completed Document Type:	Technical Report		
Completed Date:	2011-01-18 00:00:00		
Comments:	Routine Groundwater report, No approval letter required		
Completed Area Name:	PROJECT WIDE		
Completed Sub Area Name:	Not reported		
Completed Document Type:	Technical Report		
Completed Date:	2011-04-07 00:00:00		
Comments:	Not reported		
Completed Area Name:	PROJECT WIDE		
Completed Sub Area Name:	Not reported		
Completed Document Type:	Interim Measures Workplan		
Completed Date:	2011-06-07 00:00:00		
Comments:	Not reported		
Completed Area Name:	Sites With No Operable Unit		
Completed Sub Area Name:	ENTIRE FACILITY		
Completed Document Type:	Interim Measures Questionnaire		
Completed Date:	1992-09-02 00:00:00		
Comments:	Not reported		
Completed Area Name:	Sites With No Operable Unit		
Completed Sub Area Name:	ENTIRE FACILITY		

TC3139641.1s Page 36 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
RHO-CHEM CORP (Continued)		1000138536
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Monitoring Report	
Completed Date:	2010-01-14 00:00:00	
Comments:	complete, no DTSC approval required	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Other Report	
Completed Date:	2010-01-14 00:00:00	
Comments:	completed, no DTSC approval required	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Technical Report	
Completed Date:	2010-01-14 00:00:00	
Comments:	completed, no DTSC approval required	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Monitoring Report	
Completed Date:	2010-01-19 00:00:00	
Comments:	Just now uploading this document the requires no approval for DTSC	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Monitoring Report	
Completed Date:	2010-01-19 00:00:00	
Comments:	Completed, requires no DTSC approval	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Other Report	
Completed Date:	2010-01-19 00:00:00	
Comments:	Completed, old site data	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Correspondence - Received	
Completed Date:	2010-04-12 00:00:00	
Comments:	Letter was not required, Facility chose to alter plans for SVE requirements so as to not involve city and therefore City permits would not be required.	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Monitoring Report	
Completed Date:	2010-02-04 00:00:00	
Comments:	Completed, No approval by DTSC required, part of on-going GW monitoring program	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Technical Report	
Completed Date:	2010-07-22 00:00:00	
Comments:	This document is complete	

TC3139641.1s Page 35 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
RHO-CHEM CORP (Continued)		1000138536
Completed Document Type:	RCRA Facility Assessment Report	
Completed Date:	1988-09-14 00:00:00	
Comments:	Not reported	
Future Area Name:	PROJECT WIDE	
Future Sub Area Name:	Not reported	
Future Document Type:	Interim Measures Implementation Report	
Future Due Date:	2011	
Schedule Area Name:	Not reported	
Schedule Sub Area Name:	Not reported	
Schedule Document Type:	Not reported	
Schedule Due Date:	Not reported	
Schedule Revised Date:	Not reported	

8

515 S HINDRY INGLEWOOD, CA 90301		CHMIRS S100216187 N/A
CHMIRS:		
OES Incident Number:	8802411	
OES notification:	Not reported	
OES Date:	Not reported	
OES Time:	Not reported	
Incident Date:	28-JUN-88	
Date Completed:	28-JUN-88	
Property Use:	099	
Agency Id Number:	19090	
Agency Incident Number:	37402	
Time Notified:	1326	
Time Completed:	1400	
Surrounding Area:	600	
Estimated Temperature:	85	
Property Management:	P	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	N	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	1	
Others Number Of Fatalities:	Not reported	
Vehicle Make/year:	FORD VAN	
Vehicle License Number:	Not reported	
Vehicle State:	CA	
Vehicle Id Number:	Not reported	
CA/DOT/PUC/IOC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	RICAHRD B PFIEFFER	
Report Date:	15-JUL-88	
Comments:	Y	
Facility Telephone:	213 412-5350	
Waterway Involved:	Not reported	
Waterway:	Not reported	

TC3139641.1s Page 37 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
(Continued)		S100216187
Spill Site:	Not reported	
Cleanup By:	Not reported	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	88-92	
Agency:	Not reported	
Incident Date:	Not reported	
Admin Agency:	Not reported	
Amount:	Not reported	
Contained:	Not reported	
Site Type:	Not reported	
E Date:	Not reported	
Substance:	Not reported	
Quantity Released:	Not reported	
BBLs:	Not reported	
Cups:	Not reported	
CUFF:	Not reported	
Gallons:	Not reported	
Grams:	Not reported	
Pounds:	Not reported	
Liters:	Not reported	
Ounces:	Not reported	
Pints:	Not reported	
Quarts:	Not reported	
Sheen:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	
Evacuations:	Not reported	
Number of Injuries:	Not reported	
Number of Fatalities:	Not reported	
Description:	Not reported	

8	AVAYA PROPERTY 400 HINDRY INGLEWOOD, CA 90301	SLIC	S105219911 N/A
SLIC:			
Region:	4		
Facility Status:	Site Assessment		
SLIC:	1071		
Substance:	VOCs		
Staff:	PGN		

TC3139641.1s Page 38 of 351

Map ID

Direction

Distance

Distance (ft.)Site

9

8732 BLERIOT AVE
LOS ANGELES, CA 90045

CHMIRS

S110420938
N/A

Map ID

Direction

Distance

Distance (ft.)Site

9

8732 BLERIOT AVE
LOS ANGELES, CA 90045

CHMIRS

S110420938
N/A

CHMIRS:

OES Incident Number:

'08-9271

OES notification:

12/31/2008 9:02:30 AM

OES Date:

Not reported

OES Time:

Not reported

Incident Date:

Not reported

Date Completed:

Not reported

Property Use:

Not reported

Agency Id Number:

Not reported

Agency Incident Number:

Not reported

Time Notified:

Not reported

Time Completed:

Not reported

Surrounding Area:

Not reported

Estimated Temperature:

Not reported

Property Management:

Not reported

Special Studies 1:

Not reported

Special Studies 2:

Not reported

Special Studies 3:

Not reported

Special Studies 4:

Not reported

Special Studies 5:

Not reported

Special Studies 6:

Not reported

More Than Two Substances Involved?:

Not reported

Resp Agency Personnel # Of Decontaminated:

Not reported

Responding Agency Personnel # Of Injuries:

Not reported

Responding Agency Personnel # Of Fatalities:

Not reported

Others Number Of Decontaminated:

Not reported

Others Number Of Injuries:

Not reported

Others Number Of Fatalities:

Not reported

Vehicle Make/year:

Not reported

Vehicle License Number:

Not reported

Vehicle State:

Not reported

Vehicle Id Number:

Not reported

CAD/OT/PUC/ICC Number:

Not reported

Company Name:

Not reported

Reporting Officer Name/ID:

Not reported

Report Date:

Not reported

Comments:

Not reported

Facility Telephone:

Not reported

Waterway Involved:

No

Waterway:

Not reported

Spill Site:

Airport/Residence

Cleanup By:

Unknown

Containment:

Not reported

What Happened:

Not reported

Type:

Not reported

Measure:

Unknown

Other:

Not reported

Date/Time:

0830

Year:

2008

Agency:

NRC

Incident Date:

12/31/2008

Admin Agency:

Los Angeles City Fire Department

Amount:

Not reported

Contained:

Unknown

Site Type:

Not reported

TC3139641.1s Page 40 of 351

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Distance	
Distance (ft.)	Site	Database(s)	
EPA ID Number			
8	AVAYA PROPERTY 400 S. HINDRY AVE INGLEWOOD, CA 90301	SLIC	S106485897 N/A
SLIC:			
Region:	STATE		
Facility Status:	Open - Site Assessment		
Status Date:	2010-03-23 00:00:00		
Global Id:	SLT43703701		
Lead Agency:	LOS ANGELES RWQCB (REGION 4)		
Lead Agency Case Number:	Not reported		
Latitude:	33.958214		
Longitude:	-118.373104		
Case Type:	Cleanup Program Site		
Case Worker:	PGN		
Local Agency:	Not reported		
RB Case Number:	1071		
File Location:	Regional Board		
Potential Media Affected:	Aquifer used for drinking water supply, Soil, Soil Vapor		
Potential Contaminants of Concern:	Other Chlorinated Hydrocarbons, Tetrachloroethylene (PCE), Trichloroethylene (TCE)		
Site History:	The Site was developed between 1950 and 1952 (by Pacific Bell) and		

Click here to access the California GeoTracker records for this facility:

TC3139641.1s Page 39 of 351

Map ID Direction Distance		MAP FINDINGS	EDR ID Number
Distance (ft.)Site		Database(s)	EPA ID Number
(Continued)			S110420938
E Date:	Not reported		
Substance:	Jet Fuel JP-8		
Quantity Released:	Unknown		
BBLs:	Not reported		
Cups:	Not reported		
CUFF:	Not reported		
Gallons:	Not reported		
Grams:	Not reported		
Pounds:	Not reported		
Liters:	Not reported		
Ounces:	Not reported		
Pints:	Not reported		
Quarts:	Not reported		
Sheen:	Not reported		
Tons:	Not reported		
Unknown:	Not reported		
Evacuations:	0		
Number of Injuries:	0		
Number of Fatalities:	0		
Description:	Per NRC Fax: The caller is reporting the discovery of an extremely strong jet fuel odor in his neighborhood coming from the LAX Airport. The caller stated that this is an ongoing issue, but the odor is extremely strong today.		
9	8732 BLERIOT AVE 8732 BLERIOT AVE LOS ANGELES, CA 90045	ERNS	2008893737 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
10	FRITO-LAY, INC 8731 BELLANCA LOS ANGELES, CA 90045	HIST CORTESE	S101296893 N/A
CORTESE:			
Region:	CORTESE		
Facility County Code:	19		
Reg By:	LTNKA		
Reg Id:	900450507		
10	FRITO-LAY, INC 8731 BELLANCA AVE WESTCHESTER, CA 90045	LUST	S101587701 N/A
LUST:			
Region:	STATE		
Global Id:	T0603701066		
Latitude:	33.9582321		
Longitude:	-118.3806045		
Case Type:	LUST Cleanup Site		
Status:	Open - Inactive		

TC3139641.1s Page 41 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.) Site	Database(s)	EPA ID Number	
FRITO-LAY, INC (Continued)			S101587701
Status Date:	2008-05-14 00:00:00		
Lead Agency:	LOS ANGELES, CITY OF		
Case Worker:	TP		
Local Agency:	LOS ANGELES, CITY OF		
RB Case Number:	900450507		
LOC Case Number:	Not reported		
File Location:	Not reported		
Potential Media Affect:	Soil		
Potential Contaminants of Concern:	Diesel		
Site History:	Not reported		
Click here to access the California GeoTracker records for this facility:			
LUST:			
Global Id:	T0603701066		
Contact Type:	Regional Board Caseworker		
Contact Name:	YUE RONG		
Organization Name:	LOS ANGELES RWQCB (REGION 4)		
Address:	320 W. 4TH ST., SUITE 200		
City:	Los Angeles		
Email:	yrong@waterboards.ca.gov		
Phone Number:	Not reported		
Global Id:			
Contact Type:	Local Agency Caseworker		
Contact Name:	TERRENCE PALMER		
Organization Name:	LOS ANGELES, CITY OF		
Address:	221 N FIGUEROA ST STE 1500		
City:	LOS ANGELES		
Email:	Not reported		
Phone Number:	2134826520		
LUST:			
Global Id:	T0603701066		
Action Type:	Other		
Date:	1950-01-01 00:00:00		
Action:	Leak Stopped		
Global Id:			
Action Type:	Other		
Date:	1950-01-01 00:00:00		
Action:	Leak Discovery		
Global Id:			
Action Type:	Other		
Date:	1950-01-01 00:00:00		
Action:	Leak Reported		
LUST REG 4:			
Region:	4		
Regional Board:	04		
County:	Los Angeles		
Facid:	900450507		
Status:	Leak being confirmed		
Substance:	Diesel		
Substance Quantity:	Not reported		
TC3139641.1s			Page 42 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.) Site	Database(s)	EPA ID Number	
11	FALMOUTH AVE & REDLANDS ST FALMOUTH AVE & REDLANDS ST LOS ANGELES, CA 90031	ERNS	94371697 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
12	7800 PASEO DEL RAY 7800 PASEO DEL RAY LOS ANGELES, CA	ERNS	93339940 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
13	YOUR MAN TOURS, INC 8831 AVIATION BLVD INGLEWOOD, CA 90301	HIST CORTESE LUST	1000351499 CAD981660111
CORTESE:			
Region:	CORTESE		
Facility County Code:	19		
Reg By:	LTNKA		
Reg Id:	I-12588		
LUST:			
Region:	STATE		
Global Id:	T0603703980		
Latitude:	33.956477		
Longitude:	-118.378268		
Case Type:	LUST Cleanup Site		
Status:	Completed - Case Closed		
Status Date:	1996-07-23 00:00:00		
Lead Agency:	LOS ANGELES RWQCB (REGION 4)		
Case Worker:	YR		
Local Agency:	LOS ANGELES COUNTY		
RB Case Number:	I-12588		
LOC Case Number:	Not reported		
File Location:	Not reported		
Potential Media Affect:	Soil		
Potential Contaminants of Concern:	Diesel		
Site History:	Not reported		
Click here to access the California GeoTracker records for this facility:			
LUST:			
Global Id:	T0603703980		
Contact Type:	Regional Board Caseworker		
Contact Name:	YUE RONG		
Organization Name:	LOS ANGELES RWQCB (REGION 4)		
Address:	320 W. 4TH ST., SUITE 200		
City:	Los Angeles		
Email:	yrong@waterboards.ca.gov		
Phone Number:	Not reported		
TC3139641.1s			Page 44 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.) Site	Database(s)	EPA ID Number	
FRITO-LAY, INC (Continued)			S101587701
Local Case No:	Not reported		
Case Type:	Soil		
Abatement Method Used at the Site:	Excavate and Treat		
Global ID:	T0603701066		
W Global ID:	Not reported		
Staff:	UNK		
Local Agency:	19050		
Cross Street:	MANCHESTER		
Enforcement Type:	Not reported		
Date Leak Discovered:	7/10/1987		
Date Leak First Reported:	7/10/1987		
Date Leak Record Entered:	8/13/1987		
Date Confirmation Began:	7/10/1987		
Date Leak Stopped:	7/10/1987		
Date Case Last Changed on Database:	7/10/1987		
Date the Case was Closed:	Not reported		
How Leak Discovered:	Tank Closure		
How Leak Stopped:	Not reported		
Cause of Leak:	Corrosion		
Leak Source:	Tank		
Operator:	OLD CASENO WAS 005023		
Water System:	Not reported		
Well Name:	Not reported		
Approx. Dist To Production Well (ft):	5172.8214589510896410438407468		
Source of Cleanup Funding:	Tank		
Preliminary Site Assessment Workplan Submitted:	Not reported		
Preliminary Site Assessment Began:	Not reported		
Pollution Characterization Began:	Not reported		
Remediation Plan Submitted:	Not reported		
Remedial Action Underway:	Not reported		
Post Remedial Action Monitoring Began:	Not reported		
Enforcement Action Date:	Not reported		
Historical Max MTBE Date:	Not reported		
Hist Max MTBE Conc in Groundwater:	Not reported		
Hist Max MTBE Conc in Soil:	Not reported		
Significant Interim Remedial Action Taken:	Not reported		
GW Qualifier:	Not reported		
Soil Qualifier:	Not reported		
Organization:	Not reported		
Owner Contact:	Not reported		
Responsible Party:	FRITO-LAY, INC		
RP Address:	7701 LEGACY DR, PLAWO, TX 75024		
Program:	LUST		
Lat/Long:	33.9582321 / -1		
Local Agency Staff:	PEJ		
Beneficial Use:	Not reported		
Priority:	Not reported		
Cleanup Fund Id:	Not reported		
Suspended:	Not reported		
Assigned Name:	Not reported		
Summary:	TANKS 2,3,4,AND 5 ARE 12000, 12000, 10000, 10000 GALS TANK 6 IS 5000 GALS		
TC3139641.1s			Page 43 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.) Site	Database(s)	EPA ID Number	
YOUR MAN TOURS, INC (Continued)			1000351499
Global Id:	T0603703980		
Contact Type:	Local Agency Caseworker		
Contact Name:	JOHN ARWUJO		
Organization Name:	LOS ANGELES COUNTY		
Address:	900 S FREMONT AVE		
City:	ALHAMBRA		
Email:	Not reported		
Phone Number:	6264583507		
LUST:			
Global Id:	T0603703980		
Action Type:	Other		
Date:	1950-01-01 00:00:00		
Action:	Leak Discovery		
Global Id:			
Action Type:	Other		
Date:	1950-01-01 00:00:00		
Action:	Leak Reported		
LUST REG 4:			
Region:	4		
Regional Board:	04		
County:	Los Angeles		
Facid:	I-12588		
Status:	Case Closed		
Substance:	Diesel		
Substance Quantity:	Not reported		
Local Case No:	Not reported		
Case Type:	Soil		
Abatement Method Used at the Site:	Not reported		
Global ID:	T0603703980		
W Global ID:	Not reported		
Staff:	UNK		
Local Agency:	19000		
Cross Street:	Not reported		
Enforcement Type:	Not reported		
Date Leak Discovered:	8/4/1992		
Date Leak First Reported:	8/11/1992		
Date Leak Record Entered:	8/20/1992		
Date Confirmation Began:	Not reported		
Date Leak Stopped:	Not reported		
Date Case Last Changed on Database:	6/5/1996		
Date the Case was Closed:	7/23/1996		
How Leak Discovered:	Tank Closure		
How Leak Stopped:	Not reported		
Cause of Leak:	UNK		
Leak Source:	UNK		
Operator:	DUPUIS, FRANK		
Water System:	Not reported		
Well Name:	Not reported		
Approx. Dist To Production Well (ft):	3769.0492030089803361775305572		
Source of Cleanup Funding:	UNK		
Preliminary Site Assessment Workplan Submitted:	Not reported		
Preliminary Site Assessment Began:	Not reported		
TC3139641.1s			Page 45 of 351

MAP FINDINGS		
Map ID		EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

YOUR MAN TOURS, INC (Continued)

1000351499

Pollution Characterization Began: Not reported
Remediation Plan Submitted: 6/5/1996
Remedial Action Underway: Not reported
Post Remedial Action Monitoring Began: Not reported
Enforcement Action Date: Not reported
Historical Max MTBE Date: Not reported
Hist Max MTBE Conc in Groundwater: Not reported
Hist Max MTBE Conc in Soil: Not reported
Significant Interim Remedial Action Taken: Not reported
GW Qualifier: Not reported
Soil Qualifier: Not reported
Organization: Not reported
Owner Contact: Not reported
Responsible Party: YOUR MAN TOUR
RP Address: 8831 AVIATION BLVD, INGLEWOOD CA 90501
Program: LUST
Lat/Long: 33.9575782 / -1
Local Agency Staff: Not reported
Beneficial Use: Not reported
Priority: Not reported
Cleanup Fund Id: Not reported
Suspended: Not reported
Assigned Name: Not reported
Summary: Not reported

14

**7263 WEST 90TH ST
LOS ANGELES, CA 90031**CHMIRS S109040557
N/A**CHMIRS:**

OES Incident Number: 07-5801
OES notification: 9/22/2007 07:21:49 PM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personnel # Of Decontaminated: Not reported
Responding Agency Personnel # Of Injuries: Not reported
Responding Agency Personnel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported

TC3139641.1s Page 46 of 351

MAP FINDINGS		
Map ID		EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

14 7263 WEST 90TH STREET
7263 WEST 90TH STREET
LOS ANGELES, CAERNS 2007325096
N/A

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

15 EL SEGUNDO BATTERY SITE

FUDS 1007212239
N/A**EL SEGUNDO, CA**

FUDS:
Federal Facility ID: CA9799F5350
FUDS #: J09CA0215
INST ID: 60989
Facility Name: EL SEGUNDO BATTERY SITE
City: EL SEGUNDO
State: CA
EPA Region: 9
County: LOS ANGELES
Congressional District: 36
US Army District: Los Angeles District (SPL)
Fiscal Year: 2009
Telephone: 213-452-3920
NPL Status: Not reported
RAB: Not reported
CTC: Not reported
Current Owner: OTHER

FUDS Description Details:

Los Angeles Antiaircraft Artillery Battery Site No. 61 was located in an undeveloped area of the City of Los Angeles. It is now a residential area bounded by Campdell and Waterview Streets to the north and south, respectively, and Vista Del Mar to the west and Pershing Drive to the east. The site is a 0.55-acre parcel. The former site was gradually developed and now supports residential development owned by numerous property owners. No visible indication of AAA L.A. Site #61 remains. This property is known or suspected to contain military munitions and explosives of concern (e.g., unexploded ordnance) and therefore may present an explosive hazard.

FUDS History Details:

In December 1941, a six-block undeveloped area of the City of Los Angeles was reportedly acquired by the U.S. Army for use as an antiaircraft battery. The battery was used for the harbor defense of Los Angeles from the end of December 1941 until October 1942.

FUDS Current Program Details:**FUDS Future Program Details:**

TC3139641.1s Page 48 of 351

MAP FINDINGS		
Map ID		EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

(Continued)

S109040557

Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Comments: Not reported
Facility Telephone: Not reported
Waterway Involved: Not reported
Waterway: Ballona Creek
Spill Site: Not reported
Cleanup By: Reporting Party
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Date/Time: Not reported
Year: 2007
Agency: City of Los Angeles Bureau of Sanitation
Incident Date: 9/22/2007 12:00:00 AM
Admin Agency: Los Angeles City Fire Department
Amount: Not reported
Contained: No
Site Type: Merchant/Business
E Date: Not reported
Substance: Sewage
Quantity Released: Not reported
BBLs: 0
Cups: 0
CUFT: 0
Gallons: 92
Grams: 0
Pounds: 0
Liters: 0
Ounces: 0
Pints: 0
Quarts: 0
Sheets: 0
Tons: 0
Unknown: 0
Evacuations: 0
Number of Injuries: 0
Number of Fatalities: 0
Description: 09/22/07 at 1745 hrs, a sewer main line blockage due to roots. Line has been cleared, but spill made it to a catch basin and Ballona Creek.

TC3139641.1s Page 47 of 351

MAP FINDINGS		
Map ID		EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

16

**640 ISIS
WESTCHESTER, CA**CHMIRS S109040219
N/A**CHMIRS:**

OES Incident Number: 06-2063
OES notification: 4/6/2006 09:41:55 AM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personnel # Of Decontaminated: Not reported
Responding Agency Personnel # Of Injuries: Not reported
Responding Agency Personnel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Comments: Not reported
Facility Telephone: Not reported
Waterway Involved: Not reported
Waterway: Pacific Ocean
Spill Site: Not reported
Cleanup By: Unknown
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Date/Time: Not reported
Year: 2006
Agency: NRC
Incident Date: 4/6/2006 12:00:00 AM
Admin Agency: Not reported
Amount: Not reported
Contained: Unknown
Site Type: Merchant/Business

TC3139641.1s Page 49 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.) Site		Database(s) EPA ID Number
(Continued)		S109040219
E Date:	Not reported	
Substance:	Bleach	
Quantity Released:	Not reported	
BBL's:	6	
Cups:	0	
CUFF:	0	
Gallons:	0.000000	
Grams:	0	
Pounds:	0	
Liters:	0	
Ounces:	0	
Pints:	0	
Quarts:	0	
Sheen:	0	
Tons:	0	
Unknown:	0	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	A business (tide line) that sells sea shells is dumping large amounts of leach directly into the drain that leads to the ocean.	

16 640 ISIS
640 ISIS
WESTCHESTER, CA ERNS 2006793194
N/A

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

17 WESTERN FARM SERVICE
256 MANCHESTER
LOS ANGELES, CA 90003 HIST CORTESE S110060971
N/A
CORTESE:
Region: CORTESE
Facility County Code: 19
Reg By: LTNKA
Reg Id: 102

17 SHELL
255 MANCHESTER
LOS ANGELES, CA 90001 HIST CORTESE S105126335
N/A
CORTESE:
Region: CORTESE
Facility County Code: Not reported
Reg By: Not reported
Reg Id: Not reported

TC3139641.1s Page 50 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.) Site		Database(s) EPA ID Number
AVIATION INGLEWOOD (FORMERLY BODYCOTE HINDERLITER) (Continued)		S106483901
Region:	STATE	
Facility Status:	Open - Site Assessment	
Status Date:	1997-09-01 00:00:00	
Global Id:	SL204161506	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Lead Agency Case Number:	Not reported	
Latitude:	33.954182434	
Longitude:	-118.37702	
Case Type:	Cleanup Program Site	
Case Worker:	PGN	
Local Agency:	Not reported	
RB Case Number:	0205	
File Location:	Regional Board	
Potential Media Affected:	Aquifer used for drinking water supply, Other Groundwater (uses other than drinking water), Soil, Soil Vapor	
Potential Contaminants of Concern:	Not reported	
Site History:	Aviation Inglewood is the current owner of the property located between 9007-9021 Aviation Boulevard in Inglewood. National Heat Treating (NHT) formerly leased and operated a metal treating facility on a portion of the property, located at 9117-9121 Aviation Boulevard from approximately 1954 until 1970. Public records indicate that the site was primarily improved between 1945 and 1960 with commercial and industrial buildings. The site was also utilized for auto service & repair, truck delivery and air cargo services, a lumber yard, warehousing and for light manufacturing. Prior to 1945, the site was vacant land. Numerous tenants occupied the site from the time it was developed until 1995, when all site structures were demolished and the entire property was leased to Alamo for storage and rental of their auto fleet. The site continues to be a rental parking lot.	

[Click here to access the California GeoTracker records for this facility.](#)

18 ALAMO (SEE FILE #13957-2E) ENVIROSTOR S101480900
9020 S AVIATION BLVD
INGLEWOOD, CA N/A

ENVIROSTOR:
Site Type: Historical
Site Type Detailed: * Historical
Acres: Not reported
NPL: NO
Regulatory Agencies: NONE SPECIFIED
Lead Agency: NONE SPECIFIED
Program Manager: Not reported
Supervisor: * MMONROY
Division Branch: Cleanup Chatsworth
Facility ID: 19370021
Site Code: Not reported
Assembly: 51
Sennets: 25
Special Program: * Site Char & Assess Grant (CERCLA 104)
Status: Refer: Other Agency
Status Date: 1995-08-31 00:00:00
Restricted Use: NO
Site Mgmt. Req.: NONE SPECIFIED
Funding: Not reported
Latitude: 33.954444444444398
Longitude: -118.37666666666701

TC3139641.1s Page 52 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.) Site		Database(s) EPA ID Number
17 CHEVRON 256 MANCHESTER LOS ANGELES, CA 90003 HIST CORTESE S110060515 N/A CORTESE: Region: CORTESE Facility County Code: 19 Reg By: LTNKA Reg Id: 900030125		
18 UNION BANK/ESTATE OF JOSEPH COLLINS 9007-9121 AVIATION INGLEWOOD, CA 90301 SLIC S106386950 N/A SLIC: Region: 4 Facility Status: Remediation SLIC: 0205 Substance: VOCs Staff: AH		

18 AVIATION INGLEWOOD (FORMERLY BODYCOTE HINDERLITER)
9007-9121 AVIATION BOULEVARD
INGLEWOOD, CA 90301 SLIC S106483901
N/A
SLIC:
Region: STATE
Facility Status: Open - Site Assessment
Status Date: 2010-03-23 00:00:00
Global Id: SL2049F1725
Lead Agency: LOS ANGELES RWQCB (REGION 4)
Lead Agency Case Number: Not reported
Latitude: 33.959774
Longitude: -118.376145
Case Type: Cleanup Program Site
Case Worker: PGN
Local Agency: Not reported
RB Case Number: 0205B
File Location: Regional Board
Potential Media Affected: Aquifer used for drinking water supply, Soil, Soil Vapor
Potential Contaminants of Concern: Other Chlorinated Hydrocarbons, Tetrachloroethylene (PCE), Trichloroethylene (TCE), Diesel, Fuel Oxygenates, Gasoline
Site History: Aviation Inglewood is the current owner of the property located between 9007-9021 Aviation Boulevard in Inglewood. National Heat Treating (NHT) formerly leased and operated a metal treating facility on a portion of the property, located at 9117-9121 Aviation Boulevard from approximately 1954 until 1970. Public records indicate that the site was primarily improved between 1945 and 1960 with commercial and industrial buildings. The site was also utilized for auto service & repair, truck delivery and air cargo services, a lumber yard, warehousing and for light manufacturing. Prior to 1945, the site was vacant land. Numerous tenants occupied the site from the time it was developed until 1995, when all site structures were demolished and the entire property was leased to Alamo for storage and rental of their auto fleet. The site continues to be a rental parking lot.

[Click here to access the California GeoTracker records for this facility.](#)

TC3139641.1s Page 51 of 351

MAP FINDINGS		EDR ID Number
Map ID		
Direction		
Distance		
Distance (ft.) Site	Database(s)	EPA ID Number
ALAMO (SEE FILE #13957-2E) (Continued)		S101480900
APN:	NONE SPECIFIED	
Past Use:	NONE SPECIFIED	
Potential COC:	10119, 10176, 10179, 10193, 10197, 10198, 10199, 20012	
Confirmed COC:	NONE SPECIFIED	
Potential Description:	NONE SPECIFIED	
Alias Name:	CAD008504367	
Alias Type:	EPA Identification Number	
Alias Name:	19370021	
Alias Type:	Envirostor ID Number	
Completed Info:		
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Site Screening	
Completed Date:	1994-10-25 00:00:00	
Comments:	Database verification project confirms NFA for DTSC.	
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	* Discovery	
Completed Date:	1982-02-26 00:00:00	
Comments:	Facility identified via LA Chamber of Commerce Bus. Dir 1966	
Future Area Name:	Not reported	
Future Sub Area Name:	Not reported	
Future Document Type:	Not reported	
Future Due Date:	Not reported	
Schedule Area Name:	Not reported	
Schedule Sub Area Name:	Not reported	
Schedule Document Type:	Not reported	
Schedule Due Date:	Not reported	
Schedule Revised Date:	Not reported	

18 ALAMO (SEE FILE #13957-2E) LUST S108418307
9020 AVIATION BLVD.
INGLEWOOD, CA 90301 N/A

LUST:
Region: STATE
Global Id: T0603788512
Latitude: 33.954872
Longitude: -118.376983
Case Type: LUST Cleanup Site
Status: Completed - Case Closed
Status Date: 2008-11-13 00:00:00
Lead Agency: LOS ANGELES COUNTY
Case Worker: MRR
Local Agency: LOS ANGELES COUNTY
RB Case Number: Not reported
LOC Case Number: 41004
File Location: Not reported
Potential Media Affect: Soil
Potential Contaminants of Concern: Gasoline, Diesel
Site History: Not reported

[Click here to access the California GeoTracker records for this facility.](#)

LUST:
Global Id: T0603788512

TC3139641.1s Page 53 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
ALAMO (Continued)	S108418307	
Contact Type:	Local Agency Caseworker	
Contact Name:	MANUEL R REGALADO	
Organization Name:	LOS ANGELES COUNTY	
Address:	900 S. FREMONT AVE.	
City:	ALHAMBRA	
Email:	mregalad@dpw.lacounty.gov	
Phone Number:	Not reported	
Global Id:	T0603788512	
Contact Type:	Regional Board Caseworker	
Contact Name:	YUE RONG	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yrong@waterboards.ca.gov	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603788512	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id:	T0603788512	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603788512	
Action Type:	ENFORCEMENT	
Date:	2008-11-13 00:00:00	
Action:	Closure/No Further Action Letter	
Global Id:	T0603788512	
Action Type:	REMEDATION	
Date:	1950-01-01 00:00:00	
Action:	Not reported	

19 9110 SOUTH RAYFORD DRIVE
9110 SOUTH RAYFORD DRIVE
LOS ANGELES, CA 90045

ERNS 2007316426
N/A

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

TC3139641.1s Page 54 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
(Continued)	S109040586	
Other:	Not reported	
Date/Time:	Not reported	
Year:	2007	
Agency:	City of Los Angeles	
Incident Date:	1/28/2007 12:00:00 AM	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	Yes	
Site Type:	Residence	
E Date:	Not reported	
Substance:	Sewage	
Quantity Released:	Not reported	
BBL:	0	
Cups:	0	
CUFT:	0	
Gallons:	2268	
Grams:	0	
Pounds:	0	
Liters:	0	
Ounces:	0	
Pints:	0	
Quarts:	0	
Sheen:	0	
Tons:	0	
Unknown:	0	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	RP Sates: Main sewer line blockage caused a released a maintenance hole and a residence. 100 gallons into a storm drain.	

21 MERLE NORMAN COSMETICS
9130 BELLANCA AVE
LOS ANGELES, CA 90045

HIST CORTESE U001561873
N/A

CORTESE:
Region: CORTESE
Facility County Code: 19
Reg By: LTNKA
Reg Id: 900450398

21 MERLE NORMAN COSMETICS
9130 BELLANCA AVE
WESTCHESTER, CA 90045

LUST S104159631
N/A

LUST:
Region: STATE
Global Id: T0603701062
Latitude: 33.9533822
Longitude: -118.3803174
Case Type: LUST Cleanup Site
Status: Completed - Case Closed
Status Date: 1997-03-24 00:00:00
Lead Agency: LOS ANGELES RWQCB (REGION 4)
Case Worker: YR
Local Agency: LOS ANGELES, CITY OF

TC3139641.1s Page 56 of 351

Map ID		MAP FINDINGS		EDR ID Number	
Direction					
Distance				Database(s)	
Distance (ft.)Site				EPA ID Number	
20	7341 VISTA DEL MAR LANE 7341 VISTA DEL MAR LANE LOS ANGELES, CA			ERNS	2007302733 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.					
20	7341 VISTA DEL MAR LANE LOS ANGELES, CA 90065			CHMIRS	S109040586 N/A
CHMIRS:					
OES Incident Number:		07-0622			
OES notification:		1/28/2007 05:40:17 PM			
OES Date:		Not reported			
OES Time:		Not reported			
Incident Date:		Not reported			
Date Completed:		Not reported			
Property Use:		Not reported			
Agency Id Number:		Not reported			
Agency Incident Number:		Not reported			
Time Notified:		Not reported			
Time Completed:		Not reported			
Surrounding Area:		Not reported			
Estimated Temperature:		Not reported			
Property Management:		Not reported			
Special Studies 1:		Not reported			
Special Studies 2:		Not reported			
Special Studies 3:		Not reported			
Special Studies 4:		Not reported			
Special Studies 5:		Not reported			
Special Studies 6:		Not reported			
More Than Two Substances Involved?:		Not reported			
Resp Agency Personnel # Of Decontaminated:		Not reported			
Responding Agency Personnel # Of Injuries:		Not reported			
Responding Agency Personnel # Of Fatalities:		Not reported			
Others Number Of Decontaminated:		Not reported			
Others Number Of Injuries:		Not reported			
Others Number Of Fatalities:		Not reported			
Vehicle Make/year:		Not reported			
Vehicle License Number:		Not reported			
Vehicle State:		Not reported			
Vehicle Id Number:		Not reported			
CA/DOT/PUC/ICC Number:		Not reported			
Company Name:		Not reported			
Reporting Officer Name/ID:		Not reported			
Report Date:		Not reported			
Comments:		Not reported			
Facility Telephone:		Not reported			
Waterway Involved:		Not reported			
Waterway:		storm drain, to the beach, Playa Del Rey			
Spill Site:		Not reported			
Cleanup By:		Reporting Party			
Containment:		Not reported			
What Happened:		Not reported			
Type:		Not reported			
Measure:		Not reported			

TC3139641.1s Page 55 of 351

Map ID
Direction
Distance

Distance (ft.)Site

MAP FINDINGS

EDR ID Number
EPA ID Number

Database(s)

MERLE NORMAN COSMETICS (Continued)

S104159631

RB Case Number: 900450398
LOC Case Number: Not reported
File Location: Not reported
Potential Media Affect: Aquifer used for drinking water supply
Potential Contaminants of Concern: Gasoline
Site History: Not reported

Click here to access the California GeoTracker records for this facility:

LUST:

Global Id: T0603701062
Contact Type: Regional Board Caseworker
Contact Name: YUE RONG
Organization Name: LOS ANGELES RWQCB (REGION 4)
Address: 320 W. 4TH ST., SUITE 200
City: Los Angeles
Email: yrong@waterboards.ca.gov
Phone Number: Not reported

Global Id: T0603701062
Contact Type: Local Agency Caseworker
Contact Name: ELOY LUNA
Organization Name: LOS ANGELES, CITY OF
Address: 200 North Main Street, Suite 1780
City: LOS ANGELES
Email: eloy.luna@lacity.org
Phone Number: Not reported

LUST:

Global Id: T0603701062
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Reported

LUST REG 4:

Region: 4
Regional Board: 04
County: Los Angeles
Facid: 900450398
Status: Case Closed
Substance: Gasoline
Substance Quantity: Not reported
Local Case No: Not reported
Case Type: Groundwater
Abatement Method Used at the Site: Not reported
Global ID: T0603701062
W Global ID: Not reported
Staff: UNK
Local Agency: 19050
Cross Street: ARBOR VITAE ST
Enforcement Type: Not reported
Date Leak Discovered: Not reported
Date Leak First Reported: 5/1/1990
Date Leak Record Entered: 5/24/1990
Date Confirmation Began: Not reported
Date Leak Stopped: Not reported

TC3139641.1s Page 57 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
		EPA ID Number
MERLE NORMAN COSMETICS (Continued)		S104159631
Date Case Last Changed on Database: 3/8/1999		
Date the Case was Closed: 3/24/1997		
How Leak Discovered: Not reported		
How Leak Stopped: Not reported		
Cause of Leak: Not reported		
Leak Source: Not reported		
Operator: OLD CASE #052590-01		
Water System: Not reported		
Well Name: Not reported		
Approx. Dist To Production Well (ft): 4307.2501305219284684060377732		
Source of Cleanup Funding: Not reported		
Preliminary Site Assessment Workplan Submitted: Not reported		
Preliminary Site Assessment Began: Not reported		
Pollution Characterization Began: Not reported		
Remediation Plan Submitted: 5/1/1990		
Remedial Action Underway: Not reported		
Post Remedial Action Monitoring Began: 10/5/1996		
Enforcement Action Date: Not reported		
Historical Max MTBE Date: Not reported		
Hist Max MTBE Conc in Groundwater: Not reported		
Hist Max MTBE Conc in Soil: Not reported		
Significant Interim Remedial Action Taken: Not reported		
GW Qualifier: Not reported		
Soil Qualifier: Not reported		
Organization: Not reported		
Owner Contact: Not reported		
Responsible Party: MERLE NORMAN COSMETICS		
RP Address: 9130 BELLANCA AVE., LOS ANGELES CA 90045		
Program: LUST		
Lat/Long: 33.9533822 / -1		
Local Agency Staff: PEJ		
Beneficial Use: Not reported		
Priority: Not reported		
Cleanup Fund Id: Not reported		
Suspended: Not reported		
Assigned Name: Not reported		
Summary: 02/13/97 - QUARTERLY GW MONITORING REPORT		OLD CASE
#903010034		
22	BARNES WHOLESALE INC 740 S GLASGOW AVE INGLEWOOD, CA 90301	LUST U003777118 N/A
LUST:		
Region: STATE		
Global Id: T10000000193		
Latitude: 33.956305		
Longitude: -118.371804		
Case Type: LUST Cleanup Site		
Status: Open - Verification Monitoring		
Status Date: 2008-08-12 00:00:00		
Lead Agency: LOS ANGELES COUNTY		
Case Worker: JOA		
Local Agency: LOS ANGELES COUNTY		
RB Case Number: Not reported		
LOC Case Number: 013102-013378		
File Location: Not reported		
Potential Media Affect: Not reported		
		TC3139641.1s Page 58 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
		EPA ID Number
HERTZ CORPORATION (Continued)		S106448063
LUST:		
Global Id: T0603732721		
Action Type: ENFORCEMENT		
Date: 2004-05-11 00:00:00		
Action: Staff Letter		
Global Id: T0603732721		
Action Type: RESPONSE		
Date: 2009-08-17 00:00:00		
Action: Soil and Water Investigation Report		
Global Id: T0603732721		
Action Type: RESPONSE		
Date: 2008-01-15 00:00:00		
Action: Soil and Water Investigation Workplan		
Global Id: T0603732721		
Action Type: ENFORCEMENT		
Date: 2009-03-09 00:00:00		
Action: Staff Letter		
Global Id: T0603732721		
Action Type: ENFORCEMENT		
Date: 2009-06-15 00:00:00		
Action: Staff Letter		
Global Id: T0603732721		
Action Type: RESPONSE		
Date: 2008-06-15 00:00:00		
Action: Soil and Water Investigation Report		
Global Id: T0603732721		
Action Type: RESPONSE		
Date: 2008-04-15 00:00:00		
Action: Monitoring Report - Quarterly		
Global Id: T0603732721		
Action Type: RESPONSE		
Date: 2009-04-15 00:00:00		
Action: Monitoring Report - Quarterly		
Global Id: T0603732721		
Action Type: RESPONSE		
Date: 2009-07-15 00:00:00		
Action: Monitoring Report - Semi-Annually		
Global Id: T0603732721		
Action Type: ENFORCEMENT		
Date: 2008-03-05 00:00:00		
Action: Staff Letter		
Global Id: T0603732721		
Action Type: ENFORCEMENT		
Date: 2007-11-21 00:00:00		
Action: Staff Letter		
Global Id: T0603732721		
		TC3139641.1s Page 60 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
		EPA ID Number
BARNES WHOLESALE INC (Continued)		U003777118
Potential Contaminants of Concern: Not reported		
Site History: Not reported		
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id: T10000000193		
Contact Type: Local Agency Caseworker		
Contact Name: JOHN AWUJO		
Organization Name: LOS ANGELES COUNTY		
Address: 900 S FREMONT AVE		
City: ALHAMBRA		
Email: Not reported		
Phone Number: 6264583507		
23	HERTZ CORPORATION 9000 AIRPORT BLVD. LOS ANGELES, CA 90045	LUST S106448063 N/A
LUST:		
Region: STATE		
Global Id: T0603732721		
Latitude: 33.955011		
Longitude: -118.385764		
Case Type: LUST Cleanup Site		
Status: Open - Remediation		
Status Date: 2011-04-29 00:00:00		
Lead Agency: LOS ANGELES RWQCB (REGION 4)		
Case Worker: JH		
Local Agency: LOS ANGELES, CITY OF		
RB Case Number: 900450670		
LOC Case Number: Not reported		
File Location: Regional Board		
Potential Media Affect: Aquifer used for drinking water supply		
Potential Contaminants of Concern: Other Solvent or Non-Petroleum Hydrocarbon		
Site History: Not reported		
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id: T0603732721		
Contact Type: Local Agency Caseworker		
Contact Name: MARCUS LOOK		
Organization Name: LOS ANGELES, CITY OF		
Address: 200 N. MAIN ST. RM. 970		
City: LOS ANGELES		
Email: Not reported		
Phone Number: Not reported		
Global Id: T0603732721		
Contact Type: Regional Board Caseworker		
Contact Name: JAY HUANG		
Organization Name: LOS ANGELES RWQCB (REGION 4)		
Address: 320 WEST 4TH STREET, SUITE 200		
City: LOS ANGELES		
Email: jhuang@waterboards.ca.gov		
Phone Number: 2135766711		
		TC3139641.1s Page 59 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
		EPA ID Number
HERTZ CORPORATION (Continued)		S106448063
Action Type: RESPONSE		
Date: 2009-05-15 00:00:00		
Action: Soil and Water Investigation Workplan		
Global Id: T0603732721		
Action Type: Other		
Date: 1950-01-01 00:00:00		
Action: Leak Discovery		
Global Id: T0603732721		
Action Type: RESPONSE		
Date: 2006-07-19 00:00:00		
Action: Final Remedial Action Report / Corrective Action Report		
Global Id: T0603732721		
Action Type: ENFORCEMENT		
Date: 2009-05-29 00:00:00		
Action: Staff Letter		
Global Id: T0603732721		
Action Type: RESPONSE		
Date: 2004-06-15 00:00:00		
Action: Other Report / Document		
Global Id: T0603732721		
Action Type: REMEDIATION		
Date: 1950-01-01 00:00:00		
Action: Excavate and Dispose		
Global Id: T0603732721		
Action Type: Other		
Date: 1950-01-01 00:00:00		
Action: Leak Reported		
LUST REG 4:		
Region: 4		
Regional Board: 04		
County: Los Angeles		
Facid: 900450670		
Status: Pollution Characterization		
Substance: Hydrocarbons		
Substance Quantity: Not reported		
Local Case No: Not reported		
Case Type: Groundwater		
Abatement Method Used at the Site: Not reported		
Global Id: T0603732721		
W Global ID: Not reported		
Staff: JH		
Local Agency: 19050		
Cross Street: ARBOR VITAE		
Enforcement Type: SEL		
Date Leak Discovered: 9/10/2003		
Date Leak First Reported: 3/1/2004		
Date Leak Record Entered: Not reported		
Date Confirmation Began: Not reported		
Date Leak Stopped: Not reported		
		TC3139641.1s Page 61 of 351

Map ID	Direction	Distance	Distance (ft.)	Site	Database(s)	EPA ID Number	EDR ID Number
				MAP FINDINGS			
				HERTZ CORPORATION (Continued)		S106448063	
				Date Case Last Changed on Database:		Not reported	
				Date the Case was Closed:		Not reported	
				How Leak Discovered:		Subsurface Monitoring	
				How Leak Stopped:		Not reported	
				Cause of Leak:		UNK	
				Leak Source:		UNK	
				Operator:		Not reported	
				Water System:		Not reported	
				Well Name:		Not reported	
				Approx. Dist To Production Well (ft):		Not reported	
				Source of Cleanup Funding:		UNK	
				Preliminary Site Assessment Workplan Submitted:		Not reported	
				Preliminary Site Assessment Began:		Not reported	
				Pollution Characterization Began:		7/16/2003	
				Remediation Plan Submitted:		Not reported	
				Remedial Action Underway:		Not reported	
				Post Remedial Action Monitoring Began:		Not reported	
				Enforcement Action Date:		Not reported	
				Historical Max MTBE Date:		Not reported	
				Hist Max MTBE Conc in Groundwater:		Not reported	
				Hist Max MTBE Conc in Soil:		Not reported	
				Significant Interim Remedial Action Taken:		Not reported	
				GW Qualifier:		Not reported	
				Soil Qualifier:		Not reported	
				Organization:		Not reported	
				Owner/Contact:		Not reported	
				Responsible Party:		Roland Costanzo	
				RP Address:		225 Brae Boulevard	
				Program:		LUST	
				Lat/Long:		0 / 0	
				Local Agency Staff:		Not reported	
				Beneficial Use:		Not reported	
				Priority:		Not reported	
				Cleanup Fund Id:		Not reported	
				Suspended:		Not reported	
				Assigned Name:		Not reported	
				Summary:		Not reported	

23	9000 AIRPORT BLVD HERTZ RENT-A-CAR FUELING AREA LOS ANGELES, CA 90045	CHMIRS	S105639828	N/A
CHMIRS:				
OES Incident Number: 009367				
OES notification: Not reported				
OES Date: 8/2/1995				
OES Time: 11:24:04 AM				
Incident Date: Not reported				
Date Completed: Not reported				
Property Use: Not reported				
Agency Id Number: Not reported				
Agency Incident Number: Not reported				
Time Notified: Not reported				
Time Completed: Not reported				
Surrounding Area: Not reported				
Estimated Temperature: Not reported				
Property Management: Not reported				
Special Studies 1: Not reported				

TC3139641.1s Page 62 of 351

Map ID	Direction	Distance	Distance (ft.)	Site	Database(s)	EPA ID Number	EDR ID Number
				MAP FINDINGS			
				(Continued)		S105639828	
				Number of Fatalities:		NO	
				Description:		emergency shut-off valve malfunctioned on fueling nozzle	
23	HERTZ RENT-A-CAR 9029 AIRPORT BLVD LOS ANGELES, CA 90045	HIST CORTESE LUST	1000423725	CAD981382997			
				CORTESE:			
				Region:		CORTESE	
				Facility County Code:		19	
				Reg By:		LTNKA	
				Reg Id:		900450298	
				LUST:			
				Region:		STATE	
				Global Id:		T0603701052	
				Latitude:		33.954791	
				Longitude:		-118.3858725	
				Case Type:		LUST Cleanup Site	
				Status:		Completed - Case Closed	
				Status Date:		1998-12-02 00:00:00	
				Lead Agency:		LOS ANGELES, CITY OF	
				Case Worker:		WR	
				Local Agency:		LOS ANGELES, CITY OF	
				RB Case Number:		900450298	
				LOC Case Number:		Not reported	
				File Location:		Not reported	
				Potential Media Affect:		Other Groundwater (uses other than drinking water)	
				Potential Contaminants of Concern:		Gasoline	
				Site History:		Not reported	
				Click here to access the California GeoTracker records for this facility:			
				LUST:			
				Global Id:		T0603701052	
				Contact Type:		Regional Board Caseworker	
				Contact Name:		YUE RONG	
				Organization Name:		LOS ANGELES RWQCB (REGION 4)	
				Address:		320 W. 4TH ST., SUITE 200	
				City:		Los Angeles	
				Email:		yrong@waterboards.ca.gov	
				Phone Number:		Not reported	
				Global Id:		T0603701052	
				Contact Type:		Local Agency Caseworker	
				Contact Name:		TBD	
				Organization Name:		LOS ANGELES, CITY OF	
				Address:		200 N. MAIN ST. RM. 970	
				City:		LOS ANGELES	
				Email:		Not reported	
				Phone Number:		2138763722	
				LUST:			
				Global Id:		T0603701052	
				Action Type:		Other	
				Date:		1950-01-01 00:00:00	
				Action:		Leak Stopped	

TC3139641.1s Page 64 of 351

Map ID	Direction	Distance	Distance (ft.)	Site	Database(s)	EPA ID Number	EDR ID Number
				MAP FINDINGS			
				(Continued)		S105639828	
				Special Studies 2:		Not reported	
				Special Studies 3:		Not reported	
				Special Studies 4:		Not reported	
				Special Studies 5:		Not reported	
				Special Studies 6:		Not reported	
				More Than Two Substances Involved?:		Not reported	
				Resp Agency Personnel # Of Decontaminated:		Not reported	
				Responding Agency Personnel # Of Injuries:		Not reported	
				Responding Agency Personnel # Of Fatalities:		Not reported	
				Others Number Of Decontaminated:		Not reported	
				Others Number Of Injuries:		Not reported	
				Others Number Of Fatalities:		Not reported	
				Vehicle Make/year:		Not reported	
				Vehicle License Number:		Not reported	
				Vehicle State:		Not reported	
				Vehicle ID Number:		Not reported	
				CA/DOT/PUC/COC Number:		Not reported	
				Company Name:		Not reported	
				Reporting Officer Name/ID:		Not reported	
				Report Date:		Not reported	
				Comments:		Not reported	
				Facility Telephone:		Not reported	
				Waterway Involved:		YES	
				Waterway:		Not reported	
				Spill Site:		Not reported	
				Cleanup By:		hertz rent-a-car	
				Containment:		Not reported	
				What Happened:		Not reported	
				Type:		PETROLEUM	
				Measure:		Not reported	
				Other:		Not reported	
				Date/Time:		Not reported	
				Year:		1995	
				Agency:		hertz corp	
				Incident Date:		06/03/2009	
				Admin Agency:		Not reported	
				Amount:		est 50 gals	
				Contained:		NO	
				Site Type:		OTHER	
				E Date:		Not reported	
				Substance:		diesel	
				Quantity Released:		Not reported	
				BBLs:		Not reported	
				Cups:		Not reported	
				CUFT:		Not reported	
				Gallons:		Not reported	
				Grams:		Not reported	
				Pounds:		Not reported	
				Liters:		Not reported	
				Ounces:		Not reported	
				Pints:		Not reported	
				Quarts:		Not reported	
				Sheen:		Not reported	
				Tons:		Not reported	
				Unknown:		Not reported	
				Evscuations:		NO	
				Number of Injuries:		NO	

TC3139641.1s Page 63 of 351

Map ID	Direction	Distance	Distance (ft.)	Site	Database(s)	EPA ID Number	EDR ID Number
				MAP FINDINGS			
				HERTZ RENT-A-CAR (Continued)		1000423725	
				Global Id:		T0603701052	
				Action Type:		Other	
				Date:		1950-01-01 00:00:00	
				Action:		Leak Discovery	
				Global Id:		T0603701052	
				Action Type:		Other	
				Date:		1950-01-01 00:00:00	
				Action:		Leak Reported	
				LUST REG 4:			
				Region:		4	
				Regional Board:		04	
				Country:		Los Angeles	
				Facid:		900450298	
				Status:		Case Closed	
				Substance:		Gasoline	
				Substance Quantity:		Not reported	
				Local Case No:		Not reported	
				Case Type:		Groundwater	
				Abatement Method Used at the Site:		Not reported	
				Global ID:		T0603701052	
				W Global ID:		Not reported	
				Staff:		UNK	
				Local Agency:		19050	
				Cross Street:		ARBOR VITAE ST	
				Enforcement Type:		Not reported	
				Date Leak Discovered:		12/1/1992	
				Date Leak First Reported:		12/1/1992	
				Date Leak Record Entered:		3/21/1996	
				Date Confirmation Began:		Not reported	
				Date Leak Stopped:		12/1/1992	
				Date Case Last Changed on Database:		12/2/1998	
				Date the Case was Closed:		12/2/1998	
				How Leak Discovered:		Tank Closure	
				How Leak Stopped:		Not reported	
				Cause of Leak:		UNK	
				Leak Source:		UNK	
				Operator:		OLD#960321-01	
				Water System:		Not reported	
				Well Name:		Not reported	
				Approx. Dist To Production Well (ft):		6063.4121709935314272397998482	
				Source of Cleanup Funding:		UNK	
				Preliminary Site Assessment Workplan Submitted:		Not reported	
				Preliminary Site Assessment Began:		Not reported	
				Pollution Characterization Began:		11/20/1995	
				Remediation Plan Submitted:		2/27/1996	
				Remedial Action Underway:		Not reported	
				Post Remedial Action Monitoring Began:		Not reported	
				Enforcement Action Date:		Not reported	
				Historical Max MTBE Date:		Not reported	
				Hist Max MTBE Conc in Groundwater:		Not reported	
				Hist Max MTBE Conc in Soil:		Not reported	
				Significant Interim Remedial Action Taken:		Yes	
				GW Qualifier:		Not reported	
				Soil Qualifier:		Not reported	

TC3139641.1s Page 65 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
HERTZ RENT-A-CAR (Continued)		1000423725
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	HERTZ	
RP Address:	225 BRAE BLVD PARK RIDGE NJ 07656-0713	
Program:	LUST	
Lat/Long:	33.954791 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	USED RBCA (ASTM 1995) FOR SITE EVALUATION!!!	

24 HARRY'S AIRPORT GARAGE 9131 AVIATION BLVD S INGLEWOOD, CA 90301 LUST S103891278 N/A

LUST:

Region: STATE

Global Id: T0603704863

Latitude: 33.9529462

Longitude: -118.3771413

Case Type: LUST Cleanup Site

Status: Open - Remediation

Status Date: 2010-09-21 00:00:00

Lead Agency: LOS ANGELES RWQCB (REGION 4)

Case Worker: MT

Local Agency: LOS ANGELES COUNTY

RB Case Number: R-09799

LOC Case Number: Not reported

File Location: Not reported

Potential Media Affect: Aquifer used for drinking water supply

Potential Contaminants of Concern: Gasoline

Site History: Not reported

Click here to access the California GeoTracker records for this facility:

LUST:

Global Id: T0603704863

Contact Type: Regional Board Caseworker

Contact Name: MARYAM TAIDY

Organization Name: LOS ANGELES RWQCB (REGION 4)

Address: 320 W. 4TH ST., SUITE 200

City: LOS ANGELES

Email: mtaidy@waterboards.ca.gov

Phone Number: 2135766741

Global Id: T0603704863

Contact Type: Local Agency Caseworker

Contact Name: JOHN AWUJO

Organization Name: LOS ANGELES COUNTY

Address: 900 S FREMONT AVE

City: ALHAMBRA

Email: Not reported

Phone Number: 6264583507

TC3139641.1s Page 66 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
HARRY'S AIRPORT GARAGE (Continued)		S103891278
Action Type:	RESPONSE	
Date:	2006-04-15 00:00:00	
Action:	Interim Remedial Action Plan	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2008-07-29 00:00:00	
Action:	Well Installation Report	
Global Id:	T0603704863	
Action Type:	ENFORCEMENT	
Date:	2003-01-26 00:00:00	
Action:	Technical Correspondence / Assistance / Other	
Global Id:	T0603704863	
Action Type:	ENFORCEMENT	
Date:	2009-01-06 00:00:00	
Action:	Staff Letter	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2008-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2009-01-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2006-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2009-02-09 00:00:00	
Action:	Correspondence	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2009-04-15 00:00:00	
Action:	Well Installation Report	
Global Id:	T0603704863	
Action Type:	ENFORCEMENT	
Date:	2003-08-28 00:00:00	
Action:	Staff Letter	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2009-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2009-07-15 00:00:00	

TC3139641.1s Page 68 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
HARRY'S AIRPORT GARAGE (Continued)		S103891278
LUST:		
Global Id:	T0603704863	
Action Type:	ENFORCEMENT	
Date:	2006-01-31 00:00:00	
Action:	Staff Letter	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2003-09-27 00:00:00	
Action:	Soil and Water Investigation Report	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2010-10-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2010-09-01 00:00:00	
Action:	Other Workplan	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2007-08-20 00:00:00	
Action:	Interim Remedial Action Plan	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2010-03-18 00:00:00	
Action:	Clean Up Fund - 5-Year Review Summary	
Global Id:	T0603704863	
Action Type:	ENFORCEMENT	
Date:	2007-08-13 00:00:00	
Action:	Staff Letter	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2008-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2005-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2005-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2005-09-23 00:00:00	
Action:	Request for Closure	
Global Id:	T0603704863	

TC3139641.1s Page 67 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
HARRY'S AIRPORT GARAGE (Continued)		S103891278
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2009-12-03 00:00:00	
Action:	Interim Remedial Action Report	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2010-01-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2011-01-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603704863	
Action Type:	ENFORCEMENT	
Date:	2003-02-10 00:00:00	
Action:	Staff Letter	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2010-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2010-04-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603704863	
Action Type:	ENFORCEMENT	
Date:	2007-09-17 00:00:00	
Action:	Waste Discharge Requirements	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2010-06-14 00:00:00	
Action:	Interim Remedial Action Report	
Global Id:	T0603704863	
Action Type:	ENFORCEMENT	
Date:	2002-10-16 00:00:00	
Action:	Staff Letter	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2006-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2002-11-15 00:00:00	
Action:	Other Report / Document	

TC3139641.1s Page 69 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
HARRY'S AIRPORT GARAGE (Continued)		S103891278
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2003-04-15 00:00:00	
Action:	Soil and Water Investigation Workplan	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2003-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603704863	
Action Type:	ENFORCEMENT	
Date:	2010-09-22 00:00:00	
Action:	Staff Letter	
Global Id:	T0603704863	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2011-05-27 00:00:00	
Action:	Interim Remedial Action Report	
Global Id:	T0603704863	
Action Type:	ENFORCEMENT	
Date:	2009-06-15 00:00:00	
Action:	Staff Letter	
Global Id:	T0603704863	
Action Type:	REMEDIATION	
Date:	1950-01-01 00:00:00	
Action:	Soil Vapor Extraction w/Other	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2007-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603704863	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2009-02-09 00:00:00	
Action:	Other Report / Document	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2007-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603704863	
Action Type:	RESPONSE	

TC3139641.1s Page 70 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
HARRY'S AIRPORT GARAGE (Continued)		S103891278
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	7/11/2002	
Hist Max MTBE Conc in Groundwater:	159	
Hist Max MTBE Conc in Soil:	11.2	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	=	
Soil Qualifier:	=	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	MR. HARRY ACQUARELLI	
RP Address:	6632 W. 87TH ST.	
Program:	LUST	
Lat/Long:	33.9529482 / -1	
Local Agency Staff:	Not reported	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	Not reported	
24 HARRY'S AIRPORT GARAGE		HIST CORTESE
9131 AVIATION		S104565603
INGLEWOOD, CA		N/A
CORTESE:		
Region:	CORTESE	
Facility County Code:	19	
Reg By:	LTNKA	
Reg Id:	R-09799	
24 BODYCOTE HINDERLITER		SLIC
9121 AVIATION		S104404753
INGLEWOOD, CA 90304		N/A
SLIC:		
Region:	4	
Facility Status:	Site Assessment	
SLIC:	0205B	
Substance:	VOCs	
Staff:	AH	
24 COLLINS TRUST		Cortese
9121 AVIATION BLVD		HIST CORTESE
INGLEWOOD, CA 90301		LUST
Cortese:		
Region:	CORTESE	
Envirostor Id:	Not reported	
Site/Facility Type:	Not reported	
Cleanup Status:	Not reported	
Status Date:	Not reported	
Site Code:	Not reported	
Latitude:	Not reported	

TC3139641.1s Page 72 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
HARRY'S AIRPORT GARAGE (Continued)		S103891278
Date:	2009-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2011-01-21 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2004-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603704863	
Action Type:	RESPONSE	
Date:	2004-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	R-09799	
Status:	Pollution Characterization	
Substance:	Gasoline	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Groundwater	
Abatement Method Used at the Site:	Not reported	
Global Id:	T0603704863	
W Global ID:	Not reported	
Staff:	CEC	
Local Agency:	19000	
Cross Street:	ARBOR VITAE	
Enforcement Type:	SEL	
Date Leak Discovered:	3/10/1999	
Date Leak First Reported:	4/29/1999	
Date Leak Record Entered:	Not reported	
Date Confirmation Began:	3/10/1999	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	4/29/1999	
Date the Case was Closed:	Not reported	
How Leak Discovered:	Repair Tank	
How Leak Stopped:	Not reported	
Cause of Leak:	Not reported	
Leak Source:	Tank	
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	3344.1819139337594765239051362	
Source of Cleanup Funding:	Tank	
Preliminary Site Assessment Workplan Submitted:	11/14/2001	
Preliminary Site Assessment Began:	7/11/2002	
Pollution Characterization Began:	8/28/2003	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	

TC3139641.1s Page 71 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
COLLINS TRUST (Continued)		S102428214
Longitude:	Not reported	
EPA Id:	Not reported	
Owner:	Bodycote Hinderliter	
Enf Type:	CAO	
Effective Date:	10/27/1999	
Order No:	99-005	
Region:	4	
WDID:	4SLIC205B	
Swat R:	Not reported	
Waste Discharger System Num:	Not reported	
Solid Waste Id Num:	Not reported	
Waste Management Unit Name:	Not reported	
Agency Name:	Not reported	
Region:	CORTESE	
Envirostor Id:	Not reported	
Site/Facility Type:	Not reported	
Cleanup Status:	Not reported	
Status Date:	Not reported	
Site Code:	Not reported	
Latitude:	Not reported	
Longitude:	Not reported	
EPA Id:	Not reported	
Owner:	Bodycote Hinderliter	
Enf Type:	CAO	
Effective Date:	10/27/1999	
Order No:	R4-1999-0101	
Region:	4	
WDID:	4SLIC205B	
Swat R:	Not reported	
Waste Discharger System Num:	Not reported	
Solid Waste Id Num:	Not reported	
Waste Management Unit Name:	Not reported	
Agency Name:	Not reported	
CORTESE:		
Region:	CORTESE	
Facility County Code:	19	
Reg By:	LTNKA	
Reg Id:	R-23232	
LUST:		
Region:	STATE	
Global Id:	T0603705303	
Latitude:	33.953192	
Longitude:	-118.377519	
Case Type:	LUST Cleanup Site	
Status:	Completed - Case Closed	
Status Date:	1997-01-28 00:00:00	
Lead Agency:	LOS ANGELES COUNTY	
Case Worker:	JOA	
Local Agency:	LOS ANGELES COUNTY	
RE Case Number:	R-23232	
LOC Case Number:	Not reported	
File Location:	Not reported	
Potential Media Affect:	Soil	

TC3139641.1s Page 73 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
COLLINS TRUST (Continued)		S102428214
Potential Contaminants of Concern: Other Solvent or Non-Petroleum Hydrocarbon		
Site History: Not reported		
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603705393	
Contact Type:	Local Agency Caseworker	
Contact Name:	JOHN AWUJO	
Organization Name:	LOS ANGELES COUNTY	
Address:	900 S FREMONT AVE	
City:	ALHAMBRA	
Email:	Not reported	
Phone Number:	6264583507	
Global Id: T0603705393		
Contact Type:	Regional Board Caseworker	
Contact Name:	YUE RONG	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yrong@waterboards.ca.gov	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603705393	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Stopped	
Global Id: T0603705393		
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id: T0603705393		
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	R-23232	
Status:	Case Closed	
Substance:	Hydrocarbons	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Soil	
Abatement Method Used at the Site:	Excavate and Dispose	
Global ID:	T0603705393	
W Global ID:	Not reported	
Staff:	UNK	
Local Agency:	19000	
Cross Street:	ARBOR VITAE	

TC3139641.1s Page 74 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
COLLINS TRUST PROPERTY FORMER (Continued)		S102428212
Latitude: 33.9532745647437		
Longitude: -118.377342224121		
Case Type: LUST Cleanup Site		
Status: Completed - Case Closed		
Status Date: 2011-02-15 00:00:00		
Lead Agency: LOS ANGELES RWQCB (REGION 4)		
Case Worker: WXT		
Local Agency: LOS ANGELES COUNTY		
RB Case Number: R-23231		
LOC Case Number: 017720-022321		
File Location: Regional Board		
Potential Media Affect: Aquifer used for drinking water supply		
Potential Contaminants of Concern: Other Solvent or Non-Petroleum Hydrocarbon, Waste Oil / Motor / Hydraulic / Lubricating		
Site History: Not reported		
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603705392	
Contact Type:	Regional Board Caseworker	
Contact Name:	DAVID M. BJOSTAD	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4th Street, Suite 200	
City:	Los Angeles	
Email:	Not reported	
Phone Number:	Not reported	
Global Id: T0603705392		
Contact Type:	Local Agency Caseworker	
Contact Name:	PHILLIP GHARIBIAN-TABRIZI	
Organization Name:	LOS ANGELES COUNTY	
Address:	900 S. FREMONT AVE.	
City:	ALHAMBRA	
Email:	pgharibians@dpw.lacounty.gov	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603705392	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Stopped	
Global Id: T0603705392		
Action Type:	ENFORCEMENT	
Date:	2009-06-11 00:00:00	
Action:	Staff Letter	
Global Id: T0603705392		
Action Type:	RESPONSE	
Date:	2009-07-10 00:00:00	
Action:	Other Report / Document	
Global Id: T0603705392		
Action Type:	ENFORCEMENT	
Date:	2011-02-15 00:00:00	
Action:	Closure/No Further Action Letter	

TC3139641.1s Page 76 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
COLLINS TRUST (Continued)		S102428214
Enforcement Type: Not reported		
Date Leak Discovered:	5/16/1996	
Date Leak First Reported:	5/16/1996	
Date Leak Record Entered:	6/14/1996	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	5/16/1996	
Date Case Last Changed on Database:	1/28/1997	
Date the Case was Closed:	1/28/1997	
How Leak Discovered:	Tank Closure	
How Leak Stopped:	Not reported	
Cause of Leak:	UNK	
Leak Source:	UNK	
Operator:	AKA RV SUPPLIES	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	3351.5100472834445617894046753	
Source of Cleanup Funding:	UNK	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	5/16/1996	
Pollution Characterization Began:	Not reported	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	0	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	Not reported	
Soil Qualifier:	ND	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	UNION BANK OF CALIFORNIA	
RP Address:	P.O. BOX 926, LA PUENTE, CA 91747-0926	
Program:	LUST	
Lat/Long:	33.9530102 / -1	
Local Agency Staff:	Not reported	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	Not reported	

24 **COLLINS TRUST PROPERTY FORMER** **HIST CORTESE** **S102428212**
9117-9121 AVIATION BLVD **LUST** **N/A**
INGLEWOOD, CA 90301

CORTESE:

Region: CORTESE

Facility County Code: 19

Reg By: LTNKA

Reg Id: R-23231

LUST:

Region: STATE

Global Id: T0603705392

TC3139641.1s Page 75 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
COLLINS TRUST PROPERTY FORMER (Continued)		S102428212
Global Id: T0603705392		
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id: T0603705392		
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id: T0603705392		
Action Type:	REMEDATION	
Date:	1950-01-01 00:00:00	
Action:	Excavate and Dispose	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	R-23231	
Status:	Preliminary site assessment workplan submitted	
Substance:	Hydrocarbons	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Soil	
Abatement Method Used at the Site:	OT	
Global ID:	T0603705392	
W Global ID:	Not reported	
Staff:	UNK	
Local Agency:	19000	
Cross Street:	ARBOR	
Enforcement Type:	Not reported	
Date Leak Discovered:	5/16/1993	
Date Leak First Reported:	5/16/1996	
Date Leak Record Entered:	6/14/1996	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	12/26/1995	
Date Case Last Changed on Database:	5/16/1996	
Date the Case was Closed:	Not reported	
How Leak Discovered:	Tank Closure	
How Leak Stopped:	Not reported	
Cause of Leak:	UNK	
Leak Source:	UNK	
Operator:	KERCHNER, STEVEN	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	3098.9893297584873258396736883	
Source of Cleanup Funding:	UNK	
Preliminary Site Assessment Workplan Submitted:	5/16/1996	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	Not reported	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	Not reported	

TC3139641.1s Page 77 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
COLLINS TRUST PROPERTY FORMER (Continued)		S102428212
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	UNION BANK	
RP Address:	445 S FIGUEROA ST. 3RD FL, LOS ANGELES CA 90071	
Program:	LUST	
Lat/Long:	33.9544442 / -1	
Local Agency Staff:	Not reported	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	Not reported	

24	FREIGHT FOREARDERS 9107 S AVIATION BLVD INGLEWOOD, CA	LUST SLIC	S102061375 N/A
LUST REG 4:			
Region:	4		
Regional Board:	04		
County:	Los Angeles		
Facid:	R-15997		
Status:	Case Closed		
Substance:	Gasoline		
Substance Quantity:	Not reported		
Local Case No:	Not reported		
Case Type:	Groundwater		
Abatement Method Used at the Site:	Not reported		
Global ID:	T0603793015		
W Global ID:	Not reported		
Staff:	JW		
Local Agency:	19000		
Cross Street:	Not reported		
Enforcement Type:	CLOS		
Date Leak Discovered:	10/23/1990		
Date Leak First Reported:	11/24/1999		
Date Leak Record Entered:	Not reported		
Date Confirmation Began:	11/24/1999		
Date Leak Stopped:	Not reported		
Date Case Last Changed on Database:	11/24/1999		
Date the Case was Closed:	1/22/2004		
How Leak Discovered:	OM		
How Leak Stopped:	Not reported		
Cause of Leak:	Tank		
Leak Source:	Not reported		
Operator:	Not reported		
Water System:	Not reported		
Well Name:	Not reported		
Approx. Dist To Production Well (ft):	3490.1792150021303613749188798		
Source of Cleanup Funding:	Tank		
Preliminary Site Assessment Workplan Submitted:	3/25/2002		
Preliminary Site Assessment Began:	4/22/2002		

TC3139641.1s Page 78 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
AVON RENT-A-CAR (Continued)		S102424819
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Case Worker:	YR	
Local Agency:	LOS ANGELES, CITY OF	
RR Case Number:	900450052	
LOC Case Number:	Not reported	
File Location:	Not reported	
Potential Media Affect:	Soil	
Potential Contaminants of Concern:	Waste Oil / Motor / Hydraulic / Lubricating	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603701032	
Contact Type:	Regional Board Caseworker	
Contact Name:	YUE RONG	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yrong@waterboards.ca.gov	
Phone Number:	Not reported	
Global Id:		
Contact Type:	T0603701032	
Contact Name:	Local Agency Caseworker	
Organization Name:	ELOY LUNA	
Address:	LOS ANGELES, CITY OF	
City:	200 North Main Street, Suite 1780	
Email:	LOS ANGELES	
Phone Number:	eloy.luna@lacity.org	
	Not reported	

LUST:
Global Id: T0603701032
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Reported

LUST REG 4:
Region: 4
Regional Board: 04
County: Los Angeles
Facid: 900450052
Status: Case Closed
Substance: Waste Oil
Substance Quantity: Not reported
Local Case No: Not reported
Case Type: Soil
Abatement Method Used at the Site: Not reported
Global ID: T0603701032
W Global ID: Not reported
Staff: UNK
Local Agency: 19050
Cross Street: TUPPER
Enforcement Type: Not reported
Date Leak Discovered: Not reported
Date Leak First Reported: 6/6/1985

TC3139641.1s Page 80 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
FREIGHT FOREARDERS (Continued)		S102061375
Pollution Characterization Began:	Not reported	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	UNION BANK OF CA	
RP Address:	500 S. MAIN ST., STE. #320, ORANGE, CA 92668	
Program:	SLIC	
Lat/Long:	33.953798 / -1	
Local Agency Staff:	Not reported	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	ONGOING INVESTIGATION WITH CRWQCB (SITE CLEANUP UNIT)	

SLIC:
Region: STATE
Facility Status: Completed - Case Closed
Status Date: 2004-01-22 00:00:00
Global Id: T0603793015
Lead Agency: LOS ANGELES RWQCB (REGION 4)
Lead Agency Case Number: Not reported
Latitude: 33.953798
Longitude: -118.377264
Case Type: Cleanup Program Site
Case Worker: JW
Local Agency: LOS ANGELES COUNTY
RR Case Number: R-15997
File Location: Not reported
Potential Media Affected: Aquifer used for drinking water supply
Potential Contaminants of Concern: Gasoline
Site History: Not reported

Click here to access the California GeoTracker records for this facility:

25	AVON RENT-A-CAR 9220 SEPULVEDA BLVD WESTCHESTER, CA 90045	LUST	S102424819 N/A
LUST:			
Region:	STATE		
Global Id:	T0603701032		
Latitude:	33.9531669		
Longitude:	-118.3959468		
Case Type:	LUST Cleanup Site		
Status:	Completed - Case Closed		
Status Date:	1989-12-12 00:00:00		

TC3139641.1s Page 79 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
AVON RENT-A-CAR (Continued)		S102424819
Date Leak Record Entered:	12/31/1986	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	12/12/1988	
Date the Case was Closed:	12/12/1988	
How Leak Discovered:	Not reported	
How Leak Stopped:	Not reported	
Cause of Leak:	UNK	
Leak Source:	UNK	
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	8927.325302650565979614268875	
Source of Cleanup Funding:	UNK	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	7/14/1989	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	BLANK RP	
RP Address:	Not reported	
Program:	LUST	
Lat/Long:	33.9531669 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	CONTAMINATED SOIL REMOVED. NO FURTHER ACTION REQUIRED. DAB CASE.	ORIGINALLY

25	9150 SOUTH SEPULVEDA BLVD LOS ANGELES, CA 90045	CHMIRS	S109041108 N/A
----	--	---------------	---------------------------

CHMIRS:
OES Incident Number: 06-4693
OES notification: 8/7/2006 11:46:47 AM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported

TC3139641.1s Page 81 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
(Continued)		S109041108
Surrounding Area:	Not reported	
Estimated Temperature:	Not reported	
Property Management:	Not reported	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	Not reported	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DOT/PUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	Not reported	
Waterway:	Storm Drains	
Spill Site:	Not reported	
Cleanup By:	Unknown	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	2006	
Agency:	Citizen	
Incident Date:	8/3/2006 12:00:00 AM	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	No	
Site Type:	Merchant/Business	
E Date:	Not reported	
Substance:	Motor Oil	
Quantity Released:	Not reported	
BBLs:	0	
Cups:	0	
CUFF:	0	
Gallons:	0.000000	
Grams:	0	
Pounds:	0	
Liters:	0	
Ounces:	0	
Pints:	0	
Quarts:	0	
Sheen:	0	
TC3139641.1s Page 82 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
26	PRINCELAND PROPERTY 1237 ARBOR VITAE INGLEWOOD, CA 90301	SLIC S104404744 N/A
SLIC:		
Region:	4	
Facility Status:	Remediation	
SLIC:	0730	
Substance:	VOC	
Staff:	PGN	
26	PRINCELAND PROPERTIES 1237 W ARBOR VITAE ST INGLEWOOD, CA	SLIC S106023738 N/A
SLIC:		
Region:	STATE	
Facility Status:	Open	
Status Date:	1999-01-01 00:00:00	
Global Id:	SL603792562	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Lead Agency Case Number:	Not reported	
Latitude:	33.953059	
Longitude:	-118.378203	
Case Type:	Cleanup Program Site	
Case Worker:	Not reported	
Local Agency:	Not reported	
RB Case Number:	0730	
File Location:	Not reported	
Potential Media Affected:	Not reported	
Potential Contaminants of Concern:	Not reported	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
27	901 ARBOR VITAE 901 ARBOR VITAE INGLEWOOD, CA	ERNS 8715801 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		
28	KING DELIVERY, INC 5600 ARBOR VITAE ST W WESTCHESTER, CA 90045	HIST CORTESE S104159630 LUST N/A
CORTESE:		
Region:	CORTESE	
Facility County Code:	19	
Reg By:	LTNKA	
Reg Id:	900450143	
LUST:		
Region:	STATE	
TC3139641.1s Page 84 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
(Continued)		S109041108
Tons:	0	
Unknown:	0	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	Caller states a rental car lot is dumping substance into the storm drains.	
26	PRINCELAND PROPERTY 1237 W ARBOR VITAE ST INGLEWOOD, CA 90301	SLIC S106485839 N/A
SLIC:		
Region:	STATE	
Facility Status:	Open - Assessment & Interim Remedial Action	
Status Date:	2009-05-26 00:00:00	
Global Id:	SLT43607605	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Lead Agency Case Number:	Not reported	
Latitude:	33.953059	
Longitude:	-118.378203	
Case Type:	Cleanup Program Site	
Case Worker:	PGN	
Local Agency:	Not reported	
RB Case Number:	0730	
File Location:	Regional Board	
Potential Media Affected:	Aquifer used for drinking water supply, Soil, Soil Vapor	
Potential Contaminants of Concern:	Other Chlorinated Hydrocarbons, Tetrachloroethylene (PCE), Trichloroethylene (TCE), Other Metal	
Site History:	The site was formerly used for degreasing operations, plastic extrusion and furniture distribution between the 1940s and the early 1990s. The industrial buildings were demolished in 1993 and since that time, the Site has been used for rental car parking. A Soil Vapor Extraction (SVE) system has been operational at the Site since November 3, 2004, to address chlorinated solvent contamination detected in soil beneath the Site during prior assessments. A different SVE system had operated at the Site between August 25, 1999 and April 28, 2000, after which it was shut down. Soil and groundwater investigations have been in progress at the Site since 1997 under the oversight of the Regional Board. Based upon the information provided in the technical reports submitted to the Regional Board, the previous chemical use, storage and/or disposal practices at this Site during former manufacturing, degreasing and spray painting operations have contaminated the underlying soil and groundwater. The potential source areas identified in prior studies include the cinder block vault area, former degreasing room, and former spray painting areas, two former manholes, former hydraulic lift tank, a former clarifier and an east-west trending drainage line. The Volatile Organic Compounds (VOCs) present in groundwater beneath the Site, at concentrations above their respective Maximum Contaminant Levels (MCLs) established by the California Department of Health Services, have degraded the beneficial uses of the State's groundwater resources.	
Click here to access the California GeoTracker records for this facility:		
TC3139641.1s Page 83 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
KING DELIVERY, INC (Continued)		S104159630
Global Id:	T0603701040	
Latitude:	33.9524172	
Longitude:	-118.378223	
Case Type:	LUST Cleanup Site	
Status:	Open - Assessment & Interim Remedial Action	
Status Date:	2010-08-06 00:00:00	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Case Worker:	MSH	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450143	
LOC Case Number:	Not reported	
File Location:	Regional Board	
Potential Media Affect:	Aquifer used for drinking water supply	
Potential Contaminants of Concern:	Gasoline	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603701040	
Contact Type:	Regional Board Caseworker	
Contact Name:	CHANDRA CANSLER	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	Not reported	
City:	R4 UNKNOWN	
Email:	ccansler@waterboards.ca.gov	
Phone Number:	Not reported	
Global Id:	T0603701040	
Contact Type:	Local Agency Caseworker	
Contact Name:	ELOY LUNA	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 North Main Street, Suite 1780	
City:	LOS ANGELES	
Email:	eloy.luna@lacity.org	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2011-07-15 00:00:00	
Action:	Soil and Water Investigation Workplan	
Global Id:	T0603701040	
Action Type:	ENFORCEMENT	
Date:	2004-01-29 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701040	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Stopped	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2005-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
TC3139641.1s Page 85 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
KING DELIVERY, INC (Continued)		S104159630
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2003-07-14 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2003-04-16 00:00:00	
Action:	Interim Remedial Action Plan	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2010-08-10 00:00:00	
Action:	Clean Up Fund - 5-Year Review Summary	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2008-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2005-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2006-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	ENFORCEMENT	
Date:	2004-05-06 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2007-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2011-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701040	
Action Type:	ENFORCEMENT	
Date:	2010-08-06 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701040	
Action Type:	ENFORCEMENT	

TC3139641.1s Page 86 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
KING DELIVERY, INC (Continued)		S104159630
Global Id:	T0603701040	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2006-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2006-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2007-09-14 00:00:00	
Action:	Interim Remedial Action Plan	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2007-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2004-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2004-08-15 00:00:00	
Action:	Soil and Water Investigation Report	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2004-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2003-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	ENFORCEMENT	
Date:	2001-07-19 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2004-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	

TC3139641.1s Page 88 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
KING DELIVERY, INC (Continued)		S104159630
Date:	2007-10-12 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701040	
Action Type:	ENFORCEMENT	
Date:	2006-09-14 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701040	
Action Type:	ENFORCEMENT	
Date:	2011-05-17 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2007-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	ENFORCEMENT	
Date:	2001-06-13 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2011-07-15 00:00:00	
Action:	Site Assessment Report	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2012-07-15 00:00:00	
Action:	Other Report / Document	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2011-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2012-07-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701040	
Action Type:	ENFORCEMENT	
Date:	2007-09-14 00:00:00	
Action:	Clean-up and Abatement Order	
Global Id:	T0603701040	
Action Type:	ENFORCEMENT	
Date:	2003-06-30 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2003-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	

TC3139641.1s Page 87 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
KING DELIVERY, INC (Continued)		S104159630
Date:	2008-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2007-12-15 00:00:00	
Action:	Other Report / Document	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2009-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2011-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2010-09-30 00:00:00	
Action:	Well Installation Report	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2006-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2007-08-17 00:00:00	
Action:	Soil and Water Investigation Workplan	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2004-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	ENFORCEMENT	
Date:	2002-04-02 00:00:00	
Action:	13267 Requirement	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2012-07-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2007-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2005-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	

TC3139641.1s Page 89 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
KING DELIVERY, INC (Continued)		S104159630
Global Id:	T0603701040	
Action Type:	ENFORCEMENT	
Date:	2009-06-15 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2004-03-01 00:00:00	
Action:	Soil and Water Investigation Workplan	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2005-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2008-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701040	
Action Type:	RESPONSE	
Date:	2008-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	

LUST REG 4:
Region: 4
Regional Board: 04
County: Los Angeles
Facid: 900450143
Status: Remediation Plan
Substance: Gasoline
Substance Quantity: Not reported
Local Case No: Not reported
Case Type: Groundwater
Abatement Method Used at the Site: Cap Site
Global ID: T0603701040
W Global ID: Not reported
Staff: MSH
Local Agency: 19050
Cross Street: BELLANCA AVENUE
Enforcement Type: SEL
Date Leak Discovered: 2/15/1988
Date Leak First Reported: 3/25/1988
Date Leak Record Entered: 6/22/1988
Date Confirmation Began: Not reported
Date Leak Stopped: 10/21/1987
Date Case Last Changed on Database: 7/9/2001
Date the Case was Closed: Not reported
How Leak Discovered: Subsurface Monitoring
How Leak Stopped: Not reported
Cause of Leak: Not reported
Leak Source: Not reported
Operator: Not reported
Water System: Not reported
Well Name: Not reported

TC3139641.1s Page 90 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S109039938
Surrounding Area:	Not reported	
Estimated Temperature:	Not reported	
Property Management:	Not reported	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	Not reported	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/Year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CAD/OT/PUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	Not reported	
Waterway:	Not reported	
Spill Site:	Not reported	
Cleanup By:	Reporting Party	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	2007	
Agency:	NRC	
Incident Date:	4/21/2007 12:00:00 AM	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	Yes	
Site Type:	Merchant/Business	
E Date:	Not reported	
Substance:	Oil	
Quantity Released:	Not reported	
BBLs:	0	
Cups:	0	
CUFF:	0	
Gallons:	10	
Grams:	0	
Pounds:	0	
Liters:	0	
Ounces:	0	
Pints:	0	
Quarts:	0	
Sheen:	0	

TC3139641.1s Page 92 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
KING DELIVERY, INC (Continued)		S104159630
Approx. Dist To Production Well (ft):	3779.206422846396540674000359	
Source of Cleanup Funding:	Not reported	
Preliminary Site Assessment Workplan Submitted:	3/25/1988	
Preliminary Site Assessment Began:	9/15/1999	
Pollution Characterization Began:	3/30/2004	
Remediation Plan Submitted:	5/6/2004	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	3/25/1988	
Enforcement Action Date:	3/15/2001	
Historical Max MTBE Date:	7/18/2003	
Hist Max MTBE Conc in Groundwater:	500	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	<	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	NANCY ANGLIN	
RP Address:	5757 W. CENTURY BLVD., 7TH FLOOR	
Program:	LUST	
Lat/Long:	33.9524172 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	REQUIRE GW ASSESSMENT WORKPLAN (FREE PRODUCT SITE) ; 5/12/00 RPT OF WELL INSTALL & SAMPLING; 7/25/00 QMR2; 10/23/00 3RD QTR GW MON RPT 2000; 1/15/01 4TH QTR GW MON RPT 2000	

29 5630 ARBORVITAE ST
5630 ARBORVITAE ST
LOS ANGELES, CA

ERNS 2007310146
N/A

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

29 5630 ARBORVITAE ST
LOS ANGELES, CA

CHMIRS: S109039938
N/A

OES Incident Number: 07-2452
OES notification: 4/21/2007 03:47:14 PM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported

TC3139641.1s Page 91 of 351

Map ID		EDR ID Number
Direction		
Distance		
Distance (ft.)	Site	Database(s) EPA ID Number
(Continued)		S109039938
Tons:	0	
Unknown:	0	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	THE CALLER IS REPORTING A HOSE BROKE ON AN OIL STORAGE TANK SPILLING OIL ONTO THE GROUND. THE CAUSE OF THE INCIDENT IS UNKNOWN.	
30	NEUTROGENA FACILITY 5800 ARBOR VITAE AVE LOS ANGELES, CA 90045	HIST CORTESE LUST S102434324 N/A
CORTESE:		
Region:	CORTESE	
Facility County Code:	19	
Reg By:	LTNKA	
Reg Id:	900450334	
LUST:		
Region:	STATE	
Global Id:	T0603701056	
Latitude:	33.9526247	
Longitude:	-118.3797929	
Case Type:	LUST Cleanup Site	
Status:	Completed - Case Closed	
Status Date:	1997-01-14 00:00:00	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Case Worker:	YR	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450334	
LOC Case Number:	Not reported	
File Location:	Not reported	
Potential Media Affect:	Aggiler used for drinking water supply	
Potential Contaminants of Concern:	Diesel	
Site History:	Not reported	

Click here to access the California GeoTracker records for this facility:

LUST:
Global Id: T0603701056
Contact Type: Regional Board Caseworker
Contact Name: YUE RONG
Organization Name: LOS ANGELES RWQCB (REGION 4)
Address: 320 W. 4TH ST., SUITE 200
City: Los Angeles
Email: yrong@waterboards.ca.gov
Phone Number: Not reported
Global Id: T0603701056
Contact Type: Local Agency Caseworker
Contact Name: ELOY LUNA
Organization Name: LOS ANGELES, CITY OF
Address: 200 North Main Street, Suite 1780
City: LOS ANGELES
Email: eloy.luna@lacity.org
Phone Number: Not reported

TC3139641.1s Page 93 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
NEUTROGENA FACILITY (Continued)		S102434324
LUST:		
Global Id:	T0603701056	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Stopped	
Global Id:	T0603701056	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603701056	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	900450334	
Status:	Case Closed	
Substance:	Diesel	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Groundwater	
Abatement Method Used at the Site:	Not reported	
Global Id:	T0603701056	
W Global ID:	Not reported	
Staff:	UNK	
Local Agency:	19050	
Cross Street:	AIRPORT BLVD	
Enforcement Type:	Not reported	
Date Leak Discovered:	4/28/1993	
Date Leak First Reported:	9/18/1996	
Date Leak Record Entered:	10/8/1996	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	4/28/1993	
Date Case Last Changed on Database:	4/18/1979	
Date the Case was Closed:	1/14/1997	
How Leak Discovered:	Tank Closure	
How Leak Stopped:	Not reported	
Cause of Leak:	Not reported	
Leak Source:	Not reported	
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	5062.6080257730121536321529797	
Source of Cleanup Funding:	Not reported	
Preliminary Site Assessment Workplan Submitted:	10/26/1995	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	Not reported	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	1/8/1997	
Post Remedial Action Monitoring Began:	Not reported	
TC3139641.1s Page 94 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
AVIS RENT-A-CAR (Continued)		S100698306
Organization Name:		
Address:	LOS ANGELES RWQCB (REGION 4)	
City:	320 WEST 4TH STREET, SUITE 200	
Email:	LOS ANGELES	
Phone Number:	jhuang@waterboards.ca.gov	
2135766711		
Global Id:	T0603701057	
Contact Type:	Local Agency Caseworker	
Contact Name:	ELOY LUNA	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 North Main Street, Suite 1780	
City:	LOS ANGELES	
Email:	elcyl.luna@lacity.org	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603701057	
Action Type:	ENFORCEMENT	
Date:	2006-09-22 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701057	
Action Type:	RESPONSE	
Date:	2007-07-23 00:00:00	
Action:	Soil and Water Investigation Report	
Global Id:	T0603701057	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Stopped	
Global Id:	T0603701057	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603701057	
Action Type:	RESPONSE	
Date:	2011-01-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701057	
Action Type:	RESPONSE	
Date:	2010-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701057	
Action Type:	RESPONSE	
Date:	2009-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701057	
Action Type:	ENFORCEMENT	
Date:	2004-08-18 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701057	
TC3139641.1s Page 96 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
NEUTROGENA FACILITY (Continued)		S102434324
Enforcement Action Date:		
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	NEUTROGENA CORPORATION	
RP Address:	5760 W 96TH ST, LOS ANGELES CA 90045	
Program:	LUST	
Lat/Long:	33.9524301 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	02/26/06 - BIOVENTING SYSTEM STATUS REPORT 10/17/94 - PERMIT APPLICATION PACKAGE FOR SOIL REMEDIATION 02/07/94 - WORKPLAN DIESEL IMPACTED SOIL REMEDIATION 04/18/97 - VE & GW MONITORING WELL ABANDONMENT	
31	AVIS RENT-A-CAR 9217 AIRPORT BLVD WESTCHESTER, CA 90045	HIST CORTESE LUST S100698306 N/A
CORTESE:		
Region:	CORTESE	
Facility County Code:	19	
Reg By:	L7NKA	
Reg Id:	900450343	
LUST:		
Region:	STATE	
Global Id:	T0603701057	
Latitude:	33.9524041	
Longitude:	-118.3859765	
Case Type:	LUST Cleanup Site	
Status:	Open - Remediation	
Status Date:	2006-09-22 00:00:00	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Case Worker:	JH	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450343	
LOC Case Number:	Not reported	
File Location:	Regional Board	
Potential Media Affect:	Aquifer used for drinking water supply	
Potential Contaminants of Concern:	Gasoline	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603701057	
Contact Type:	Regional Board Caseworker	
Contact Name:	JAY HUANG	
TC3139641.1s Page 95 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
AVIS RENT-A-CAR (Continued)		S100698306
Action Type:		
Date:	ENFORCEMENT	
Action:	2004-04-26 00:00:00	
Global Id:	T0603701057	
Action Type:	RESPONSE	
Date:	2006-12-15 00:00:00	
Action:	Final Remedial Action Report / Corrective Action Report	
Global Id:	T0603701057	
Action Type:	RESPONSE	
Date:	2006-12-15 00:00:00	
Action:	Well Installation Report	
Global Id:	T0603701057	
Action Type:	RESPONSE	
Date:	2006-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701057	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id:	T0603701057	
Action Type:	RESPONSE	
Date:	2006-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701057	
Action Type:	RESPONSE	
Date:	2006-07-24 00:00:00	
Action:	CAP/RAP - Final Remediation / Design Plan	
Global Id:	T0603701057	
Action Type:	RESPONSE	
Date:	2004-05-31 00:00:00	
Action:	Other Report / Document	
Global Id:	T0603701057	
Action Type:	ENFORCEMENT	
Date:	2009-06-15 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701057	
Action Type:	RESPONSE	
Date:	2004-11-01 00:00:00	
Action:	Soil and Water Investigation Workplan	
Global Id:	T0603701057	
Action Type:	RESPONSE	
Date:	2010-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
LUST REG 4:		
Region:	4	
TC3139641.1s Page 97 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
AVIS RENT-A-CAR (Continued)		S100698306
Regional Board:	04	
County:	Los Angeles	
Facid:	900450343	
Status:	Preliminary site assessment underway	
Substance:	Gasoline	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Soil	
Abatement Method Used at the Site:	Not reported	
Global ID:	T0603701057	
W Global ID:	Not reported	
Staff:	JH	
Local Agency:	19050	
Cross Street:	CENTURY	
Enforcement Type:	SEL	
Date Leak Discovered:	6/1/1990	
Date Leak First Reported:	6/1/1990	
Date Leak Record Entered:	12/12/1991	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	6/1/1990	
Date Case Last Changed on Database:	10/25/1991	
Date the Case was Closed:	Not reported	
How Leak Discovered:	Inventory Control	
How Leak Stopped:	Not reported	
Cause of Leak:	Other Cause	
Leak Source:	Piping	
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	5903.443552749080371354138607	
Source of Cleanup Funding:	Piping	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	6/1/1990	
Pollution Characterization Began:	Not reported	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	MR. ED MARIOTTI	
RP Address:	9217 AIRPORT BLVD.	
Program:	LUST	
Lat/Long:	33.9524041 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	Not reported	

TC3139641.1s Page 98 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
NATIONAL CAR SALES (Continued)		S109117681
Case Type:	LUST Cleanup Site	
Status:	Open - Remediation	
Status Date:	1990-12-04 00:00:00	
Lead Agency:	LOS ANGELES, CITY OF	
Case Worker:	ML	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	Not reported	
LOC Case Number:	XS0000439	
File Location:	Not reported	
Potential Media Affect:	Soil	
Potential Contaminants of Concern:	Gasoline	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603776617	
Contact Type:	Local Agency Caseworker	
Contact Name:	MARCUS LOOK	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 N. MAIN ST. RM. 970	
City:	LOS ANGELES	
Email:	Not reported	
Phone Number:	Not reported	
Global Id:		
Contact Type:	Regional Board Caseworker	
Contact Name:	YUE RONG	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yrong@waterboards.ca.gov	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603776617	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id:		
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	

TC3139641.1s Page 100 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
ARBOR VITRE(ARID) LA CIENEGA INGLEWOOD, CA		CHMIRS S100278913 N/A
CHMIRS:		
OES Incident Number:	8802281	
OES notification:	Not reported	
OES Date:	Not reported	
OES Time:	Not reported	
Incident Date:	20-JUL-88	
Date Completed:	20-JUL-88	
Property Use:	962	

TC3139641.1s Page 101 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
NATIONAL CAR SALES 9204 S AIRPORT BLVD LOS ANGELES, CA		LUST S109117681 N/A
LUST:		
Region:	STATE	
Global Id:	T0603768170	
Latitude:	33.808911	
Longitude:	-118.154377	
Case Type:	LUST Cleanup Site	
Status:	Open - Remediation	
Status Date:	1990-12-04 00:00:00	
Lead Agency:	LOS ANGELES, CITY OF	
Case Worker:	ML	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	Not reported	
LOC Case Number:	Not reported	
File Location:	Not reported	
Potential Media Affect:	Soil	
Potential Contaminants of Concern:	Gasoline	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603768170	
Contact Type:	Local Agency Caseworker	
Contact Name:	MARCUS LOOK	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 N. MAIN ST. RM. 970	
City:	LOS ANGELES	
Email:	Not reported	
Phone Number:	Not reported	
Global Id:		
Contact Type:	Regional Board Caseworker	
Contact Name:	YUE RONG	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yrong@waterboards.ca.gov	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603768170	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id:		
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Region:		
Global Id:	T0603776617	
Latitude:	33.808911	
Longitude:	-118.154377	

TC3139641.1s Page 99 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S100278913
Agency Id Number:	19090	
Agency Incident Number:	88042284	
Time Notified:	1804	
Time Completed:	2210	
Surrounding Area:	962	
Estimated Temperature:	78	
Property Management:	C	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	N	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DOT/PU/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	CAPT PAUL MORGAN #13	
Report Date:	22-JUL-88	
Comments:	Y	
Facility Telephone:	213 412-5356	
Waterway Involved:	Not reported	
Waterway:	Not reported	
Spill Site:	Not reported	
Cleanup By:	Not reported	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	88-92	
Agency:	Not reported	
Incident Date:	Not reported	
Admin Agency:	Not reported	
Amount:	Not reported	
Contained:	Not reported	
Site Type:	Not reported	
E Date:	Not reported	
Substance:	Not reported	
Quantity Released:	Not reported	
BBLs:	Not reported	
Cups:	Not reported	
CUFFT:	Not reported	
Gallons:	Not reported	
Grams:	Not reported	
Pounds:	Not reported	
Liters:	Not reported	

TC3139641.1s Page 101 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
		EPA ID Number
(Continued)		S100278913
Ounces:	Not reported	
Pints:	Not reported	
Quarts:	Not reported	
Shewn:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	
Evacuations:	Not reported	
Number of Injuries:	Not reported	
Number of Fatalities:	Not reported	
Description:	Not reported	

33	HONEYWELL INTERNATIONAL CORP. 9225 AVIATION LOS ANGELES, CA 90045	SLIC	S104549281 N/A
SLIC:			
Region:	4		
Facility Status:	Post Remediation Monitoring		
SLIC:	0379		
Substance:	TPH/VOCs		
Staff:	DBR		

33	HONEYWELL INTERNATIONAL CORP. 9225 AVIATION BOULEVARD LOS ANGELES, CA	SLIC	S106483903 N/A
SLIC:			
Region:	STATE		
Facility Status:	Open - Site Assessment		
Status Date:	2000-06-30 00:00:00		
Global Id:	SL204221522		
Lead Agency:	LOS ANGELES RWQCB (REGION 4)		
Lead Agency Case Number:	Not reported		
Latitude:	33.9514234490459		
Longitude:	-118.378007411957		
Case Type:	Cleanup Program Site		
Case Worker:	SR		
Local Agency:	Not reported		
RB Case Number:	0379		
File Location:	Not reported		
Potential Media Affected:	Not reported		
Potential Contaminants of Concern:	Not reported		
Site History:	Not reported		

Click here to access the California GeoTracker records for this facility:

TC3139641.1s Page 102 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
		EPA ID Number
AVIS/FORMER NATIONAL CAR RENTAL (Continued)		S104163938
Action Type:	RESPONSE	
Date:	2008-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2003-01-15 00:00:00	
Action:	CAPRAP - Final Remediation / Design Plan	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2008-12-27 00:00:00	
Action:	Soil and Water Investigation Report	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2005-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603701065	
Action Type:	ENFORCEMENT	
Date:	2008-12-24 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2005-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2005-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	ENFORCEMENT	
Date:	2004-02-17 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2006-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	ENFORCEMENT	
Date:	2002-10-30 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701065	
Action Type:	ENFORCEMENT	
Date:	2003-01-17 00:00:00	

TC3139641.1s Page 104 of 351

MAP FINDINGS		EDR ID Number	
Map ID			
Direction			
Distance			
Distance (ft.)	Site	Database(s)	
		EPA ID Number	
34	NATIONAL CAR RENTAL 9419 AIRPORT BLVD LOS ANGELES, CA 90045	HIST CORTESE	U001561875 N/A
CORTESE:			
Region:	CORTESE		
Facility County Code:	19		
Reg By:	LTNKA		
Reg Id:	900450498		

34	AVIS/FORMER NATIONAL CAR RENTAL 9419 AIRPORT BLVD WESTCHESTER, CA 90045	LUST	S104163938 N/A
LUST:			
Region:	STATE		
Global Id:	T0603701065		
Latitude:	33.9502601		
Longitude:	-118.3860625		
Case Type:	LUST Cleanup Site		
Status:	Open - Verification Monitoring		
Status Date:	2007-04-10 00:00:00		
Lead Agency:	LOS ANGELES RWQCB (REGION 4)		
Case Worker:	DMB		
Local Agency:	LOS ANGELES, CITY OF		
RB Case Number:	900450498		
LOC Case Number:	Not reported		
File Location:	Regional Board		
Potential Media Affect:	Aquifer used for drinking water supply		
Potential Contaminants of Concern:	Gasoline		
Site History:	Not reported		

Click here to access the California GeoTracker records for this facility:

LUST:	
Global Id:	T0603701065
Contact Type:	Regional Board Caseworker
Contact Name:	DAVID M. BJOSTAD
Organization Name:	LOS ANGELES RWQCB (REGION 4)
Address:	320 W. 4th Street, Suite 200
City:	Los Angeles
Email:	Not reported
Phone Number:	Not reported
Global Id:	T0603701065
Contact Type:	Local Agency Caseworker
Contact Name:	ELOY LUNA
Organization Name:	LOS ANGELES, CITY OF
Address:	200 North Main Street, Suite 1780
City:	LOS ANGELES
Email:	eloy.luna@lacity.org
Phone Number:	Not reported

LUST:	
Global Id:	T0603701065
Action Type:	RESPONSE
Date:	2004-01-15 00:00:00
Action:	Monitoring Report - Quarterly
Global Id:	T0603701065

TC3139641.1s Page 103 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
		EPA ID Number
AVIS/FORMER NATIONAL CAR RENTAL (Continued)		S104163938
Action:	Staff Letter	
Global Id:	T0603701065	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2006-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2004-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2002-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2002-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2002-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2003-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2003-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2003-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2004-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2007-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	

TC3139641.1s Page 105 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
AVIS/FORMER NATIONAL CAR RENTAL (Continued)		S104163938
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2003-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2003-04-15 00:00:00	
Action:	CAP/RAP - Other Report	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2003-07-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701065	
Action Type:	ENFORCEMENT	
Date:	2009-06-15 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2004-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701065	
Action Type:	REMEDIATION	
Date:	1950-01-01 00:00:00	
Action:	Soil Vapor Extraction w/Other	
Global Id:	T0603701065	
Action Type:	REMEDIATION	
Date:	1950-01-01 00:00:00	
Action:	Excavate and Dispose	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2009-07-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2009-01-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2009-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2009-01-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701065	
Action Type:	ENFORCEMENT	

TC3139641.1s Page 106 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
AVIS/FORMER NATIONAL CAR RENTAL (Continued)		S104163938
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	5864.8941500267167298283096407	
Source of Cleanup Funding:	Other Source	
Preliminary Site Assessment Workplan Submitted:	3/1/1998	
Preliminary Site Assessment Began:	3/1/1998	
Pollution Characterization Began:	5/25/2001	
Remediation Plan Submitted:	10/9/2001	
Remedial Action Underway:	7/15/2003	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	8/6/2003	
Hist Max MTBE Conc in Groundwater:	6300	
Hist Max MTBE Conc in Soil:	35000	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	=	
Soil Qualifier:	=	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	DAVID FAVERO	
RP Address:	1210 S. 5TH ST.	
Program:	LUST	
Lat/Long:	33.9502601 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	2/18/00 INTERIM RPT FOR SUBSURFACE INVESTIGATION: 7/13/00 2ND QTR GW MON RPT 2000; 9/5/00 3RD QTR GW MON RPT; 1/8/01 4TH QTR GW MON RPT 2000	

34

**9419 AIRPORT BLVD.
LOS ANGELES, CA**

CHMIRS: S105885980
N/A

CHMIRS:

OES Incident Number: 02-4612

OES Notification: 8/28/200201:31:06 PM

OES Date: Not reported

OES Time: Not reported

Incident Date: Not reported

Date Completed: Not reported

Property Use: Not reported

Agency Id Number: Not reported

Agency Incident Number: Not reported

Time Notified: Not reported

Time Completed: Not reported

Surrounding Area: Not reported

Estimated Temperature: Not reported

Property Management: Not reported

Special Studies 1: Not reported

Special Studies 2: Not reported

Special Studies 3: Not reported

Special Studies 4: Not reported

Special Studies 5: Not reported

TC3139641.1s Page 108 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
AVIS/FORMER NATIONAL CAR RENTAL (Continued)		S104163938
Date:	2001-05-24 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2007-05-09 00:00:00	
Action:	Soil and Water Investigation Report	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2008-01-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2008-12-27 00:00:00	
Action:	Other Report / Document	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2007-01-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701065	
Action Type:	RESPONSE	
Date:	2004-01-28 00:00:00	
Action:	CAP/RAP - Feasibility Study Report	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	900450498	
Status:	Remedial action (cleanup) Underway	
Substance:	Motor Oil	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Groundwater	
Abatement Method Used at the Site:	Not reported	
Global Id:	T0603701065	
W Global ID:	Not reported	
Staff:	TCS	
Local Agency:	19050	
Cross Street:	096TH ST.	
Enforcement Type:	SEL	
Date Leak Discovered:	8/13/1992	
Date Leak First Reported:	8/19/1992	
Date Leak Record Entered:	12/22/1992	
Date Confirmation Began:	12/1/1997	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	7/12/2002	
Date the Case was Closed:	Not reported	
How Leak Discovered:	OM	
How Leak Stopped:	Not reported	
Cause of Leak:	Spill	
Leak Source:	Other Source	

TC3139641.1s Page 107 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
(Continued)		S105885980
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	Not reported	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DOT/PUC/IOC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	No	
Waterway:	Not reported	
Spill Site:	Not reported	
Cleanup By:	N/A	
Containment:	Not reported	
What Happened:	Not reported	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	2002	
Agency:	Paul Hastings for National Car Rental	
Incident Date:	8/21/200212:00:00 AM	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	Yes	
Site Type:	Merchant/Business	
E Date:	Not reported	
Substance:	Gasoline vapor	
Quantity Released:	Not reported	
BBLs:	0	
Cups:	0	
CUFT:	0	
Gallons:	0.000000	
Grams:	0	
Pounds:	0	
Liters:	0	
Ounces:	0	
Pints:	0	
Quarts:	0	
Sheen:	0	
Tons:	0	
Unknown:	0	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	HISTORICAL: An underground 20,000 gallon tank was releasing vapors on Aug. 21st. The release was stopped immediately upon discovery. The RP attempted contact with the CUPA on Aug. 21st & 22nd, the CUPA	

TC3139641.1s Page 109 of 351

Map ID
Direction
Distance
Distance (ft.)Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

(Continued)

returned their call today advising them to call CA State OES.

S105885980

35

5760 WEST 96 TH ST
LOS ANGELES, CA 90045

CHMIRS S110420372
N/A

CHMIRS:
OES Incident Number: 108-6887
OES notification: 9/22/2008 2:32:16 PM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personnel # Of Decontaminated: Not reported
Responding Agency Personnel # Of Injuries: Not reported
Responding Agency Personnel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Comments: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: Storm drain
Spill Site: Merchant/Business
Cleanup By: Contractor
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Gall(s)
Other: Not reported
Date/Time: 0200
Year: 2008
Agency: Nutrogena Corp
Incident Date: 9/22/2008
Admin Agency: Los Angeles City Fire Department

TC3139641.1s Page 110 of 351

Map ID
Direction
Distance
Distance (ft.)Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

(Continued)

S105651257

Responding Agency Personnel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Comments: Not reported
Facility Telephone: Not reported
Waterway Involved: No
Waterway: Not reported
Spill Site: Not reported
Cleanup By: Reporting Party
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Date/Time: Not reported
Year: 1997
Agency: Nutrogena Corporation
Incident Date: 4/25/1997 12:00:00 AM
Admin Agency: Los Angeles City Fire Department
Amount: Not reported
Contained: Yes
Site Type: Road
E Date: Not reported
Substance: Coaltar
Quantity Released: Not reported
BBLs: 0
Cups: 0
CUFT: 0
Gallons: 20
Grams: 0
Pounds: 0
Liters: 0
Ounces: 0
Pints: 0
Quarts: 0
Sheen: 0
Tons: 0
Unknown: 0
Evacuations: 0
Number of Injuries: 0
Number of Fatalities: 0
Description: Material was loaded onto a truck. The truck left and went to pick up something at another location. Somewhere along the way, 1-3 drums opened up and dripped substance onto the roadway.

TC3139641.1s Page 112 of 351

Map ID
Direction
Distance
Distance (ft.)Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

(Continued)

S110420372

Amount: Not reported
Contained: Yes
Site Type: Storm drain
E Date: Not reported
Substance: Water
Quantity Released: 42,300
BBLs: Not reported
Cups: Not reported
CUFT: Not reported
Gallons: Not reported
Grams: Not reported
Pounds: Not reported
Liters: Not reported
Ounces: Not reported
Pints: Not reported
Quarts: Not reported
Sheen: Not reported
Tons: Not reported
Unknown: Not reported
Evacuations: 0
Number of Injuries: 0
Number of Fatalities: 0
Description: Caller states a 12 inch Stand Pipe which feeds the buildings fire sprinklers broke due to unknown causes. Caller states the water went into the storm drain. Caller states there is a repair crew on site repairing broken pipe. Caller states release started at 0200 Hrs and was controlled at 0300 Hrs this morning. Caller states the building affected will not have personnel working in it until repairs are made (estimated at 2 days).

35

5735 96TH STREET
LOS ANGELES, CA

CHMIRS S105651257
N/A

CHMIRS:
OES Incident Number: 97-1655
OES notification: 4/25/1997 02:45:07 PM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personnel # Of Decontaminated: Not reported
Responding Agency Personnel # Of Injuries: Not reported

TC3139641.1s Page 111 of 351

Map ID
Direction
Distance
Distance (ft.)Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

35

5735 WEST 96TH ST
LOS ANGELES, CA 90045

CHMIRS S107450436
N/A

CHMIRS:
OES Incident Number: 04-1976
OES notification: 4/13/2004 02:00:01 PM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personnel # Of Decontaminated: Not reported
Responding Agency Personnel # Of Injuries: Not reported
Responding Agency Personnel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Comments: Not reported
Facility Telephone: Not reported
Waterway Involved: Not reported
Waterway: Storm Drain/Pacific Ocean
Spill Site: Not reported
Cleanup By: Reporting Party
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Date/Time: Not reported
Year: 2004
Agency: Nutrogena Corp
Incident Date: 4/13/2004 12:00:00 AM
Admin Agency: Los Angeles City Fire Department
Amount: Not reported
Contained: Yes
Site Type: Industrial Plant

TC3139641.1s Page 113 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S107450436
E Date:	Not reported	
Substance:	Vikining 3 % Firefighting Foam	
Quantity Released:	Not reported	
BBLs:	0	
Cups:	0	
CUFT:	0	
Gallons:	5	
Grams:	0	
Pounds:	0	
Liters:	0	
Ounces:	0	
Pints:	0	
Quarts:	0	
Sheen:	0	
Tons:	0	
Unknown:	0	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	Substance was released due to a drain valve being opened on the outside of the system to relieve the pressure.	

35 5755 96TH STREET
LOS ANGELES, CA 90045

CHMIRS: S105641058
N/A

OES Incident Number: 007659
OES notification: Not reported
OES Date: 4/3/1995
OES Time: 02:10:05 AM
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personnel # Of Decontaminated: Not reported
Responding Agency Personnel # Of Injuries: Not reported
Responding Agency Personnel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported

TC3139641.1s Page 114 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S105632538
Agency Id Number:	Not reported	
Agency Incident Number:	Not reported	
Time Notified:	Not reported	
Time Completed:	Not reported	
Surrounding Area:	Not reported	
Estimated Temperature:	Not reported	
Property Management:	Not reported	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	Not reported	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DOT/PUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	NO	
Waterway:	storm drain	
Spill Site:	Not reported	
Cleanup By:	Not reported	
Containment:	Not reported	
What Happened:	Not reported	
Type:	PETROLEUM	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	1994	
Agency:	la city fd	
Incident Date:	12/13/94 0330	
Admin Agency:	Not reported	
Amount:	unknown	
Contained:	YES	
Site Type:	OTHER	
E Date:	Not reported	
Substance:	gasoline	
Quantity Released:	Not reported	
BBLs:	Not reported	
Cups:	Not reported	
CUFT:	Not reported	
Gallons:	Not reported	
Grams:	Not reported	
Pounds:	Not reported	
Liters:	Not reported	

TC3139641.1s Page 116 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S105641058
CA/DOT/PUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	YES	
Waterway:	storm drain - less than 1 gal.	
Spill Site:	Not reported	
Cleanup By:	neutrogena corp.	
Containment:	Not reported	
What Happened:	Not reported	
Type:	CHEMICAL	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	1995	
Agency:	STORM WATER MANAGEMENT DIV.	
Incident Date:	2030 2, Apr 95	
Admin Agency:	Not reported	
Amount:	1000 GALS.	
Contained:	YES	
Site Type:	PL	
E Date:	Not reported	
Substance:	SOAP SLUDGE	
Quantity Released:	Not reported	
BBLs:	Not reported	
Cups:	Not reported	
CUFT:	Not reported	
Gallons:	Not reported	
Grams:	Not reported	
Pounds:	Not reported	
Liters:	Not reported	
Ounces:	Not reported	
Pints:	Not reported	
Quarts:	Not reported	
Sheen:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	
Evacuations:	NO	
Number of Injuries:	NO	
Number of Fatalities:	NO	
Description:	water pipe leading the ionized water system broke pumping water into the storage tank containing soap sludge causing overflow into street. less than 1 gal. entered the storm drain.	

36 9620 SOUTH AIRPORT BLVD
LOS ANGELES, CA

CHMIRS: S105632538
N/A

OES Incident Number: 5649
OES notification: Not reported
OES Date: 12/13/1994
OES Time: 06:11:28 AM
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported

TC3139641.1s Page 115 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S105632538
Ounces:	Not reported	
Pints:	Not reported	
Quarts:	Not reported	
Sheen:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	
Evacuations:	NO	
Number of Injuries:	NO	
Number of Fatalities:	NO	
Description:	received report of odor. investigated and discovered spill.	

37 6221 W. 96TH STREET
6221 W. 96TH STREET
LOS ANGELES, CA 90045

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

37 6221 W. 96TH ST
LOS ANGELES, CA 90031

CHMIRS: S105669815
N/A

OES Incident Number: 01-7391
OES notification: 12/22/2001 12:35:55 AM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personnel # Of Decontaminated: Not reported
Responding Agency Personnel # Of Injuries: Not reported
Responding Agency Personnel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported

TC3139641.1s Page 117 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S105669815
CA/DO/PUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	Yes	
Waterway:	Storm Drain	
Spill Site:	Not reported	
Cleanup By:	Unknown	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	2001	
Agency:	NRG	
Incident Date:	12/21/2001 12:00:00 AM	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	Yes	
Site Type:	Road	
E Date:	Not reported	
Substance:	Sewage;;	
Quantity Released:	Not reported	
BBLs:	0	
Cups:	0	
CUFT:	0	
Gallons:	5792	
Grams:	0	
Pounds:	0	
Liters:	0	
Ounces:	0	
Pints:	0	
Quarts:	0	
Sheen:	0	
Tons:	0	
Unknown:	0.000000	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	MAIN LINE SEWER WAS BLOCKED BY GREASE RELEASED MATERIAL	

37	6221 WEST 96TH STREET, PARKING LOT FOR LAX AIRPORT. LOS ANGELES, CA 90045	CHMIRS	S110980604 N/A
CHMIRS:			
OES Incident Number:	*10-4352		
OES notification:	7/19/2010 10:21:00 PM		
OES Date:	Not reported		
OES Time:	Not reported		
Incident Date:	Not reported		
Date Completed:	Not reported		
Property Use:	Not reported		
Agency Id Number:	Not reported		
Agency Incident Number:	Not reported		

TC3139641.1s Page 118 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S110980604
Quarts:	Not reported	
Sheen:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	
Evacuations:	Not reported	
Number of Injuries:	Not reported	
Number of Fatalities:	Not reported	
Description:	A sewer main overflowed due to a grease blockage.	

38	BUDGET RENT-A-CAR 9775 AIRPORT BLVD WESTCHESTER, CA 90045	LUST	S102425845 N/A
LUST:			
Region:	STATE		
Global Id:	T0603701038		
Latitude:	33.9473602		
Longitude:	-118.3861304		
Case Type:	LUST Cleanup Site		
Status:	Open - Remediation		
Status Date:	2011-04-29 00:00:00		
Lead Agency:	LOS ANGELES RWQCB (REGION 4)		
Case Worker:	MSH		
Local Agency:	LOS ANGELES, CITY OF		
RB Case Number:	900450125		
LOC Case Number:	Not reported		
File Location:	Regional Board		
Potential Media Affect:	Aquifer used for drinking water supply		
Potential Contaminants of Concern:	Gasoline		
Site History:	Not reported		
Click here to access the California GeoTracker records for this facility:			
LUST:			
Global Id:	T0603701038		
Contact Type:	Local Agency Caseworker		
Contact Name:	ELOY LUNA		
Organization Name:	LOS ANGELES, CITY OF		
Address:	200 North Main Street, Suite 1780		
City:	LOS ANGELES		
Email:	eloy.luna@lacity.org		
Phone Number:	Not reported		
Global Id:			
Contact Type:	Regional Board Caseworker		
Contact Name:	CHANDRA CANSLER		
Organization Name:	LOS ANGELES RWQCB (REGION 4)		
Address:	Not reported		
City:	R4 UNKNOWN		
Email:	ccansler@waterboards.ca.gov		
Phone Number:	Not reported		
LUST:			
Global Id:	T0603701038		
Action Type:	ENFORCEMENT		
Date:	2006-06-13 00:00:00		
Action:	Staff Letter		

TC3139641.1s Page 120 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S110980604
Time Notified:	Not reported	
Time Completed:	Not reported	
Surrounding Area:	Not reported	
Estimated Temperature:	Not reported	
Property Management:	Not reported	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?	Not reported	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DO/PUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	Yes	
Waterway:	Ballona Creek	
Spill Site:	Airport	
Cleanup By:	Responsible Party	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Galls	
Other:	Not reported	
Date/Time:	1830	
Year:	2010	
Agency:	L.A. City Sewer Maintenance	
Incident Date:	7/19/2010	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	Yes	
Site Type:	Ballona Creek	
E Date:	Not reported	
Substance:	Sewage	
Quantity Released:	655	
BBLs:	Not reported	
Cups:	Not reported	
CUFT:	Not reported	
Gallons:	Not reported	
Grams:	Not reported	
Pounds:	Not reported	
Liters:	Not reported	
Ounces:	Not reported	
Pints:	Not reported	

TC3139641.1s Page 119 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
BUDGET RENT-A-CAR (Continued)		S102425845
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2007-12-15 00:00:00	
Action:	Interim Remedial Action Plan	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2009-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2008-02-14 00:00:00	
Action:	Request for Closure	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2004-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2008-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2008-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	REMEDATION	
Date:	1950-01-01 00:00:00	
Action:	Vacuum Extract	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2002-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2005-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	ENFORCEMENT	
Date:	2007-10-12 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2006-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	

TC3139641.1s Page 121 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	EPA ID Number
Database(s)		
BUDGET RENT-A-CAR (Continued)		S102425845
Date:	2008-11-06 00:00:00	
Action:	Request for Closure	
Global Id:	T0603701038	
Action Type:	ENFORCEMENT	
Date:	2004-04-26 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2009-08-26 00:00:00	
Action:	Request for Closure	
Global Id:	T0603701038	
Action Type:	ENFORCEMENT	
Date:	1999-07-13 00:00:00	
Action:	13267 Requirement	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2010-07-15 00:00:00	
Action:	Soil and Water Investigation Report	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2010-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2010-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2008-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2009-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2003-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2002-07-31 00:00:00	
Action:	Other Report / Document	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2002-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
TC3139641.1s Page 122 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	EPA ID Number
Database(s)		
BUDGET RENT-A-CAR (Continued)		S102425845
Date:	2006-08-15 00:00:00	
Action:	Other Report / Document	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2005-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2003-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2004-01-30 00:00:00	
Action:	Interim Remedial Action Plan	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2004-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2006-04-14 00:00:00	
Action:	Soil and Water Investigation Workplan	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2006-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	ENFORCEMENT	
Date:	2010-04-01 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701038	
Action Type:	ENFORCEMENT	
Date:	2002-06-25 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2007-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	REMEDIATION	
Date:	1950-01-01 00:00:00	
Action:	Soil Vapor Extraction w/Other	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2007-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
TC3139641.1s Page 124 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	EPA ID Number
Database(s)		
BUDGET RENT-A-CAR (Continued)		S102425845
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2006-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2002-10-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701038	
Action Type:	ENFORCEMENT	
Date:	2009-03-12 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701038	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2006-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2006-04-18 00:00:00	
Action:	Request for Closure	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2007-08-24 00:00:00	
Action:	Request for Closure	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2003-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2004-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2003-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2007-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
TC3139641.1s Page 123 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	EPA ID Number
Database(s)		
BUDGET RENT-A-CAR (Continued)		S102425845
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2007-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2003-01-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2003-04-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701038	
Action Type:	ENFORCEMENT	
Date:	2009-06-15 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2005-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2009-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2004-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2003-10-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2005-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701038	
Action Type:	RESPONSE	
Date:	2003-07-15 00:00:00	
Action:	Remedial Progress Report	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
facid:	900450125	
Status:	Remediation Plan	
TC3139641.1s Page 125 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
BUDGET RENT-A-CAR (Continued)		S102425845
Substance:	Gasoline	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Groundwater	
Abatement Method Used at the Site:	Not reported	
Global ID:	T0603701038	
W Global ID:	Not reported	
Staff:	MSH	
Local Agency:	19050	
Cross Street:	96TH ST	
Enforcement Type:	DLSEL	
Date Leak Discovered:	Not reported	
Date Leak First Reported:	5/29/1991	
Date Leak Record Entered:	2/25/1993	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	6/20/2002	
Date the Case was Closed:	Not reported	
How Leak Discovered:	Not reported	
How Leak Stopped:	Not reported	
Cause of Leak:	Not reported	
Leak Source:	Not reported	
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	5962.8914044493064116533678947	
Source of Cleanup Funding:	Not reported	
Preliminary Site Assessment Workplan Submitted:	4/1/1993	
Preliminary Site Assessment Began:	3/20/1998	
Pollution Characterization Began:	7/13/1999	
Remediation Plan Submitted:	4/26/2004	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	7/13/1999	
Historical Max MTBE Date:	8/10/2000	
Hist Max MTBE Conc in Groundwater:	12000	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	No	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	MR. SCOTT GREEN	
RP Address:	P.O. BOX 747	
Program:	LUST	
Lat/Long:	33.9473602 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	GW MON RPT & FP REMOVAL : 8/30/00 3RD QTR GW MON; 12/18/00 4TH QTR GW MON & GRADIENT ASSESSM.; 3/20/01 1ST QTR GW MON RPT & GRADIENT ASSESSM.; 3/26/01 WP FEASIBILITY STUDY REMED. SYSTEM INSTALL.	

TC3139641.1s Page 126 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
BUDGET RENT-A-CAR-LAX (Continued)		U001561823
Agency:	Ocean Blue Environmental	
Incident Date:	4/5/2008	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	Yes	
Site Type:	Not reported	
E Date:	Not reported	
Substance:	Diesel Fuel	
Quantity Released:	50	
BBLs:	Not reported	
Cups:	Not reported	
CUFT:	Not reported	
Gallons:	Not reported	
Grams:	Not reported	
Pounds:	Not reported	
Liters:	Not reported	
Ounces:	Not reported	
Pints:	Not reported	
Quarts:	Not reported	
Sheen:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	RP states that mechanical failure of fuel port caused a separation of fuel line at the truck which caused a release of diesel fuel. The release went onto the parking lot and into a catch basin. All diesel was recovered from the catch basin. No release into any waterway.	

Map ID	Direction	Distance	EDR ID Number
Distance (ft.)	Site	Database(s)	EPA ID Number
38	9775 AIRPORT BLVD 9775 AIRPORT BLVD LOS ANGELES, CA	ERNS	2008867105 N/A

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

Map ID	Direction	Distance	EDR ID Number
Distance (ft.)	Site	Database(s)	EPA ID Number
39	RESORT RENT A CAR 6151 W 98TH ST LOS ANGELES, CA 90045	LUST	S109117712 N/A

LUST:
Region: STATE
Global Id: T0603790524
Latitude: 33.947341
Longitude: -118.393047
Case Type: LUST Cleanup Site
Status: Open - Site Assessment
Status Date: 1991-09-30 00:00:00
Lead Agency: LOS ANGELES, CITY OF
Case Worker: WR
Local Agency: LOS ANGELES, CITY OF
RB Case Number: Not reported
LOC Case Number: Not reported

TC3139641.1s Page 128 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
38	BUDGET RENT-A-CAR-LAX 9775 AIRPORT BLVD LOS ANGELES, CA 90045	HIST CORTESE CHMIRS U001561823 N/A
CORTESE:	CORTESE	
Region:	CORTESE	
Facility County Code:	19	
Reg By:	LTNKA	
Reg Id:	900450125	
CHMIRS:		
OES Incident Number:	198-2583	
OES notification:	4/5/2008 2:44:32 PM	
OES Date:	Not reported	
OES Time:	Not reported	
Incident Date:	Not reported	
Date Completed:	Not reported	
Property Use:	Not reported	
Agency Id Number:	Not reported	
Agency Incident Number:	Not reported	
Time Notified:	Not reported	
Time Completed:	Not reported	
Surrounding Area:	Not reported	
Estimated Temperature:	Not reported	
Property Management:	Not reported	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	Not reported	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DOT/FUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	No	
Waterway:	Not reported	
Spill Site:	Airport	
Cleanup By:	Contractor	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Gall(s)	
Other:	Not reported	
Date/Time:	1130	
Year:	2008	

TC3139641.1s Page 127 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
RESORT RENT A CAR (Continued)		S109117712
File Location:	Not reported	
Potential Media Affect:	Soil	
Potential Contaminants of Concern:	Diesel	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603790524	
Contact Type:	Regional Board Caseworker	
Contact Name:	YIUE RONG	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yrong@waterboards.ca.gov	
Phone Number:	Not reported	
Global Id:	T0603790524	
Contact Type:	Local Agency Caseworker	
Contact Name:	TBD	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 N. MAIN ST. RM. 970	
City:	LOS ANGELES	
Email:	Not reported	
Phone Number:	2139783722	
LUST:		
Global Id:	T0603790524	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id:	T0603790524	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	

Map ID	Direction	Distance	EDR ID Number
Distance (ft.)	Site	Database(s)	EPA ID Number
40	5900 WEST 98TH ST LOS ANGELES, CA	CHMIRS	S105660045 N/A

CHMIRS:
OES Incident Number: 99-3775
OES notification: 9/8/199904:07:59 PM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
Special Studies 1: Not reported

TC3139641.1s Page 129 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S105660045
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	Not reported	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/Year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CAD/OT/PUC/CC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	No	
Waterway:	Not reported	
Spill Site:	Not reported	
Cleanup By:	None required	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	1999	
Agency:	LA City FD	
Incident Date:	9/8/1999 12:00:00 AM	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	Yes	
Site Type:	Merchant/Business	
E Date:	Not reported	
Substance:	Unk	
Quantity Released:	Not reported	
BBLs:	0	
Cups:	0	
CUFT:	0	
Gallons:	0	
Grams:	0	
Pounds:	0	
Liters:	0	
Ounces:	0	
Pints:	0	
Quarts:	0	
Sheen:	0	
Tons:	0	
Unknown:	0	
Evacuations:	0	
Number of Injuries:	3	

TC3139641.1s Page 130 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
HONEYWELL, INC. (Continued)		S101297244
How Leak Discovered:	Not reported	
How Leak Stopped:	Not reported	
Cause of Leak:	Structure Failure	
Leak Source:	Tank	
Operator:	PARK ONE	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	9055.738714298570376090945651	
Source of Cleanup Funding:	Tank	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	5/10/1991	
Remediation Plan Submitted:	9/11/1995	
Remedial Action Underway:	9/23/1998	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Yes	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	TRW	
RP Address:	2525 190TH ST W, TORRANCE, CA 90504-6099	
Program:	SLIC	
Lat/Long:	33.94699 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	1	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	THIS IS A COST RECOVERY CASE (SLIC). SLIC #346	REFER TO
SLIC:	Region: STATE	
Facility Status:	Open - Remediation	
Status Date:	1998-09-23 00:00:00	
Global Id:	T0603701048	
Lead Agency:	LOS ANGELES RWOCB (REGION 4)	
Lead Agency Case Number:	Not reported	
Latitude:	33.94699	
Longitude:	-118.3963977	
Case Type:	Cleanup Program Site	
Case Worker:	SLC	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450225	
File Location:	Not reported	
Potential Media Affected:	Aquifer used for drinking water supply	
Potential Contaminants of Concern:	* Solvents	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		

TC3139641.1s Page 132 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S105660045
Number of Fatalities:	0	
Description:	Irritant in air that was reported and 3 persons were transported to the hospital. Fire Department did not detect anything	
41 HONEYWELL INTERNATIONAL INC. (SEPULVEDA) 9851 SOUTH SEPULVEDA BLVD. LOS ANGELES, CA 90045		SLIC 1000249111 CAD028445237
SLIC:	Region: STATE	
Facility Status:	Open - Site Assessment	
Status Date:	2002-06-30 00:00:00	
Global Id:	SL184101393	
Lead Agency:	LOS ANGELES RWOCB (REGION 4)	
Lead Agency Case Number:	Not reported	
Latitude:	33.9469734869595	
Longitude:	-118.397941589355	
Case Type:	Cleanup Program Site	
Case Worker:	SR	
Local Agency:	Not reported	
RB Case Number:	0346	
File Location:	Not reported	
Potential Media Affected:	Not reported	
Potential Contaminants of Concern:	Aviation	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
41 HONEYWELL, INC. 9851 SEPULVEDA BLVD LOS ANGELES, CA 90009		LUST S101297244 SLIC N/A
LUST REG 4:	Region: 4	
Regional Board:	04	
County:	Los Angeles	
Facid:	900450225	
Status:	Remedial action (cleanup) Underway	
Substance:	Solvents	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Groundwater	
Abatement Method Used at the Site:	Not reported	
Global ID:	T0603701048	
W Global ID:	Not reported	
Staff:	SLC	
Local Agency:	19050	
Cross Street:	CENTURY BLVD	
Enforcement Type:	Not reported	
Date Leak Discovered:	Not reported	
Date Leak First Reported:	1/27/1989	
Date Leak Record Entered:	5/21/1991	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	3/20/1996	
Date the Case was Closed:	Not reported	

TC3139641.1s Page 131 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
42 HONEYWELL INTERNATIONAL CORP. 9851 SEPULVEDA LOS ANGELES, CA 90045		SLIC S104549312 N/A
SLIC:	Region: 4	
Facility Status:	Remediation	
SLIC:	0346	
Substance:	VOCs	
Staff:	AS	
42 ALLIED-SIGNAL INC. (PARK 9851 SEPULVEDA LOS ANGELES, CA 90045		HIST CORTESE S103677809 N/A
CORTESE:	Region: CORTESE	
Facility County Code:	19	
Reg By:	LTNKA	
Reg Id:	900450225	
42 9851 SEPULVEDA BLVD 1ST FLOOR OF BLDG #1 9851 SEPULVEDA BLVD 1ST FLOOR OF BLDG #1 LOS ANGELES, CA		ERNS 8851565 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		
43 LACEY 20 LLC 9920 LA CIENEGA BLVD INGLEWOOD, CA 90301		ENVIROSTOR S103677978 N/A
ENVIROSTOR:	Site Type: Corrective Action	
Site Type Detailed:	Corrective Action	
Acres:	0	
NPL:	NO	
Regulatory Agencies:	NONE SPECIFIED	
Lead Agency:	NONE SPECIFIED	
Program Manager:	Not reported	
Supervisor:	* Unknown	
Division Branch:	Cleanup Chatsworth	
Facility ID:	80001320	
Site Code:	Not reported	
Assembly:	51	
Senate:	51	
Special Program:	Not reported	
Status:	* Inactive	
Status Date:	2008-01-01 00:00:00	
Restricted Use:	NO	
Site Mgmt. Req.:	NONE SPECIFIED	
Funding:	Not reported	
Latitude:	33.945709655304803	
Longitude:	-118.3691453937199	

TC3139641.1s Page 133 of 351

MAP FINDINGS		EDR ID Number
Map ID Direction Distance Distance (ft.)Site	Database(s)	EPA ID Number
LACEY 20 LLC (Continued) APN: 4128026016 Past Use: NONE SPECIFIED Potential COC: NONE SPECIFIED Confirmed COC: NONE SPECIFIED Potential Description: NONE SPECIFIED Alias Name: 4128026016 Alias Type: APN Alias Name: CAD000627521 Alias Type: EPA Identification Number Alias Name: 80001320 Alias Type: Envirostor ID Number Completed Info: Completed Area Name: Not reported Completed Sub Area Name: Not reported Completed Document Type: Not reported Completed Date: Not reported Comments: Not reported Future Area Name: Not reported Future Sub Area Name: Not reported Future Document Type: Not reported Future Due Date: Not reported Schedule Area Name: Not reported Schedule Sub Area Name: Not reported Schedule Document Type: Not reported Schedule Due Date: Not reported Schedule Revised Date: Not reported		S103677978
44 WYNDHAM HOTEL 6225 W. CENTURY BLVD LOS ANGELES, CA 90045 SLIC: Region: STATE Facility Status: Completed - Case Closed Status Date: 1999-08-17 00:00:00 Global Id: SLT43650648 Lead Agency: LOS ANGELES RWQCB (REGION 4) Lead Agency Case Number: Not reported Latitude: 33.946258 Longitude: -118.395099 Case Type: Cleanup Program Site Case Worker: JG Local Agency: Not reported RB Case Number: 0877 File Location: Not reported Potential Media Affected: Not reported Potential Contaminants of Concern: Not reported Site History: Not reported Click here to access the California GeoTracker records for this facility:		SLIC S106485864 N/A

TC3139641.1s Page 134 of 351

MAP FINDINGS		EDR ID Number
Map ID Direction Distance Distance (ft.)Site	Database(s)	EPA ID Number
45 FEDERAL EXPRESS LAX HUB FEDERAL EXPRESS LAX HUB LOS ANGELES, CA Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 90466049 N/A
45 LAX SERVICE RD POST 2 LAX SERVICE RD POST 2 LOS ANGELES, CA Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 90186428 N/A
45 FEDERAL EXPRESS LAX HUB 5927 W. IMPERIAL HIGHWAY FEDERAL EXPRESS LAX HUB 5927 W. IMPERIAL HIGHWAY LOS ANGELES, CA Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 90185499 N/A
45 AREA-10 HANGER/DELTA LAX AREA-10 HANGER/DELTA LAX LOS ANGELES, CA Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 8714698 N/A
45 GATE 105 AT LAX TERMINAL GATE 105 AT LAX TERMINAL LOS ANGELES, CA Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 98467315 N/A

TC3139641.1s Page 136 of 351

MAP FINDINGS		EDR ID Number
Map ID Direction Distance Distance (ft.)Site	Database(s)	EPA ID Number
44 HYATT L A X 6225 W CENTURY BLVD LOS ANGELES, CA 90045 SLIC: Region: 4 Facility Status: No further action required SLIC: 0877 Substance: TPH/VOCs Staff: John Geroch		SLIC 1000421417 CAD982321366
45 GATE 119 - LAX GATE 119 - LAX LOS ANGELES, CA 90045 Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 93346335 N/A
45 GATE 123 LAX AIRPORT GATE 123 LAX AIRPORT LOS ANGELES, CA Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 93309347 N/A
45 LAX AIRPORT, GATE 123 LAX AIRPORT, GATE 123 LOS ANGELES, CA Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 93309346 N/A
45 RUNWAY 25 RIGHT AT LAX RUNWAY 25 RIGHT AT LAX LOS ANGELES, CA Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 91234660 N/A

TC3139641.1s Page 135 of 351

MAP FINDINGS		EDR ID Number
Map ID Direction Distance Distance (ft.)Site	Database(s)	EPA ID Number
45 EASTERN REFUELING AREA/@ LAX. EASTERN REFUELING AREA/@ LAX. LOS ANGELES, CA Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 8715818 N/A
45 TAXIWAY A2 SPOT 6 LAX TAXIWAY A2 SPOT 6 LAX LOS ANGELES, CA 90045 Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 99649942 N/A
45 ICC SPOT TEN LAX AIRPORT ICC SPOT TEN LAX AIRPORT LOS ANGELES, CA Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 99647166 N/A
45 PAC OCEAN/END LAX RUNWAY TO S. BUOY E.S. PAC OCEAN/END LAX RUNWAY TO S. BUOY E.S. LOS ANGELES, CA Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 8715277 N/A
45 LAX AIRPORT/TAXIWAY-K-32 LAX AIRPORT/TAXIWAY-K-32 LOS ANGELES, CA Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		ERNS 8714369 N/A

TC3139641.1s Page 137 of 351

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Distance	Database(s)
Distance (ft.)	Site	EPA ID Number	
45	LAX, SATELLITE-3,GATE-34 LAX, SATELLITE-3,GATE-34 LOS ANGELES, CA	ERNS 87463818 N/A	
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
45	10MI OFFSHORE/270 DEGREES FROM LAX TOWER 10MI OFFSHORE/270 DEGREES FROM LAX TOWER LOS ANGELES, CA	ERNS 8872993 N/A	
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
46	TRANSPORTATION SECURITY ADMINISTRATION AT LAX 5757 W. CENTURY BLVD LOS ANGELES, CA 90045	CERCLIS 1014202333 CAN000908947	
CERCLIS: Site ID: 0908947 EPA ID: CAN000908947 Facility County: LOS ANGELES Short Name: TRANSPORTATION SECURITY A Congressional District: Not reported IFMS ID: Not reported SMSA Number: Not reported USGC Hydro Unit: Not reported Federal Facility: Federal Facility DMNSN Number: Not reported Site Orphan Flag: Not reported RCRA ID: Not reported USGS Quadrangle: Not reported Site Init By Prog: S NFRAP Flag: Not reported Parent ID: Not reported RST Code: Not reported EPA Region: 09 Classification: Not reported Site Settings Code: Not reported NPL Status: Not on the NPL DMNSN Unit Code: Not reported RBRAC Code: Not reported RRResp Fed Agency Code: Not reported Non NPL Status: Fed Fac Preliminary Assessment Review Start Needed Non NPL Status Date: 20100907 Site Fips Code: 06037 CC Concurrence Date: Not reported CC Concurrence FY: Not reported Alias EPA ID: Not reported Site FUDS Flag: N CERCLIS Site Contact Name(s): Contact ID: 9270438.00000			
TC3139641.1s Page 138 of 351			

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Distance	Database(s)
Distance (ft.)	Site	EPA ID Number	
(Continued)			S105635220
Agency Incident Number: Not reported Time Notified: Not reported Time Completed: Not reported Surrounding Area: Not reported Estimated Temperature: Not reported Property Management: Not reported Special Studies 1: Not reported Special Studies 2: Not reported Special Studies 3: Not reported Special Studies 4: Not reported Special Studies 5: Not reported Special Studies 6: Not reported More Than Two Substances Involved: Not reported Resp Agency Personnel # Of Decontaminated: Not reported Responding Agency Personnel # Of Injuries: Not reported Responding Agency Personnel # Of Fatalities: Not reported Others Number Of Decontaminated: Not reported Others Number Of Injuries: Not reported Others Number Of Fatalities: Not reported Vehicle Make/year: Not reported Vehicle License Number: Not reported Vehicle State: Not reported Vehicle Id Number: Not reported CA/DOT/PUC/ICC Number: Not reported Company Name: Not reported Reporting Officer Name/ID: Not reported Report Date: Not reported Comments: Not reported Facility Telephone: Not reported Waterway Involved: YES Waterway: Not reported Spill Site: Not reported Cleanup By: unocal Containment: Not reported What Happened: Not reported Type: PETROLEUM Measure: Not reported Other: Not reported Date/Time: Not reported Year: 1994 Agency: unocal Incident Date: 1705/14June94 Admin Agency: Not reported Amount: unknown Contained: NO Site Type: S/S E Date: Not reported Substance: petroleum hydro carbons Quantity Released: Not reported BBLs: Not reported Cups: Not reported CUFT: Not reported Gallons: Not reported Grams: Not reported Pounds: Not reported Liters: Not reported Ounces: Not reported			
TC3139641.1s Page 140 of 351			

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Distance	Database(s)
Distance (ft.)	Site	EPA ID Number	
	TRANSPORTATION SECURITY ADMINISTRATION AT LAX (Continued)	1014202333	
Contact Name: Dawn Richmond Contact Tel: (415) 972-3097 Contact Title: Site Assessment Manager (SAM) Contact Email: Not reported			
CERCLIS Site Alias Name(s): Alias ID: 13000119 Alias Name: TRANSPORTATION SECURITY ADMINISTRATION AT LAX Alias Address: 5757 W. CENTURY BLVD LOS ANGELES, CA 90045 Alias Comments: Not reported Site Description: Not reported			
CERCLIS Assessment History: Action Code: 001 Action: DISCOVERY Date Started: Not reported Date Completed: 11/25/2008 Priority Level: Not reported Operable Unit: SITEWIDE Primary Responsibility: EPA Fund-Financed Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported			
For detailed financial records, contact EDR for a Site Report:			
Action Code: 001 Action: PRE-CERCLIS SCREENING Date Started: Not reported Date Completed: 08/31/2010 Priority Level: Not reported Operable Unit: SITEWIDE Primary Responsibility: EPA Fund-Financed Planning Status: Not reported Urgency Indicator: Not reported Action Anomaly: Not reported			
For detailed financial records, contact EDR for a Site Report:			
Click this hyperlink while viewing on your computer to access additional US CERCLIS Financial: detail in the EDR Site Report.			
47	#3272 5552 WEST CENTURY BLVD LOS ANGELES, CA 90045	CHMIRS S105635220 N/A	
CHMIRS: OES Incident Number: 2791 OES notification: Not reported OES Date: 6/21/1994 OES Time: 02:15:59 PM Incident Date: Not reported Date Completed: Not reported Property Use: Not reported Agency Id Number: Not reported			
TC3139641.1s Page 139 of 351			

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Distance	Database(s)
Distance (ft.)	Site	EPA ID Number	
(Continued)			S105635220
Pints: Not reported Quarts: Not reported Sheen: Not reported Tons: Not reported Unknown: Not reported Evacuations: NO Number of Injuries: NO Number of Fatalities: NO Description: during construction project soil sample shows contamination			
47	76 PRODUCTS STATION #3272 5552 CENTURY LOS ANGELES, CA 90045	HIST CORTESE S105024594 N/A	
CORTESE: Region: CORTESE Facility County Code: 19 Reg By: LTNKA Reg Id: 900450389			
47	5552 WEST CENTURY BLVD, SERVICE STATION #3272 5552 WEST CENTURY BLVD, SERVICE STATION #3272 LOS ANGELES, CA 90045	ERNS 94381056 N/A	
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
47	76 PRODUCTS STATION #3272 5552 CENTURY BLVD W WESTCHESTER, CA 90045	LUST S102439910 N/A	
LUST: Region: STATE Global Id: T0603701061 Latitude: 33.9451603 Longitude: -118.3779282 Case Type: LUST Cleanup Site Status: Completed - Case Closed Status Date: 2009-11-12 00:00:00 Lead Agency: LOS ANGELES RWQCB (REGION 4) Case Worker: YR Local Agency: LOS ANGELES, CITY OF RB Case Number: 900450389A LOCC Case Number: Not reported File Location: Regional Board Potential Media Affect: Aquifer used for drinking water supply, Soil Potential Contaminants of Concern: Other Solvent or Non-Petroleum Hydrocarbon CASE CLOSED BY LA CITY FD, PRIOR 1/12/1999 Click here to access the California GeoTracker records for this facility:			
LUST: Global Id: T0603701061			
TC3139641.1s Page 141 of 351			

Map ID
Direction
Distance
Distance (ft.)Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

76 PRODUCTS STATION #3272 (Continued)

S102439910

Contact Type: Regional Board Caseworker
Contact Name: JAY HUANG
Organization Name: LOS ANGELES RWQCB (REGION 4)
Address: 320 WEST 4TH STREET, SUITE 200
City: LOS ANGELES
Email: jhuang@waterboards.ca.gov
Phone Number: 2135766711

Global Id: T0603701061
Contact Type: Local Agency Caseworker
Contact Name: ELOY LUNA
Organization Name: LOS ANGELES, CITY OF
Address: 200 North Main Street, Suite 1780
City: LOS ANGELES
Email: eloy.luna@lacity.org
Phone Number: Not reported

LUST:

Global Id: T0603701061
Action Type: ENFORCEMENT
Date: 2009-01-16 00:00:00
Action: Staff Letter

Global Id: T0603701061
Action Type: RESPONSE
Date: 2009-08-27 00:00:00
Action: Soil and Water Investigation Report

Global Id: T0603701061
Action Type: RESPONSE
Date: 2008-11-15 00:00:00
Action: Other Report / Document

Global Id: T0603701061
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Discovery

Global Id: T0603701061
Action Type: ENFORCEMENT
Date: 2009-10-27 00:00:00
Action: Site Visit / Inspection / Sampling

Global Id: T0603701061
Action Type: ENFORCEMENT
Date: 2009-10-21 00:00:00
Action: Notification - Preclosure

Global Id: T0603701061
Action Type: ENFORCEMENT
Date: 2008-10-14 00:00:00
Action: Staff Letter

Global Id: T0603701061
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Reported

TC3139641.1s Page 142 of 351

Map ID
Direction
Distance
Distance (ft.)Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

76 PRODUCTS STATION #3272 (Continued)

S102439910

Approx. Dist To Production Well (ft): 3834.6969471704130000658959976
Source of Cleanup Funding: UNK
Preliminary Site Assessment Workplan Submitted: Not reported
Preliminary Site Assessment Began: Not reported
Pollution Characterization Began: Not reported
Remediation Plan Submitted: Not reported
Remedial Action Underway: Not reported
Post Remedial Action Monitoring Began: Not reported
Enforcement Action Date: Not reported
Historical Max MTBE Date: Not reported
Hist Max MTBE Conc in Groundwater: Not reported
Hist Max MTBE Conc in Soil: Not reported
Significant Interim Remedial Action Taken: Not reported
GW Qualifier: Not reported
Soil Qualifier: Not reported
Organization: Not reported
Owner Contact: Not reported
Responsible Party: TOSCO/76 PRODUCTS TEAM
RP Address: 555 ANTON, COSTA MESA, CA 92626
Program: LUST
Lat/Long: 33.9451603 / -1
Local Agency Staff: PEJ
Beneficial Use: Not reported
Priority: Not reported
Cleanup Fund Id: Not reported
Suspended: Not reported
Assigned Name: Not reported
Summary: Not reported

47

TEXACO
5551 CENTURY
LOS ANGELES, CA 90045

HIST CORTESE

S105024593
N/A

CORTESE:
Region: CORTESE
Facility County Code: 19
Reg By: LTNKA
Reg Id: 900450534

47

TEXACO SVC STA
5551 W CENTURY
LOS ANGELES, CA 90045

LUST

1000144849
CAD981436355

LUST:
Region: STATE
Global Id: T0603701069
Latitude: 33.9455593
Longitude: -118.3771472
Case Type: LUST Cleanup Site
Status: Completed - Case Closed
Status Date: 1996-09-20 00:00:00
Lead Agency: LOS ANGELES, CITY OF
Case Worker: EL
Local Agency: LOS ANGELES, CITY OF
RB Case Number: 900450534
LOC Case Number: Not reported

TC3139641.1s Page 144 of 351

Map ID
Direction
Distance
Distance (ft.)Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

76 PRODUCTS STATION #3272 (Continued)

S102439910

Global Id: T0603701061
Action Type: ENFORCEMENT
Date: 2009-06-15 00:00:00
Action: Staff Letter

Global Id: T0603701061
Action Type: RESPONSE
Date: 2009-04-15 00:00:00
Action: Monitoring Report - Quarterly

Global Id: T0603701061
Action Type: RESPONSE
Date: 2008-12-01 00:00:00
Action: Request for Closure

Global Id: T0603701061
Action Type: REMEDIATION
Date: 1950-01-01 00:00:00
Action: Excavate and Dispose

Global Id: T0603701061
Action Type: ENFORCEMENT
Date: 2009-11-12 00:00:00
Action: Closure/No Further Action Letter

LUST REG 4:

Region: 4
Regional Board: 04
County: Los Angeles
Facid: 900450389
Status: Case Closed
Substance: Hydrocarbons
Substance Quantity: Not reported
Local Case No: Not reported
Case Type: Soil
Abatement Method Used at the Site: Not reported
Global ID: T0603701061
W Global ID: Not reported
Staff: UNK
Local Agency: 19050
Cross Street: AVIATION BLVD
Enforcement Type: Not reported
Date Leak Discovered: 6/12/1994
Date Leak First Reported: 6/12/1994
Date Leak Record Entered: 11/2/1995
Date Confirmation Began: 6/12/1994
Date Leak Stopped: Not reported
Date Case Last Changed on Database: 1/12/1999
Date the Case was Closed: 1/12/1999
How Leak Discovered: OM
How Leak Stopped: Not reported
Cause of Leak: UNK
Leak Source: UNK
Operator: OLD CASE #951102-09
Water System: Not reported
Well Name: Not reported

TC3139641.1s Page 143 of 351

Map ID
Direction
Distance
Distance (ft.)Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

TEXACO SVC STA (Continued)

1000144849

File Location: Not reported
Potential Media Affect: Soil
Potential Contaminants of Concern: Waste Oil / Motor / Hydraulic / Lubricating
Site History: Not reported

Click here to access the California GeoTracker records for this facility:

LUST:

Global Id: T0603701069
Contact Type: Regional Board Caseworker
Contact Name: YUE RONG
Organization Name: LOS ANGELES RWQCB (REGION 4)
Address: 320 W. 4TH ST., SUITE 200
City: Los Angeles
Email: yrong@waterboards.ca.gov
Phone Number: Not reported

Global Id: T0603701069
Contact Type: Local Agency Caseworker
Contact Name: ELOY LUNA
Organization Name: LOS ANGELES, CITY OF
Address: 200 North Main Street, Suite 1780
City: LOS ANGELES
Email: eloy.luna@lacity.org
Phone Number: Not reported

LUST:

Global Id: T0603701069
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Stopped

Global Id: T0603701069
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Discovery

Global Id: T0603701069
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Reported

LUST REG 4:

Region: 4
Regional Board: 04
County: Los Angeles
Facid: 900450534
Status: Case Closed
Substance: Waste Oil
Substance Quantity: Not reported
Local Case No: Not reported
Case Type: Soil
Abatement Method Used at the Site: Not reported
Global ID: T0603701069
W Global ID: Not reported
Staff: UNK

TC3139641.1s Page 145 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
TEXACO SVC STA (Continued)		1000144849
Local Agency:		19050
Cross Street:		AVIATION
Enforcement Type:		Not reported
Date Leak Discovered:		7/7/1988
Date Leak First Reported:		7/8/1988
Date Leak Record Entered:		9/11/1988
Date Confirmation Began:		Not reported
Date Leak Stopped:		7/7/1988
Date Case Last Changed on Database:		9/20/1996
Date the Case was Closed:		9/20/1996
How Leak Discovered:		Tank Closure
How Leak Stopped:		Not reported
Cause of Leak:		Overfill
Leak Source:		Piping
Operator:		OLD CASENO WAS 091688-17
Water System:		Not reported
Well Name:		Not reported
Approx. Dist To Production Well (ft):		3558.1859425020449047595917267
Source of Cleanup Funding:		Piping
Preliminary Site Assessment Workplan Submitted:		Not reported
Preliminary Site Assessment Began:		Not reported
Pollution Characterization Began:		Not reported
Remediation Plan Submitted:		9/16/1988
Remedial Action Underway:		Not reported
Post Remedial Action Monitoring Began:		Not reported
Enforcement Action Date:		Not reported
Historical Max MTBE Date:		Not reported
Hist Max MTBE Conc in Groundwater:		Not reported
Hist Max MTBE Conc in Soil:		Not reported
Significant Interim Remedial Action Taken:		Not reported
GW Qualifier:		Not reported
Soil Qualifier:		Not reported
Organization:		Not reported
Owner Contact:		Not reported
Responsible Party:		TEXACO USA
RP Address:		SAME AS ABOVE
Program:		LUST
Lat/Long:		33.9455593 / -1
Local Agency Staff:		PEJ
Beneficial Use:		Not reported
Priority:		Not reported
Cleanup Fund Id:		Not reported
Suspended:		Not reported
Assigned Name:		Not reported
Summary:		WHILE REMOVING OLD TANK TO REPLACE WITH NEW TANK CONTAMINATION WAS OBSERVED TEXACO WILL REMEDIATE.

48	ARCO #0003	LUST	S102424129
5201 CENTURY BLVD W		N/A	
WESTCHESTER, CA 90045			
LUST:			
Region:		STATE	
Global Id:		T0603701053	
Latitude:		33.9454755	
Longitude:		-118.370067	
Case Type:		LUST Cleanup Site	
Status:		Open - Site Assessment	

TC3139641.1s Page 146 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
ARCO #0003 (Continued)		S102424129
Global Id:		T0603701053
Action Type:		ENFORCEMENT
Date:		2006-05-18 00:00:00
Action:		Staff Letter
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2005-01-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701053
Action Type:		ENFORCEMENT
Date:		2009-06-15 00:00:00
Action:		Staff Letter
Global Id:		T0603701053
Action Type:		ENFORCEMENT
Date:		2002-04-02 00:00:00
Action:		Site Visit / Inspection / Sampling
Global Id:		T0603701053
Action Type:		ENFORCEMENT
Date:		2003-01-16 00:00:00
Action:		Staff Letter
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2009-01-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2007-07-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2009-07-15 00:00:00
Action:		Monitoring Report - Semi-Annually
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2009-04-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701053
Action Type:		Other
Date:		1950-01-01 00:00:00
Action:		Leak Discovery
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2005-10-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701053
Action Type:		ENFORCEMENT

TC3139641.1s Page 148 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
ARCO #0003 (Continued)		S102424129
Status Date:		2003-01-16 00:00:00
Lead Agency:		LOS ANGELES RWQCB (REGION 4)
Case Worker:		MSH
Local Agency:		LOS ANGELES, CITY OF
RB Case Number:		900450307
LOC Case Number:		Not reported
File Location:		Regional Board
Potential Media Affect:		Aquifer used for drinking water supply
Potential Contaminants of Concern:		Gasoline
Site History:		Not reported
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:		T0603701053
Contact Type:		Local Agency Caseworker
Contact Name:		ELOY LUNA
Organization Name:		LOS ANGELES, CITY OF
Address:		200 North Main Street, Suite 1780
City:		LOS ANGELES
Email:		eloy.luna@lacity.org
Phone Number:		Not reported
Global Id:		T0603701053
Contact Type:		Regional Board Caseworker
Contact Name:		CHANDRA CANSLER
Organization Name:		LOS ANGELES RWQCB (REGION 4)
Address:		Not reported
City:		R4 UNKNOWN
Email:		ccansler@waterboards.ca.gov
Phone Number:		Not reported
LUST:		
Global Id:		T0603701053
Action Type:		ENFORCEMENT
Date:		2006-05-09 00:00:00
Action:		Site Visit / Inspection / Sampling
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2007-10-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2008-10-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2008-07-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2004-10-15 00:00:00
Action:		Monitoring Report - Quarterly

TC3139641.1s Page 147 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
ARCO #0003 (Continued)		S102424129
Date:		2004-10-22 00:00:00
Action:		Site Visit / Inspection / Sampling
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2005-07-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2009-10-15 00:00:00
Action:		Monitoring Report - Semi-Annually
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2011-01-15 00:00:00
Action:		Monitoring Report - Semi-Annually
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2006-04-19 00:00:00
Action:		Request for Closure
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2006-07-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2006-04-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701053
Action Type:		ENFORCEMENT
Date:		1998-03-02 00:00:00
Action:		Staff Letter
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2011-04-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2010-07-15 00:00:00
Action:		Monitoring Report - Semi-Annually
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2002-10-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701053
Action Type:		RESPONSE
Date:		2007-01-15 00:00:00
Action:		Monitoring Report - Quarterly

TC3139641.1s Page 149 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance (ft.)	Site	Database(s)
EPA ID Number		
ARCO #0003 (Continued)		S102424129
Global Id:	T0603701053	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2007-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2006-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2007-04-26 00:00:00	
Action:	Well Installation Report	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2006-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2002-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2004-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2004-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2008-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2008-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2004-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701053	
Action Type:	RESPONSE	
TC3139641.1s	Page 150 of 351	

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance (ft.)	Site	Database(s)
EPA ID Number		
ARCO #0003 (Continued)		S102424129
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	1943.2854980568464566456768898	
Source of Cleanup Funding:	UNK	
Preliminary Site Assessment Workplan Submitted:	4/2/1990	
Preliminary Site Assessment Began:	3/4/1992	
Pollution Characterization Began:	1/16/2003	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	4/2/1990	
Enforcement Action Date:	3/2/1998	
Historical Max MTBE Date:	12/11/2003	
Hist Max MTBE Conc in Groundwater:	1500	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	=	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	TONY BROWN	
RP Address:	4 CENTERPOINTE DR.	
Program:	LUST	
Lat/Long:	33.9454755 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	244	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	GROUNDWATER MONITORING AND VES RPT: 10/13/00 3RD QTR GW MON RPT 2000; 1/15/01 4TH QTR GW MON RPT 2000; 4/13/01 1ST QTR GW MON RPT 2001	
48	BP WEST COAST PRODUCTS LLC 0003 5201 CENTURY BLVD LOS ANGELES, CA 90045	HIST CORTESE S103663398 N/A
CORTESE:		
Region:	CORTESE	
Facility County Code:	19	
Reg By:	LTMKA	
Reg Id:	900450307	
49	DELTA AIRLINES 6150 CENTURY LOS ANGELES, CA	HIST CORTESE S101583680 LUST N/A SLIC
CORTESE:		
Region:	CORTESE	
Facility County Code:	19	
Reg By:	LTMKA	
Reg Id:	094-44	
LUST REG 4:		
Region:	4	
Regional Board:	04	
TC3139641.1s	Page 152 of 351	

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance (ft.)	Site	Database(s)
EPA ID Number		
ARCO #0003 (Continued)		S102424129
Date:	2003-01-14 00:00:00	
Action:	Soil and Water Investigation Report	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2003-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2003-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2005-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2003-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701053	
Action Type:	RESPONSE	
Date:	2003-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	900450307	
Status:	Pollution Characterization	
Substance:	Gasoline	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Groundwater	
Abatement Method Used at the Site:	VE	
Global Id:	T0603701053	
W Global ID:	Not reported	
Staff:	MSH	
Local Agency:	19050	
Cross Street:	Not reported	
Enforcement Type:	SEL	
Date Leak Discovered:	3/30/1990	
Date Leak First Reported:	4/2/1990	
Date Leak Record Entered:	3/13/1992	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	7/15/2002	
Date the Case was Closed:	Not reported	
How Leak Discovered:	OM	
How Leak Stopped:	Not reported	
Cause of Leak:	UNK	
Leak Source:	UNK	
TC3139641.1s	Page 151 of 351	

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance (ft.)	Site	Database(s)
EPA ID Number		
DELTA AIRLINES (Continued)		S101583680
County:	Los Angeles	
Facid:	094-44	
Status:	Post remedial action monitoring	
Substance:	Solvents	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Groundwater	
Abatement Method Used at the Site:	Not reported	
Global ID:	T0603700113	
W Global ID:	Not reported	
Staff:	SLC	
Local Agency:	19050	
Cross Street:	Not reported	
Enforcement Type:	Not reported	
Date Leak Discovered:	6/24/1993	
Date Leak First Reported:	6/24/1993	
Date Leak Record Entered:	8/3/1993	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	5/1/1998	
Date the Case was Closed:	Not reported	
How Leak Discovered:	Not reported	
How Leak Stopped:	Not reported	
Cause of Leak:	UNK	
Leak Source:	UNK	
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	8108.77310569052068572809179	
Source of Cleanup Funding:	UNK	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	Not reported	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	8/1/1995	
Enforcement Action Date:	5/1/1998	
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Yes	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	DELTA AIR LINES, INC.	
RP Address:	6150 W. CENTURY BLVD., 4TH FL., RM #446, LOS ANGELES 90045	
Program:	SLIC	
Lat/Long:	33.9454281 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	LOP/LOW - MINOR OR NO POTENTIAL WATER RESOURCE IMPACT	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	SLIC COST RECOVERY CASE. SLIC #644	REFER TO PART OF SITE
TC3139641.1s	Page 153 of 351	

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.) Site		Database(s) EPA ID Number
DELTA AIRLINES (Continued)		S101583680
CLOSED-AVION BUILDING MAY 1, 1998		
SLIC:		
Region:	STATE	
Facility Status:	Open - Verification Monitoring	
Status Date:	1998-05-01 00:00:00	
Global Id:	T0603700113	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Lead Agency Case Number:	Not reported	
Latitude:	33.9454281	
Longitude:	-118.3929136	
Case Type:	Cleanup Program Site	
Case Worker:	SLC	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	09444	
File Location:	Not reported	
Potential Media Affected:	Aquifer used for drinking water supply	
Potential Contaminants of Concern:	* Solvents	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
SLIC:		
Region:	4	
Facility Status:	No further action required	
SLIC:	0644A	
Substance:	VOCs	
Staff:	John Geroch	

49	DELTA AIRLINES 6150 CENTURY BOULEVARD W LOS ANGELES, CA	SLIC S106483731 N/A
SLIC:		
Region:	STATE	
Facility Status:	Completed - Case Closed	
Status Date:	1999-09-11 00:00:00	
Global Id:	SL184131396	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Lead Agency Case Number:	Not reported	
Latitude:	33.945746	
Longitude:	-118.261652	
Case Type:	Cleanup Program Site	
Case Worker:	JG	
Local Agency:	Not reported	
RB Case Number:	0644A	
File Location:	Not reported	
Potential Media Affected:	Not reported	
Potential Contaminants of Concern:	Not reported	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		

TC3139641.1s Page 154 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.) Site		Database(s) EPA ID Number
THRIFTY CAR RENTAL (Continued)		S101296949
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2008-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2005-01-28 00:00:00	
Action:	CAP/RAP - Feasibility Study Report	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2004-04-20 00:00:00	
Action:	Well Installation Report	
Global Id:	T0603701068	
Action Type:	REMEDATION	
Date:	1950-01-01 00:00:00	
Action:	Soil Vapor Extraction w/Other	
Global Id:	T0603701068	
Action Type:	ENFORCEMENT	
Date:	2003-03-10 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701068	
Action Type:	ENFORCEMENT	
Date:	2010-05-10 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2003-07-15 00:00:00	
Action:	Well Installation Report	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2007-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2005-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2005-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2009-10-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701068	
Action Type:	Other	

TC3139641.1s Page 156 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.) Site		Database(s) EPA ID Number
50	THRIFTY CAR RENTAL 5440 CENTURY BLVD W WESTCHESTER, CA 90045	LUST S101296949 N/A
LUST:		
Region:	STATE	
Global Id:	T0603701068	
Latitude:	33.9439562803138	
Longitude:	-118.375620245934	
Case Type:	LUST Cleanup Site	
Status:	Open - Remediation	
Status Date:	2009-12-21 00:00:00	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Case Worker:	DMB	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450525	
LOC Case Number:	Not reported	
File Location:	Regional Board	
Potential Media Affect:	Aquifer used for drinking water supply	
Potential Contaminants of Concern:	Aviation	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
Global Id:	T0603701068	
Contact Type:	Regional Board Caseworker	
Contact Name:	DAVID M. BJOSTAD	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4th Street, Suite 200	
City:	Los Angeles	
Email:	Not reported	
Phone Number:	Not reported	
Global Id:	T0603701068	
Contact Type:	Local Agency Caseworker	
Contact Name:	ELOY LUNA	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 North Main Street, Suite 1780	
City:	LOS ANGELES	
Email:	eloy.luna@lacity.org	
Phone Number:	Not reported	
Global Id:	T0603701068	
Action Type:	ENFORCEMENT	
Date:	2003-04-21 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701068	
Action Type:	ENFORCEMENT	
Date:	2008-11-18 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2004-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	

TC3139641.1s Page 155 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.) Site		Database(s) EPA ID Number
THRIFTY CAR RENTAL (Continued)		S101296949
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603701068	
Action Type:	ENFORCEMENT	
Date:	2003-10-28 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2010-10-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2010-04-05 00:00:00	
Action:	Soil and Water Investigation Workplan	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2010-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2010-04-30 00:00:00	
Action:	Well Installation Workplan	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2011-04-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2007-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2006-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	ENFORCEMENT	
Date:	2003-10-06 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2005-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2010-03-03 00:00:00	
Action:	CAP/RAP - Feasibility Study Report	

TC3139641.1s Page 157 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
THRIFTY CAR RENTAL (Continued)		S101296949
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2010-07-15 00:00:00	
Action:	Other Report / Document	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2006-06-06 00:00:00	
Action:	CAP/RAP - Feasibility Study Report	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2010-08-30 00:00:00	
Action:	Well Installation Report	
Global Id:	T0603701068	
Action Type:	ENFORCEMENT	
Date:	2004-01-20 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2006-04-03 00:00:00	
Action:	Soil and Water Investigation Workplan	
Global Id:	T0603701068	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2004-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2004-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2004-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2003-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2003-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	

TC3139641.1s Page 158 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
THRIFTY CAR RENTAL (Continued)		S101296949
Local Case No:	Not reported	
Case Type:	Soil	
Abatement Method Used at the Site:	Not reported	
Global ID:	T0603701068	
W Global ID:	Not reported	
Staff:	WXT	
Local Agency:	19050	
Cross Street:	AVIATION BLVD	
Enforcement Type:	DLSEL	
Date Leak Discovered:	5/25/1993	
Date Leak First Reported:	5/26/1993	
Date Leak Record Entered:	3/16/1993	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	6/7/1993	
Date the Case was Closed:	Not reported	
How Leak Discovered:	OM	
How Leak Stopped:	Not reported	
Cause of Leak:	UNK	
Leak Source:	UNK	
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	2962.8503839746474839042005749	
Source of Cleanup Funding:	UNK	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	5/26/1993	
Pollution Characterization Began:	5/10/2002	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	MIR. GREGG GERVAIS	
RP Address:	5440 W. CENTRAL BLVD.	
Program:	LUST	
Lat/Long:	33.9454534 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	Not reported	

TC3139641.1s Page 160 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
THRIFTY CAR RENTAL (Continued)		S101296949
Date:	2011-05-12 00:00:00	
Action:	CAP/RAP - Other Report	
Global Id:	T0603701068	
Action Type:	ENFORCEMENT	
Date:	2009-06-15 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2006-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	ENFORCEMENT	
Date:	2010-03-22 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2008-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2007-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2006-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2003-04-11 00:00:00	
Action:	Other Report / Document	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2003-12-01 00:00:00	
Action:	Soil and Water Investigation Workplan	
Global Id:	T0603701068	
Action Type:	RESPONSE	
Date:	2003-12-01 00:00:00	
Action:	Soil and Water Investigation Workplan	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	900450525	
Status:	Pollution Characterization	
Substance:	1	
Substance Quantity:	Not reported	

TC3139641.1s Page 159 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
50	THRIFTY CAR RENTAL 5440 CENTURY LOS ANGELES, CA 90045	HIST CORTESI S105024592 N/A
CORTESE:		
Region:	CORTESE	
Facility County Code:	19	
Reg By:	LTNKA	
Reg Id:	900450525	
51	FAA LAX CONTROL TOWER 1 WORLD WAY WESTCHESTER, CA 90045	LUST S102429637 N/A
LUST:		
Region:	STATE	
Global Id:	T0603701050	
Latitude:	33.944248	
Longitude:	-118.4001617	
Case Type:	LUST Cleanup Site	
Status:	Completed - Case Closed	
Status Date:	1996-06-26 00:00:00	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Case Worker:	YR	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450270	
LOC Case Number:	Not reported	
File Location:	Not reported	
Potential Media Affect:	Soil	
Potential Contaminants of Concern:	Diesel	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603701050	
Contact Type:	Regional Board Caseworker	
Contact Name:	YUE RONG	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yrong@waterboards.ca.gov	
Phone Number:	Not reported	
Global Id:	T0603701050	
Contact Type:	Local Agency Caseworker	
Contact Name:	ELOY LUNA	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 North Main Street, Suite 1780	
City:	LOS ANGELES	
Email:	eloy.luna@lacity.org	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603701050	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	

TC3139641.1s Page 161 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)

FAA LAX CONTROL TOWER (Continued)	S102429637
LUST REG 4:	
Region:	4
Regional Board:	04
County:	Los Angeles
Facid:	900450270
Status:	Case Closed
Substance:	Diesel
Substance Quantity:	Not reported
Local Case No.:	Not reported
Case Type:	Soil
Abatement Method Used at the Site:	Not reported
Global ID:	T0603701050
W Global ID:	Not reported
Staff:	UNK
Local Agency:	19050
Cross Street:	Not reported
Enforcement Type:	Not reported
Date Leak Discovered:	Not reported
Date Leak First Reported:	1/27/1988
Date Leak Record Entered:	5/30/1996
Date Confirmation Began:	Not reported
Date Leak Stopped:	Not reported
Date Case Last Changed on Database:	6/26/1996
Date the Case was Closed:	6/26/1996
How Leak Discovered:	Not reported
How Leak Stopped:	Not reported
Cause of Leak:	Not reported
Leak Source:	Piping
Operator:	FAA
Water System:	Not reported
Well Name:	Not reported
Approx. Dist To Production Well (ft):	10341.950216908443267151511886
Source of Cleanup Funding:	Piping
Preliminary Site Assessment Workplan Submitted:	Not reported
Preliminary Site Assessment Began:	Not reported
Pollution Characterization Began:	Not reported
Remediation Plan Submitted:	Not reported
Remedial Action Underway:	Not reported
Post Remedial Action Monitoring Began:	Not reported
Enforcement Action Date:	Not reported
Historical Max MTBE Date:	Not reported
Hist Max MTBE Conc in Groundwater:	Not reported
Hist Max MTBE Conc in Soil:	Not reported
Significant Interim Remedial Action Taken:	No
GW Qualifier:	Not reported
Soil Qualifier:	Not reported
Organization:	Not reported
Owner Contact:	Not reported
Responsible Party:	FED AVIATION ADMINISTRATION
RP Address:	P.O. BOX 92007, LOS ANGELES CA 90009
Program:	LUST
Lat/Long:	33.944248 / -1
Local Agency Staff:	PEJ
Beneficial Use:	Not reported
Priority:	Not reported
Cleanup Fund Id:	Not reported
Suspended:	Not reported

TC3139641.1s Page 162 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)

LAX AIR TRAFFIC CONTROL TOWER (Continued)	U001561860
Admin Agency:	Los Angeles City Fire Department
Amount:	Not reported
Contained:	Yes
Site Type:	Airport
E Date:	Not reported
Substance:	Diesel
Quantity Released:	Not reported
BBLs:	0
Cups:	0
CUFT:	0
Gallons:	350
Grams:	0
Pounds:	0
Liters:	0
Ounces:	0
Pints:	0
Quarts:	0
Sheen:	0
Tons:	0
Unknown:	0
Evacuations:	0
Number of Injuries:	0
Number of Fatalities:	0
Description:	The Central Plant at LAX airport received an alarm from an underground pipeline indicating a release. The fuel went to the secondary containment area but that was not secure allowing the fuel to leak to the soil. An airport contractor is on scene determining cleanup and extent of soil contamination.

51	1 WORLD WAY 1 WORLD WAY LOS ANGELES, CA 90045	ERNS	2010929275 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			

51	FAA LAX CONTROL TOWER 1 WORLD LOS ANGELES, CA 90045	HIST CORTESE CHMIRS	S100851406 N/A
CORTESE:			
Region:			
Facility County Code:			
Reg By:			
Reg Id:			
CHMIRS:			
OES Incident Number:			
OES notification:			
OES Date:			
OES Time:			
Incident Date:			
Date Completed:			

TC3139641.1s Page 164 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)

FAA LAX CONTROL TOWER (Continued)	S102429637
Assigned Name:	Not reported
Summary:	SITE RETREIVED FROM EHS OFFICE HEAP(S) DURING ORGANIZATION

51	LAX AIR TRAFFIC CONTROL TOWER 1 WORLD WAY LOS ANGELES, CA 90045	CHMIRS	U001561860 N/A
CHMIRS:			
OES Incident Number:			
OES notification:			
OES Date:			
OES Time:			
Incident Date:			
Date Completed:			
Property Use:			
Agency Id Number:			
Agency Incident Number:			
Time Notified:			
Time Completed:			
Surrounding Area:			
Estimated Temperature:			
Property Management:			
Special Studies 1:			
Special Studies 2:			
Special Studies 3:			
Special Studies 4:			
Special Studies 5:			
Special Studies 6:			
More Than Two Substances Involved?:			
Resp Agency Personnel # Of Decontaminated:			
Responding Agency Personnel # Of Injuries:			
Responding Agency Personnel # Of Fatalities:			
Others Number Of Decontaminated:			
Others Number Of Injuries:			
Others Number Of Fatalities:			
Vehicle Make/year:			
Vehicle License Number:			
Vehicle State:			
Vehicle Id Number:			
CA/DOT/PUC/IC Number:			
Company Name:			
Reporting Officer Name/ID:			
Report Date:			
Comments:			
Facility Telephone:			
Waterway Involved:			
Waterway:			
Spill Site:			
Cleanup By:			
Containment:			
What Happened:			
Type:			
Measure:			
Other:			
Date/Time:			
Year:			
Agency:			
Incident Date:			

TC3139641.1s Page 163 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)

FAA LAX CONTROL TOWER (Continued)	S100851406
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
Special Studies 1:	Not reported
Special Studies 2:	Not reported
Special Studies 3:	Not reported
Special Studies 4:	Not reported
Special Studies 5:	Not reported
Special Studies 6:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personnel # Of Decontaminated:	Not reported
Responding Agency Personnel # Of Injuries:	Not reported
Responding Agency Personnel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA/DOT/PUC/IC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Comments:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Storm Drain
Spill Site:	Airport
Cleanup By:	Responsible Party
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Gall(s)
Other:	Not reported
Date/Time:	1530
Year:	2010
Agency:	NRC
Incident Date:	1/21/2010
Admin Agency:	Los Angeles City Fire Department
Amount:	Not reported
Contained:	Yes
Site Type:	Storm Drain
E Date:	Not reported
Substance:	Jet Fuel
Quantity Released:	Not reported
BBLs:	Not reported
Cups:	Not reported
CUFT:	Not reported
Gallons:	Not reported
Grams:	Not reported
Pounds:	Not reported

TC3139641.1s Page 165 of 351

MAP FINDINGS		EDR ID Number
Map ID		
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number
FAA LAX CONTROL TOWER (Continued)		S100851406
Liters:	Not reported	
Ounces:	Not reported	
Pints:	Not reported	
Quarts:	Not reported	
Sheen:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	
Evacuations:	Not reported	
Number of Injuries:	Not reported	
Number of Fatalities:	Not reported	
Description:	PER NRC REPORT: "CALLER STATED THAT THERE WAS A RELEASE OF AN UNKNOWN AMOUNT OF JET-A FUEL INTO A STORM DRAIN WHICH LEADS TO THE DOMINGUEZ CHANNEL. THE CAUSE IS UNKNOWN. REMEDIAL ACTIONS: ABSORBENTS APPLIED."	

51 **TERMINAL #1 LAX** LUST S106517233
100 WORLD WY N/A
WESTCHESTER, CA 90045

LUST:
Region: STATE
Global Id: T0603701075
Latitude: 33.944248
Longitude: -118.4001617
Case Type: LUST Cleanup Site
Status: Open - Site Assessment
Status Date: 2002-12-03 00:00:00
Lead Agency: LOS ANGELES, CITY OF
Case Worker: PK
Local Agency: LOS ANGELES, CITY OF
RB Case Number: 900450598
LOC Case Number: Not reported
File Location: Not reported
Potential Media Affect: Soil
Potential Contaminants of Concern: Gasoline
Site History: Not reported

Click here to access the California GeoTracker records for this facility:

LUST:
Global Id: T0603701075
Contact Type: Regional Board Caseworker
Contact Name: YUE RONG
Organization Name: LOS ANGELES RWQCB (REGION 4)
Address: 320 W. 4TH ST., SUITE 200
City: Los Angeles
Email: yrong@waterboards.ca.gov
Phone Number: Not reported

Global Id: T0603701075
Contact Type: Local Agency Caseworker
Contact Name: PATRICK KILLIAN
Organization Name: LOS ANGELES, CITY OF
Address: 221 N FIGUEROA ST STE 1500
City: LOS ANGELES
Email: Not reported
Phone Number: 2134826527

TC3139641.1s Page 166 of 351

MAP FINDINGS		EDR ID Number
Map ID		
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number
TERMINAL #1 LAX (Continued)		S106517233
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	U.S. AIR	
RP Address:	SAME AS SITE	
Program:	LUST	
Lat/Long:	33.944248 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	Not reported	

52 **LOS ANGELES MUNICIPAL AIRPORT** Cortese S104891042
1 WORLD WAY LUST
LOS ANGELES, CA 90045 SLIC
ENVIROSTOR N/A

Cortese:
Region: CORTESE
Envirostor Id: 80000841
Site/Facility Type: MILITARY EVALUATION
Cleanup Status: ACTIVE
Status Date: 1/19/2010
Site Code: Not reported
Latitude: 33.9416666666667
Longitude: -118.375
EPA Id: Not reported
Owner: Not reported
Enf Type: Not reported
Effective Date: Not reported
Order No: Not reported
Region: Not reported
WIDID: Not reported
Swat R: Not reported
Waste Discharger System Num: Not reported
Solid Waste Id Num: Not reported
Waste Management Unit Name: Not reported
Agency Name: Not reported

LUST REG 4:
Region: 4
Regional Board: 04
County: Los Angeles
Facid: 900450098
Status: Remedial action (cleanup) Underway
Substance: Hydrocarbons
Substance Quantity: Not reported
Local Case No: Not reported

TC3139641.1s Page 168 of 351

MAP FINDINGS		EDR ID Number
Map ID		
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number
TERMINAL #1 LAX (Continued)		S106517233
LUST:		
Global Id:	T0603701075	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Stopped	
Global Id:	T0603701075	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603701075	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	

LUST REG 4:
Region: 4
Regional Board: 04
County: Los Angeles
Facid: 900450598
Status: Preliminary site assessment workplan submitted
Substance: Gasoline
Substance Quantity: Not reported
Local Case No: Not reported
Case Type: Soil
Abatement Method Used at the Site: Not reported
Global Id: T0603701075
W Global ID: Not reported
Staff: UNK
Local Agency: 19050
Cross Street: SEPULVEDA
Enforcement Type: Not reported
Date Leak Discovered: 11/6/1990
Date Leak First Reported: 11/6/1990
Date Leak Record Entered: 10/26/1991
Date Confirmation Began: Not reported
Date Leak Stopped: 11/6/1990
Date Case Last Changed on Database: 10/28/1991
Date the Case was Closed: Not reported
How Leak Discovered: OM
How Leak Stopped: Not reported
Cause of Leak: Other Cause
Leak Source: Piping
Operator: OLD CASENO WAS 102891-02
Water System: Not reported
Well Name: Not reported
Approx. Dist To Production Well (ft): 10341.950216908443267151511886
Source of Cleanup Funding: Piping
Preliminary Site Assessment Workplan Submitted: 11/6/1990
Preliminary Site Assessment Began: Not reported
Pollution Characterization Began: Not reported
Remediation Plan Submitted: Not reported
Remedial Action Underway: Not reported
Post Remedial Action Monitoring Began: Not reported

TC3139641.1s Page 167 of 351

MAP FINDINGS		EDR ID Number
Map ID		
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number
LOS ANGELES MUNICIPAL AIRPORT (Continued)		S104891042
Case Type:	Groundwater	
Abatement Method Used at the Site:	Not reported	
Global Id:	T0603701035	
W Global ID:	Not reported	
Staff:	SLC	
Local Agency:	19000	
Cross Street:	Not reported	
Enforcement Type:	Not reported	
Date Leak Discovered:	Not reported	
Date Leak First Reported:	1/14/1987	
Date Leak Record Entered:	3/10/1988	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	2/13/1998	
Date the Case was Closed:	Not reported	
How Leak Discovered:	Not reported	
How Leak Stopped:	Not reported	
Cause of Leak:	Not reported	
Leak Source:	Not reported	
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	8169.34725316136342145725064	
Source of Cleanup Funding:	Not reported	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	3/18/1988	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	2/13/1998	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	1/1/1965	
Hist Max MTBE Conc in Groundwater:	1	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	<	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	BLANK RP	
RP Address:	Not reported	
Program:	SLIC	
Lat/Long:	33.9598568 / -1	
Local Agency Staff:	Not reported	
Beneficial Use:	Not reported	
Priority:	LOP/HIGH - KNOWN HEALTH/SAFETY/ENVIRONMENTAL IMPACT	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	THIS IS PART OF THE LAX BULK FUEL STORAGE FACILITY. REFER TO SLIC #303A-LAXFUEL-BFSF	SAME SITE

SLIC:
Region: STATE
Facility Status: Open - Remediation
Status Date: 1998-02-13 00:00:00
Global Id: T0603701035

TC3139641.1s Page 169 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
LOS ANGELES MUNICIPAL AIRPORT (Continued)		S104891042
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Lead Agency Case Number:	Not reported	
Latitude:	33.9598568	
Longitude:	-118.3924138	
Case Type:	Cleanup Program Site	
Case Worker:	SLC	
Local Agency:	LOS ANGELES COUNTY	
RB Case Number:	900450099	
File Location:	Not reported	
Potential Media Affected:	Aquifer used for drinking water supply	
Potential Contaminants of Concern:	Other Solvent or Non-Petroleum Hydrocarbon	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
ENVIROSTOR:		
Site Type:	Military Evaluation	
Site Type Detailed:	FUDS	
Acres:	640	
NPL:	NO	
Regulatory Agencies:	SMBRP	
Lead Agency:	SMBRP	
Program Manager:	OMORUYI PATRICK	
Supervisor:	Shelia Lowe	
Division Branch:	Cleanup Cypress	
Facility ID:	80000841	
Site Code:	Not reported	
Assembly:	53	
Senate:	28	
Special Program:	Not reported	
Status:	Active	
Status Date:	2010-01-19 00:00:00	
Restricted Use:	NO	
Site Mgmt. Req.:	NONE SPECIFIED	
Funding:	DERA	
Latitude:	33.94166666666668	
Longitude:	-118.375	
APN:	NONE SPECIFIED	
Past Use:	FIRING RANGE - SMALL ARMS ETC...	
Potential COC:	30011, 32000	
Confirmed COC:	32000-NO,30011-NO	
Potential Description:	SOIL	
Alias Name:	CA99799F549000	
Alias Type:	Federal Facility ID	
Alias Name:	J09CA7139	
Alias Type:	INPR	
Alias Name:	80000841	
Alias Type:	Envirostor ID Number	
Completed Info:		
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Inventory Project Report (INPR)	
Completed Date:	1999-03-30 00:00:00	
Comments:	Not reported	
Future Area Name:	Not reported	

TC3139641.1s Page 170 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
LAFD - FIRE STATION 95 (Continued)		S109117656
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yrong@waterboards.ca.gov	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603794280	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id:	T0603794280	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
LAX TERMINAL 2		
200 WORLD WY		HIST CORTES
WESTCHESTER, CA 90045		LUST
CORTES:		S101297376
Region:	CORTES	
Facility County Code:	19	
Reg By:	LTNKA	
Reg Id:	900450607	
LUST:		
Region:	STATE	
Global Id:	T0603701076	
Latitude:	33.944248	
Longitude:	-118.4001617	
Case Type:	LUST Cleanup Site	
Status:	Completed - Case Closed	
Status Date:	2008-11-03 00:00:00	
Lead Agency:	LOS ANGELES, CITY OF	
Case Worker:	BC	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450607	
LOC Case Number:	Not reported	
File Location:	Not reported	
Potential Media Affect:	Other Groundwater (uses other than drinking water)	
Potential Contaminants of Concern:	Aviation	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603701076	
Contact Type:	Regional Board Caseworker	
Contact Name:	YUE RONG	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yrong@waterboards.ca.gov	
Phone Number:	Not reported	

TC3139641.1s Page 172 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
LOS ANGELES MUNICIPAL AIRPORT (Continued)		S104891042
Future Sub Area Name:	Not reported	
Future Document Type:	Not reported	
Future Due Date:	Not reported	
Schedule Area Name:	Not reported	
Schedule Sub Area Name:	Not reported	
Schedule Document Type:	Not reported	
Schedule Due Date:	Not reported	
Schedule Revised Date:	Not reported	
53		
5700 W. CENTURY BLVD.		ERNS
5700 W. CENTURY BLVD.		90175756
LOS ANGELES, CA 90009		N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		
53		
LAFD - FIRE STATION 95		LUST
10010 S INTERNATIONAL RD		S109117656
LOS ANGELES, CA 90045		N/A
LUST:		
Region:	STATE	
Global Id:	T0603794280	
Latitude:	33.945258	
Longitude:	-118.381557	
Case Type:	LUST Cleanup Site	
Status:	Open - Verification Monitoring	
Status Date:	1994-09-15 00:00:00	
Lead Agency:	LOS ANGELES, CITY OF	
Case Worker:	NR	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	Not reported	
LOC Case Number:	X50000857	
File Location:	Not reported	
Potential Media Affect:	Soil	
Potential Contaminants of Concern:	Gasoline	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603794280	
Contact Type:	Local Agency Caseworker	
Contact Name:	NEAL REITZEL	
Organization Name:	LOS ANGELES, CITY OF	
Address:	221 N FIGUEROA ST, STE 1500	
City:	LOS ANGELES	
Email:	neil.reitzel@lacity.org	
Phone Number:	2134826528	
Global Id:	T0603794280	
Contact Type:	Regional Board Caseworker	
Contact Name:	YUE RONG	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	

TC3139641.1s Page 171 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
LAX TERMINAL 2 (Continued)		S101297376
Global Id:	T0603701076	
Contact Type:	Local Agency Caseworker	
Contact Name:	BRAXTON CLARK	
Organization Name:	LOS ANGELES, CITY OF	
Address:	221 N FIGUEROA ST, STE 1500	
City:	LOS ANGELES	
Email:	Not reported	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603701076	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603701076	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	900450607	
Status:	Pollution Characterization	
Substance:	1	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Groundwater	
Abatement Method Used at the Site:	Not reported	
Global ID:	T0603701076	
W Global ID:	Not reported	
Staff:	UNK	
Local Agency:	19050	
Cross Street:	SEPULVEDA	
Enforcement Type:	Not reported	
Date Leak Discovered:	7/7/1986	
Date Leak First Reported:	7/7/1986	
Date Leak Record Entered:	11/16/1987	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	7/7/1986	
Date the Case was Closed:	Not reported	
How Leak Discovered:	OM	
How Leak Stopped:	Not reported	
Cause of Leak:	UNK	
Leak Source:	UNK	
Operator:	OLD CASENO WAS 080007	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	10341.950216908443267151511886	
Source of Cleanup Funding:	UNK	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	Not reported	

TC3139641.1s Page 173 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	Database(s)
Distance (ft.)	Site		EPA ID Number
LAX TERMINAL 2 (Continued)			S101297376
Pollution Characterization Began: 7/7/1986			
Remediation Plan Submitted: Not reported			
Remedial Action Underway: Not reported			
Post Remedial Action Monitoring Began: Not reported			
Enforcement Action Date: Not reported			
Historical Max MTBE Date: Not reported			
Hist Max MTBE Conc in Groundwater: Not reported			
Hist Max MTBE Conc in Soil: Not reported			
Significant Interim Remedial Action Taken: Not reported			
GW Qualifier: Not reported			
Soil Qualifier: Not reported			
Organization: Not reported			
Owner Contact: Not reported			
Responsible Party: DEPARTMENT OF AIRPORTS			
RP Address: 1 WORLD WY, LOS ANGELES, CA 90045			
Program: LUST			
Lat/Long: 33.944248 / -1			
Local Agency Staff: PEJ			
Beneficial Use: Not reported			
Priority: Not reported			
Cleanup Fund Id: Not reported			
Suspended: Not reported			
Assigned Name: Not reported			
Summary: UNKNOWN SOURCE. MANT OLD FUELING PITS HAD OPEN BOTTOMS AND MAY HAVE LEAKED SUBSTANTIAL AMOUNTS OF FUEL. CONTAMINATION WAS DISCOVERED DURING CONSTRUCTION TRENCHING.			

55 5500 WEST CENTURY BLVD
LOS ANGELES, CA HMIRS 95100483
N/A

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

55 5500 WEST CENTURY BLVD
LOS ANGELES, CA HMIRS 95060238
N/A

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	Database(s)
Distance (ft.)	Site		EPA ID Number
55	5500 WEST CENTURY BLVD INGLEWOOD, CA		HMIRS 2000111036 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
56	5628 W CENTURY BLVD LOS ANGELES, CA		HMIRS 2000024236 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
56	5628 W CENTURY BLVD LOS ANGELES, CA		HMIRS 2000024235 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
57	5932 W CENTURY BLVD LOS ANGELES, CA		HMIRS 2002066939 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
58	5758 CENTURY BLVD 5758 CENTURY BLVD LOS ANGELES, CA 90045		ERNS 96497632 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	Database(s)
Distance (ft.)	Site		EPA ID Number
55	5500 WEST CENTURY BLVD LOS ANGELES, CA		HMIRS 92110328 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
55	5500 WEST CENTURY BLVD LOS ANGELES, CA		HMIRS 97090323 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
55	5500 W CENTURY BLVD LOS ANGELES, CA		HMIRS 90040156 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
55	5500 WEST CENTURY BLVD LOS ANGELES, CA		HMIRS 97071687 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
55	5500 W CENTURY BLVD LOS ANGELES, CA		HMIRS 91080479 N/A

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	Database(s)
Distance (ft.)	Site		EPA ID Number
59	300 WORLD WAY 300 WORLD WAY LOS ANGELES, CA 90045		HMIRS 2009049581 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
59	LOS ANGELES INTERNATIONAL AIRPORT, 300 WORLD WAY LOS ANGELES, CA		CHMIRS S110982489 N/A
CHMIRS:			
OES Incident Number: *10-6732			
OES notification: 11/8/2010 3:51:00 PM			
OES Date: Not reported			
OES Time: Not reported			
Incident Date: Not reported			
Date Completed: Not reported			
Property Use: Not reported			
Agency Id Number: Not reported			
Agency Incident Number: Not reported			
Time Notified: Not reported			
Time Completed: Not reported			
Surrounding Area: Not reported			
Estimated Temperature: Not reported			
Property Management: Not reported			
Special Studies 1: Not reported			
Special Studies 2: Not reported			
Special Studies 3: Not reported			
Special Studies 4: Not reported			
Special Studies 5: Not reported			
Special Studies 6: Not reported			
More Than Two Substances Involved?: Not reported			
Resp Agency Personnel # Of Decontaminated: Not reported			
Responding Agency Personnel # Of Injuries: Not reported			
Responding Agency Personnel # Of Fatalities: Not reported			
Others Number Of Decontaminated: Not reported			
Others Number Of Injuries: Not reported			
Others Number Of Fatalities: Not reported			
Vehicle Make/year: Not reported			
Vehicle License Number: Not reported			
Vehicle State: Not reported			
Vehicle Id Number: Not reported			
CA/DOT/PUC/ICC Number: Not reported			
Company Name: Not reported			
Reporting Officer Name/ID: Not reported			
Report Date: Not reported			
Comments: Not reported			
Facility Telephone: Not reported			
Waterway Involved: No			
Waterway: Not reported			
Spill Site: Airport			
Cleanup By: Fire Dept.			
Containment: Not reported			
What Happened: Not reported			
Type: Not reported			
Measure: Unknown			

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
		EPA ID Number
(Continued)		S110982489
Other:	Not reported	
Date/Time:	1516	
Year:	2010	
Agency:	Horizon Air	
Incident Date:	11/8/2010	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	No	
Site Type:	Not reported	
E Date:	Not reported	
Substance:	Jet A Fuel	
Quantity Released:	Not reported	
BBL's:	Not reported	
Cups:	Not reported	
CUFFT:	Not reported	
Gallons:	Not reported	
Grams:	Not reported	
Pounds:	Not reported	
Liters:	Not reported	
Ounces:	Not reported	
Pints:	Not reported	
Quarts:	Not reported	
Sheen:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	
Evacuations:	Not reported	
Number of Injuries:	Not reported	
Number of Fatalities:	Not reported	
Description:	RP reports an in-flight bird strike on a Bombardier Q-400, twin engine turbo prop aircraft. The front edge of the wing was damaged causing the fuel leak. Fuel leaked from the A/C in flight and the RP believes that some fuel leaked to the ground when the aircraft landed, taxied and stopped. LAX Fire Department is on-scene to evacuate the passengers and clean-up the spill.	

59 300 WORLD WAY TERMINAL #3
LOS ANGELES, CA HMIRS 97090971
N/A

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

59 300 WORLD WAY
LOS ANGELES, CA 90045 DOT OPS 1009634872
N/A

DOT OPS:
Report ID: 1830647
Facility name: Not reported
Address: 300 WORLD WAY
LOS ANGELES, CA 90045
Latitude: Not reported
Longitude: Not reported

TC3139641.1s Page 178 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
		EPA ID Number
(Continued)		1009634872
Dist. of other fac. contributing:	0	
Other fac. contributing:	Not reported	
Dist. of other fac. impaired:	Not reported	
Other facility impaired:	Not reported	
Location of leak or failure:	BELOW ROAD (PAVED)	
Location other comment:	Not reported	
Cover depth:	24	
Soil at pipe depth:	SOIL	
Soil temperature at soil leak:	60	
Report by:	AGENCY CAUSING DAMAGE	
Report other comment:	Not reported	
Cause of Corrosion:	Not reported	
Cause of Corrosion Other:	Not reported	
Coating:	NO DATA	
Operator rec prior notification of excavation:	YES	
Notification Date:	Not reported	
Notification Hr:	0	
Was pipeline marked:	YES	
Type mark:	MAP FURNISHED	
Type mark other:	D	
Stat Req mark:	YES	
damerthmve:	NO DATA	
damerthmo:	Not reported	
emcoth:	NO	
emcothdesc:	Not reported	
causlkcons:	NO DATA	
steel_class:	Not reported	
Plastic:	Not reported	
plastrein:	Not reported	
castiron:	Not reported	
othmat:	Not reported	
initlatst:	NO DATA	
tsmednit:	Not reported	
tsmedioth:	Not reported	
initiaty:	Not reported	
minstpres:	Not reported	
tmehdpres:	Not reported	
pressikini:	Not reported	
subseqst:	NO DATA	
tsmedsub:	Not reported	
tsmsubot:	Not reported	
subseqty:	Not reported	
minstpsub:	Not reported	
thpressub:	Not reported	
pressiksub:	Not reported	

60 SHELL SVC STATION S A P NO 129519
304 CENTURY HIST CORTESE S105024590
LOS ANGELES, CA 90003 N/A

CORTESE:
Region: CORTESE
Facility County Code: 19
Reg By: LTNKA
Reg Id: 900440034

TC3139641.1s Page 180 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
		EPA ID Number
(Continued)		1009634872
EDR type:	NATURAL GAS DISTRIBUTION	
Cause of incident:	DAMAGE BY OUTSIDE FORCES	
Operator code:	18484	
Operator name:	SOUTHERN CALIFORNIA GAS COMPANY	
Incident address:	300 WORLD WAY LOS ANGELES, CA 90045	
Incident county:	LOS ANGELES	
Incident congressional district:	Not reported	
Incident date:	19830407	
Detection time:	1035	
Stoppage hours:	0	
Stoppage minutes:	40	
Estimated pressure at incident time:	30.00	
Max. allowable operating pressure:	35.00	
Part of operation that failed:	Not reported	
Part of operation other comment:	Not reported	
Part of system that failed:	FITTING	
Part of system other comment:	Not reported	
Year oart installed:	60	
Where leak originated:	BASE MATERIAL FRACTURE	
Leak other comment:	Not reported	
Real nominal pipe diameter:	0.000	
Pipe wall thickness (inches):	0.000	
Pipe specifications:	Not reported	
Pipe grade:	Not reported	
Type of repair done:	CLAMP	
Type other comment:	Not reported	
Length of replaced pipe:	0.00	
Component replaced/reconditioned:	NO DATA	
Component other comment:	Not reported	
Employee fatalities:	0	
Employees injured:	0	
Non-empl. fatalities:	0	
Non-empl. injured:	0	
Did a rupture occur:	YES	
Did gas ignite:	NO	
Did an explosion occur:	NO	
Secondary fires/explosions:	NO	
Operator property damage:	250	
Structure adjacent to leak:	COMMERCIAL MULTI-STORY	
Structure other comment:	Not reported	
Dist. to nearest structure:	50	
Underground facility involved:	NO	
Underground facility other comment:	Not reported	
Any utilities affected:	NO	
Dist. of other gas fac. contributing:	0	
Dist. of other gas fac. impaired:	0	
Dist. of telephone fac. contributing:	0	
Dist. of telephone fac. impaired:	0	
Dist. of electric fac. contributing:	0	
Dist. of electric fac. impaired:	0	
Dist. of storm sewer fac. contributing:	0	
Dist. of storm sewer fac. impaired:	0	
Dist. of other sewer fac. contributing:	0	
Dist. of other sewer fac. impaired:	0	
Dist. of water fac. contributing:	0	
Dist. of water fac. impaired:	0	

TC3139641.1s Page 179 of 351

Map ID

Direction

Distance

Distance (ft.)Site

61

DOCKWEILER BEACH SERVICE YARD

8255 VISTA DEL MAR PL

PLAYA DEL REY, CA 90293

LUST:

Region:

Global Id:

Latitude:

Longitude:

Case Type:

Status:

Status Date:

Lead Agency:

Case Worker:

Local Agency:

RB Case Number:

LOC Case Number:

File Location:

Potential Media Affect:

Potential Contaminants of Concern:

Site History:

LUST

S106517294

N/A

Database(s)

EPA ID Number

MAP FINDINGS

Click here to access the California GeoTracker records for this facility:

LUST:

Global Id:

Contact Type:

Contact Name:

Organization Name:

Address:

City:

Email:

Phone Number:

LUST:

Global Id:

Contact Type:

Contact Name:

Organization Name:

Address:

City:

Email:

Phone Number:

LUST:

Global Id:

Action Type:

Date:

Action:

LUST REG 4:

Region:

Regional Board:

County:

facid:

Status:

Substance:

Substance Quantity:

Local Case No:

TC3139641.1s Page 181 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.)Site	Database(s)	EPA ID Number	
DOCKWEILER BEACH SERVICE YARD (Continued)			S106517294
Case Type:	Soil		
Abatement Method Used at the Site:	Not reported		
Global ID:	T0603701356		
W Global ID:	Not reported		
Staff:	MSH		
Local Agency:	19050		
Cross Street:	IMPERIAL HWY		
Enforcement Type:	Not reported		
Date Leak Discovered:	Not reported		
Date Leak First Reported:	8/8/1988		
Date Leak Record Entered:	9/15/1988		
Date Confirmation Began:	Not reported		
Date Leak Stopped:	Not reported		
Date Case Last Changed on Database:	9/24/1997		
Date the Case was Closed:	10/1/1997		
How Leak Discovered:	Not reported		
How Leak Stopped:	Not reported		
Cause of Leak:	Not reported		
Leak Source:	Not reported		
Operator:	OLD CASE #930010316		
Water System:	Not reported		
Well Name:	Not reported		
Approx. Dist To Production Well (ft):	24146.842444535361198553130898		
Source of Cleanup Funding:	Not reported		
Preliminary Site Assessment Workplan Submitted:	Not reported		
Preliminary Site Assessment Began:	Not reported		
Pollution Characterization Began:	7/8/1990		
Remediation Plan Submitted:	Not reported		
Remedial Action Underway:	Not reported		
Post Remedial Action Monitoring Began:	Not reported		
Enforcement Action Date:	Not reported		
Historical Max MTBE Date:	Not reported		
Hist Max MTBE Conc in Groundwater:	Not reported		
Hist Max MTBE Conc in Soil:	Not reported		
Significant Interim Remedial Action Taken:	Not reported		
GW Qualifier:	Not reported		
Soil Qualifier:	Not reported		
Organization:	Not reported		
Owner Contact:	Not reported		
Responsible Party:	COUNT OF LA DEPT OF BEACH & HA		
RP Address:	13837 FLIJ WAY, MARINA DEL REY, CA 90292		
Program:	LUST		
Lat/Long:	33.9444793 / -1		
Local Agency Staff:	PEJ		
Beneficial Use:	Not reported		
Priority:	Not reported		
Cleanup Fund Id:	Not reported		
Suspended:	Not reported		
Assigned Name:	Not reported		
Summary:	ADDITIONAL INFORMATION	8/25/97	
	FAX INFORMATION TO RUSS REELFS	OLD CASE	
	#930010316		

TC3139641.1s Page 182 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.)Site	Database(s)	EPA ID Number	
62	LOS ANGELES INTERNATIONAL AIRPORT (LAX) LOS ANGELES INTERNATIONAL AIRPORT (LAX) LOS ANGELES, CA	ERNS	92294298 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
62	ADJACENT TO TERMINAL 2 LA INTL AIRPORT ADJACENT TO TERMINAL 2 LA INTL AIRPORT LOS ANGELES, CA	ERNS	92260000 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
62	LOS ANGELES AIRPORT LOS ANGELES AIRPORT LOS ANGELES, CA 90009	ERNS	92266200 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
62	LOS ANGELES INT'L AIRPORT GATE 33 SATILITE 3 LOS ANGELES INT'L AIRPORT GATE 33 SATILITE 3 LOS ANGELES, CA	ERNS	90158642 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
62	LOS ANGELES INT'L AIRPORT GATE 33 LOS ANGELES INT'L AIRPORT GATE 33 LOS ANGELES, CA	ERNS	90465460 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			

TC3139641.1s Page 184 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.)Site	Database(s)	EPA ID Number	
62	LOS ANGELES AIRPORT, SATELLITE 3 GATE 30 LOS ANGELES AIRPORT, SATELLITE 3 GATE 30 LOS ANGELES, CA	ERNS	8855239 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
62	LOS ANGELES INTERNATIONAL AIRPORT LOS ANGELES INTERNATIONAL AIRPORT LOS ANGELES, CA	ERNS	87463841 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
62	LOS ANGELES INTERNATIONAL AIRPORT LOS ANGELES INTERNATIONAL AIRPORT LOS ANGELES, CA	ERNS	98427117 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
62	FEDERAL EXPRESS HUB L.A. INTL AIRPORT FEDERAL EXPRESS HUB L.A. INTL AIRPORT LOS ANGELES, CA	ERNS	90466096 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
62	TWA GATE 31/LOS ANGELES INTL AIRPORT TWA GATE 31/LOS ANGELES INTL AIRPORT LOS ANGELES, CA	ERNS	87464072 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			

TC3139641.1s Page 183 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	EDR ID Number
Distance (ft.)Site	Database(s)	EPA ID Number	
62	LAX-SATELLITE 9 LOS ANGELES, CA 90045	CHMIRS	S100275743 N/A
CHMIRS:			
OES Incident Number: 9010718			
OES notification: Not reported			
OES Date: Not reported			
OES Time: Not reported			
Incident Date: 20-APR-90			
Date Completed: 20-APR-90			
Property Use: 500			
Agency Id Number: 19105			
Agency Incident Number: 303			
Time Notified: 1146			
Time Completed: 1300			
Surrounding Area: 400			
Estimated Temperature: 70			
Property Management: C			
Special Studies 1: Not reported			
Special Studies 2: Not reported			
Special Studies 3: Not reported			
Special Studies 4: Not reported			
Special Studies 5: Not reported			
Special Studies 6: Not reported			
More Than Two Substances Involved?: N			
Resp Agency Personnel # Of Decontaminated: 0			
Responding Agency Personnel # Of Injuries: 0			
Responding Agency Personnel # Of Fatalities: 0			
Others Number Of Decontaminated: 0			
Others Number Of Injuries: 0			
Others Number Of Fatalities: 0			
Vehicle Make/year: Not reported			
Vehicle License Number: Not reported			
Vehicle State: Not reported			
Vehicle Id Number: Not reported			
CA/DOT/PLU/ICC Number: Not reported			
Company Name: Not reported			
Reporting Officer Name/ID: T.M. KEPHART F.S. 27-A			
Report Date: 22-APR-90			
Comments: N			
Facility Telephone: 213-485-6003			
Waterway Involved: Not reported			
Waterway: Not reported			
Spill Site: Not reported			
Cleanup By: Not reported			
Containment: Not reported			
What Happened: Not reported			
Type: Not reported			
Measure: Not reported			
Other: Not reported			
Date/Time: Not reported			
Year: 88-92			
Agency: Not reported			
Incident Date: Not reported			
Admin Agency: Not reported			
Amount: Not reported			
Contained: Not reported			
Site Type: Not reported			

TC3139641.1s Page 185 of 351

Map ID		MAP FINDINGS		EDR ID Number	
Direction					
Distance			Database(s)	EPA ID Number	
Distance (ft.)	Site				
(Continued)					
E Date:	10-MAY-91			S100275743	
Substance:	Not reported				
Quantity Released:	Not reported				
BBL'S:	Not reported				
Cups:	Not reported				
CUFFT:	Not reported				
Gallons:	Not reported				
Grams:	Not reported				
Pounds:	Not reported				
Liters:	Not reported				
Ounces:	Not reported				
Pints:	Not reported				
Quarts:	Not reported				
Sheen:	Not reported				
Tons:	Not reported				
Unknown:	Not reported				
Evacuations:	Not reported				
Number of Injuries:	Not reported				
Number of Fatalities:	Not reported				
Description:	Not reported				

63	DELTA AIRLINES - AVION BLDG 6060 AVION DR LOS ANGELES, CA 90045	SLIC	S103427355 N/A
SLIC:			
Region:	4		
Facility Status:	No further action required		
SLIC:	0644B		
Substance:	TPH		
Staff:	John Geroch		

63	DELTA AIRLINES - AVION BLDG 6060 AVION DR LOS ANGELES, CA 90045	SLIC	S101583514 N/A
SLIC:			
Region:	STATE		
Facility Status:	Open		
Status Date:	1965-01-01 00:00:00		
Global Id:	SLT43390388		
Lead Agency:	LOS ANGELES RWQCB (REGION 4)		
Lead Agency Case Number:	Not reported		
Latitude:	33.9450415		
Longitude:	-118.3879981		
Case Type:	Cleanup Program Site		
Case Worker:	JG		
Local Agency:	Not reported		
RB Case Number:	0644B		
File Location:	Not reported		
Potential Media Affected:	Not reported		
Potential Contaminants of Concern:	Not reported		
Site History:	Not reported		

[Click here to access the California GeoTracker records for this facility:](#)

TC3139641.1s Page 186 of 351

Map ID		MAP FINDINGS		EDR ID Number	
Direction					
Distance				Database(s)	EPA ID Number
Distance (ft.)		Site			
UNITED AIRLINES, LAXGQ/LAX INT'L AIRPORT (Continued)					S110494421
Schedule Due Date:		Not reported			
Schedule Revised Date:		Not reported			
64	UNITED AIRLINES MAINTENANCE OPERATIONS CTR. 6020 AVION DR LOS ANGELES, CA			SLIC	S106717795 N/A
SLIC:					
Region:		STATE			
Facility Status:		Open - Site Assessment			
Status Date:		2004-09-23 00:00:00			
Global Id:		SL0603744922			
Lead Agency:		LOS ANGELES RWQCB (REGION 4)			
Lead Agency Case Number:		Not reported			
Latitude:		33.9425944971546			
Longitude:		-118.389165401459			
Case Type:		Cleanup Program Site			
Case Worker:		LM			
Local Agency:		Not reported			
RB Case Number:		1162			
File Location:		Regional Board			
Potential Media Affected:		Aquifer used for drinking water supply			
Potential Contaminants of Concern:		Aviation			
Site History:		A review of Regional Board files indicates the presence of Volatile			

TC3139641.1s Page 188 of 351

Map ID		MAP FINDINGS		EDR ID Number	
Direction					
Distance			Database(s)	EPA ID Number	
Distance (ft.)	Site				
64	UNITED AIRLINES 6020 AVION DRIVE LOS ANGELES, CA 90045	HIST CORTESE	1000399389 CAT080912693		
CORTESE:					
Region:	CORTESE				
Facility County Code:	19				
Reg By:	LTNKA				
Reg Id:	900450407				

64	UNITED AIRLINES, LAXGQ/LAX INT'L AIRPORT 6020 AVION DRIVE LOS ANGELES, CA 90045	ENVIROSTOR	S110494421 N/A
ENVIROSTOR:			
Site Type:	Tiered Permit		
Site Type Detailed:	Tiered Permit		
Acres:	Not reported		
NPL:	NO		
Regulatory Agencies:	NONE SPECIFIED		
Lead Agency:	NONE SPECIFIED		
Program Manager:	Not reported		
Supervisor:	Not reported		
Division Branch:	Cleanup Cypress		
Facility Id:	71003529		
Site Code:	Not reported		
Assembly:	53		
Senate:	28		
Special Program:	Not reported		
Status:	Refer: Other Agency		
Status Date:	Not reported		
Restricted Use:	NO		
Site Mgmt. Req.:	NONE SPECIFIED		
Funding:	Not reported		
Latitude:	33.945041500000002		
Longitude:	-118.3879981		
APN:	NONE SPECIFIED		
Past Use:	NONE SPECIFIED		
Potential COC:	NONE SPECIFIED		
Confirmed COC:	NONE SPECIFIED		
Potential Description:	NONE SPECIFIED		
Alias Name:	CAT080012693		
Alias Type:	EPA Identification Number		
Alias Name:	71003528		
Alias Type:	Envirostor ID Number		
Completed Info:			
Completed Area Name:	PROJECT WIDE		
Completed Sub Area Name:	Not reported		
Completed Document Type:	Phase I Verification		
Completed Date:	1997-12-18 00:00:00		
Comments:	Not reported		
Future Area Name:	Not reported		
Future Sub Area Name:	Not reported		
Future Document Type:	Not reported		
Future Due Date:	Not reported		
Schedule Area Name:	Not reported		
Schedule Sub Area Name:	Not reported		
Schedule Document Type:	Not reported		

TC3139641.1s Page 187 of 351

Map ID	MAP FINDINGS			EDR ID Number	
Direction					
Distance			Database(s)	EPA ID Number	
Distance (ft.)	Site				
UNITED AIRLINES MAINTENANCE OPERATIONS CTR. (Continued)					S106717795
<p>Areas A, C, and F. Soil within these areas does not contain significant VOC or TPH impacts nor is groundwater impacted by the vadose zone constituents in these areas. Area B is the only study area with confirmed impacts to both soil and groundwater including free floating product (TPH) and elevated chlorinated VOCs in groundwater. Free product recovery is ongoing. Soil and groundwater sampling has been conducted in Areas D and E. Soils underlying Area G are impacted by TPH but the impact does not extend to groundwater. Soils underlying Area H impacted by TPH, it is not known whether these impacts are just in vadose zone; groundwater impacts have not been confirmed. Groundwater underlying the subject site is impacted with chlorinated VOCs (i.e., TCE) ranging from 1.2 to 880 µg/L. The source of the chlorinated VOCs is Area B. Downgradient TCE concentrations have not yet been fully evaluated. Concentrations detected along the upgradient property boundary have ranged from 1.2 to 71 µg/L. Floating hydrocarbon product observed in MW-1 and -9 consists of relatively unweathered mineral spirits, which do not contain an appreciable fraction of either jet fuel or diesel. Approximately 1,530 gallons of product have been removed at a recovery rate of 2 gph.</p>					

[Click here to access the California GeoTracker records for this facility:](#)

64	UNITED AIRLINES 6020 AVION DR WESTCHESTER, CA 90045	LUST	S102439620 N/A
LUST:			
Region:	STATE		
Global Id:	T0603701063		
Latitude:	33.9426572		
Longitude:	-118.3874024		
Case Type:	LUST Cleanup Site		
Status:	Open - Site Assessment		
Status Date:	1987-10-28 00:00:00		
Lead Agency:	LOS ANGELES, CITY OF		
Case Worker:	TP		
Local Agency:	LOS ANGELES, CITY OF		
RB Case Number:	900450407		
LOC Case Number:	Not reported		
File Location:	Not reported		
Potential Media Affect:	Soil		
Potential Contaminants of Concern:	Aviation		
Site History:	Not reported		
Click here to access the California GeoTracker records for this facility:			
LUST:			
Global Id:	T0603701063		
Contact Type:	Regional Board Caseworker		
Contact Name:	YUE RONG		
Organization Name:	LOS ANGELES RWQCB (REGION 4)		
Address:	320 W. 4TH ST., SUITE 200		
City:	Los Angeles		
Email:	yrong@waterboards.ca.gov		
Phone Number:	Not reported		
Global Id:	T0603701063		

TC3139641.1s Page 189 of 351

MAP FINDINGS		EDR ID Number
Map ID		
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

UNITED AIRLINES (Continued)

S102439620

Contact Type: Local Agency Caseworker
Contact Name: TERRENCE PALMER
Organization Name: LOS ANGELES, CITY OF
Address: 221 N FIGUEROA ST STE 1500
City: LOS ANGELES
Email: Not reported
Phone Number: 2134826520

LUST:

Global Id: T0603701063
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Stopped

Global Id: T0603701063
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Discovery

Global Id: T0603701063
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Reported

LUST REG 4:

Region: 4
Regional Board: 04
County: Los Angeles
Facid: 900450407
Status: Leak being confirmed
Substance: 1
Substance Quantity: Not reported
Local Case No.: Not reported
Case Type: Soil
Abatement Method Used at the Site: Not reported
Global Id: T0603701063
W Global ID: Not reported
Staff: UNK
Local Agency: 19050
Cross Street: CENTURY
Enforcement Type: Not reported
Date Leak Discovered: 3/17/1987
Date Leak First Reported: 3/17/1987
Date Leak Record Entered: 8/13/1987
Date Confirmation Began: 3/17/1987
Date Leak Stopped: 3/17/1987
Date Case Last Changed on Database: 4/6/1998
Date the Case was Closed: Not reported
How Leak Discovered: Tank Closure
How Leak Stopped: Not reported
Cause of Leak: Corrosion
Leak Source: Tank
Operator: OLD CASE #005042
Water System: Not reported
Well Name: Not reported

TC3139641.1s Page 190 of 351

MAP FINDINGS		EDR ID Number
Map ID		
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

(Continued)

S107450456

Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/OC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Comments: Not reported
Facility Telephone: Not reported
Waterway Involved: Not reported
Waterway: Not reported
Spill Site: Not reported
Cleanup By: Reporting Party
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Date/Time: Not reported
Year: 2004
Agency: United Airlines
Incident Date: 5/28/2004 12:00:00 AM
Admin Agency: Los Angeles City Fire Department
Amount: Not reported
Contained: Yes
Site Type: Airport
E Date: Not reported
Substance: R22
Quantity Released: Not reported
BBLs: 0
Cups: 0
CUFT: 0
Gallons: 0.000000
Grams: 0
Pounds: 200
Liters: 0
Ounces: 0
Pints: 0
Quarts: 0
Sheen: 0
Tons: 0
Unknown: 0
Evacuations: 0
Number of Injuries: 0
Number of Fatalities: 0
Description: A valve on an air-conditioning unit lifted and released substance.

TC3139641.1s Page 192 of 351

MAP FINDINGS		EDR ID Number
Map ID		
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

UNITED AIRLINES (Continued)

S102439620

Approx. Dist To Production Well (ft): 6816.8277245377283860242998
Source of Cleanup Funding: Tank
Preliminary Site Assessment Workplan Submitted: Not reported
Preliminary Site Assessment Began: Not reported
Pollution Characterization Began: Not reported
Remediation Plan Submitted: Not reported
Remedial Action Underway: Not reported
Post Remedial Action Monitoring Began: Not reported
Enforcement Action Date: Not reported
Historical Max MTBE Date: Not reported
Hist Max MTBE Conc in Groundwater: Not reported
Hist Max MTBE Conc in Soil: Not reported
Significant Interim Remedial Action Taken: Not reported
GW Qualifier: Not reported
Soil Qualifier: Not reported
Organization: Not reported
Owner Contact: Not reported
Responsible Party: UNITED AIRLINES
RP Address: PO BOX 66100, CHICAGO, IL 60666
Program: LUST
Lat/Long: 33.9426572 / -1
Local Agency Staff: PEJ
Beneficial Use: Not reported
Priority: Not reported
Cleanup Fund Id: Not reported
Suspended: Not reported
Assigned Name: Not reported
Summary: 04/06/98 - TRANSM. OF FINAL RPT SUBSURFACE INVESTIGATION

65 5930 AVION DR. CHMIRS S107450456
LOS ANGELES, CA 90045 N/A

CHMIRS:

OES Incident Number: 04-3191
OES notification: 6/18/2004 11:25:49 AM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personnel # Of Decontaminated: Not reported
Responding Agency Personnel # Of Injuries: Not reported
Responding Agency Personnel # Of Fatalities: Not reported

TC3139641.1s Page 191 of 351

MAP FINDINGS		EDR ID Number
Map ID		
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

65 5950 AVION DR. HMIRS 20011812
LOS ANGELES, CA N/A

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

65 5950 AVION DR. HMIRS 2001040399
LOS ANGELES, CA N/A

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

66 LOS ANGELES INTERNATIONAL AIRP WMUDS/SWAT S103441399
ALONG SEPULVEDA N/A
LOS ANGELES, CA

WMUDS/SWAT:
Edit Date: Not reported
Complexity: Not reported
Primary Waste: Not reported
Primary Waste Type: Not reported
Secondary Waste: Not reported
Secondary Waste Type: Not reported
Base Meridian: Not reported
NPID: Not reported
Tonnage: 0
Regional Board ID: Not reported
Municipal Solid Waste: False
Superorder: False
Open To Public: False
Waste List: False
Agency Type: Not reported
Agency Name: LOS ANGELES INTERNATIONAL AIRP
Agency Department: Not reported
Agency Address: Not reported
Agency City,St,Zip: Not reported
Agency Contact: Not reported
Agency Telephone: Not reported
Land Owner Name: Not reported
Land Owner Address: Not reported
Land Owner City,St,Zip: CA
Land Owner Contact: Not reported
Land Owner Phone: Not reported
Region: 4
Facility Type: Not reported
Facility Description: Not reported
Facility Telephone: Not reported
SWAT Facility Name: Not reported
Primary SIC: Not reported
Secondary SIC: Not reported
Comments: Not reported

TC3139641.1s Page 193 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
LOS ANGELES INTERNATIONAL AIRP (Continued)		S103441399
Last Facility Editors: Not reported		
Waste Discharge System: False		
Solid Waste Assessment Test Program: True		
Toxic Pits Cleanup Act Program: False		
Resource Conservation Recovery Act: False		
Department of Defence: False		
Solid Waste Assessment Test Program: LOS ANGELES INTERNATIONAL AIRPORT		
Threat to Water Quality: Not reported		
Sub Chapter 15: False		
Regional Board Project Officer: LT		
Number of WMUDS at Facility: 1		
Section Range: Not reported		
RCRA Facility: Not reported		
Waste Discharge Requirements: Not reported		
Self-Monitoring Rept. Frequency: Not reported		
Waste Discharge System ID: 4 190137NUR		
Solid Waste Information ID: Not reported		
67	USCG SUPPORT CENTER SAN PEDRO USCG SUPPORT CENTER SAN PEDRO LOS ANGELES, CA	ERNS 93320354 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		
68	LYNDEN AIR FREIGHT 5220 102ND LOS ANGELES, CA 90045	SLIC S104549274 N/A
SLIC:		
Region: 4		
Facility Status: Inactive		
SLIC: 0964		
Substance: VOCs		
Staff: PGN		
69	5510 W. 102ND ST. LOS ANGELES, CA	CHMIRS S100279392 N/A
CHMIRS:		
OES Incident Number: 8008345		
OES notification: Not reported		
OES Date: Not reported		
OES Time: Not reported		
Incident Date: 13-OCT-89		
Date Completed: 13-OCT-89		
Property Use: 500		
Agency Id Number: 19105		
Agency Incident Number: 227		
Time Notified: 932		
Time Completed: 1400		
TC3139641.1s Page 194 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S100279392
Tons: Not reported		
Unknown: Not reported		
Evacuations: Not reported		
Number of Injuries: Not reported		
Number of Fatalities: Not reported		
Description: Not reported		
70	400 WORLD WAY WEST 400 WORLD WAY WEST LOS ANGELES, CA	HMIRS 2008453802 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.		
70	400 WORLD WAY LAX 400 WORLD WAY LAX LOS ANGELES, CA	HMIRS 2008434132 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.		
70	400 WORLD WAY LOS ANGELES, CA	HMIRS 2000022812 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.		
70	400 WORLD WAY LOS ANGELES, CA	HMIRS 2000022811 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.		
TC3139641.1s Page 196 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S100279392
Surrounding Area: 500		
Estimated Temperature: 75		
Property Management: P		
Special Studies 1: Not reported		
Special Studies 2: Not reported		
Special Studies 3: Not reported		
Special Studies 4: Not reported		
Special Studies 5: Not reported		
Special Studies 6: Not reported		
More Than Two Substances Involved?: N		
Resp Agency Personnel # Of Decontaminated: 0		
Responding Agency Personnel # Of Injuries: 0		
Responding Agency Personnel # Of Fatalities: 0		
Others Number Of Decontaminated: 0		
Others Number Of Injuries: 0		
Others Number Of Fatalities: 0		
Vehicle Make/year: Not reported		
Vehicle License Number: Not reported		
Vehicle State: Not reported		
Vehicle Id Number: Not reported		
CA/DOT/PUC/ICC Number: Not reported		
Company Name: Not reported		
Reporting Officer Name/ID: BRUCE R. BARBER BB1209 FS 27-C		
Report Date: 13-OCT-89		
Comments: Not reported		
Facility Telephone: 213-485-7480		
Waterway Involved: Not reported		
Waterway: Not reported		
Spill Site: Not reported		
Cleanup By: Not reported		
Containment: Not reported		
What Happened: Not reported		
Type: Not reported		
Measure: Not reported		
Other: Not reported		
Date/Time: Not reported		
Year: 88-92		
Agency: Not reported		
Incident Date: Not reported		
Admin Agency: Not reported		
Amount: Not reported		
Contained: Not reported		
Site Type: Not reported		
E Date: 22-MAY-90		
Substance: Not reported		
Quantity Released: Not reported		
BBLs: Not reported		
Cups: Not reported		
CUFT: Not reported		
Gallons: Not reported		
Grams: Not reported		
Pounds: Not reported		
Liters: Not reported		
Ounces: Not reported		
Pints: Not reported		
Quarts: Not reported		
Sheen: Not reported		
TC3139641.1s Page 195 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
70	400 WORLD WAY LOS ANGELES CA 400 WORLD WAY LOS ANGELES CA LAX, CA 90045	HMIRS 2010102650 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.		
70	LOS ANGELES WORLD AIRPORTS 380 WORLD WAY WEST LOS ANGELES, CA 90045	LUST S109348418 N/A
LUST:		
Region: STATE		
Global Id: T10000000483		
Latitude: 33.9441407		
Longitude: -118.4082494		
Case Type: LUST Cleanup Site		
Status: Completed - Case Closed		
Status Date: 2007-06-20 00:00:00		
Lead Agency: LOS ANGELES, CITY OF		
Case Worker: BC		
Local Agency: LOS ANGELES, CITY OF		
RB Case Number: Not reported		
LOCC Case Number: 23902		
File Location: Not reported		
Potential Media Affect: Soil		
Potential Contaminants of Concern: Not reported		
Site History: Not reported		
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id: T10000000483		
Contact Type: Local Agency Caseworker		
Contact Name: BRAXTON CLARK		
Organization Name: LOS ANGELES, CITY OF		
Address: 221 N FIGUEROA ST, STE 1500		
City: LOS ANGELES		
Email: Not reported		
Phone Number: Not reported		
LUST:		
Global Id: T10000000483		
Action Type: Other		
Date: 1950-01-01 00:00:00		
Action: Leak Stopped		
Global Id: T10000000483		
Action Type: Other		
Date: 1950-01-01 00:00:00		
Action: Leak Reported		
TC3139641.1s Page 197 of 351		

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
71	700 WORLD WAY LAX - TERMINAL #7 700 WORLD WAY LAX - TERMINAL #7 LOS ANGELES, CA 90009	ERNS	94400911 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			

71	TERMINAL #7, LAX TERMINAL AIRPORT 700 WORLD WAY LOS ANGELES, CA 90009	CHMIRS	S105634048 N/A
CHMIRS:			
OES Incident Number: 4051			
OES Notification: Not reported			
OES Date: 9/8/1994			
OES Time: 03:55:09 PM			
Incident Date: Not reported			
Date Completed: Not reported			
Property Use: Not reported			
Agency Id Number: Not reported			
Agency Incident Number: Not reported			
Time Notified: Not reported			
Time Completed: Not reported			
Surrounding Area: Not reported			
Estimated Temperature: Not reported			
Property Management: Not reported			
Special Studies 1: Not reported			
Special Studies 2: Not reported			
Special Studies 3: Not reported			
Special Studies 4: Not reported			
Special Studies 5: Not reported			
Special Studies 6: Not reported			
More Than Two Substances Involved?: Not reported			
Resp Agency Personnel # Of Decontaminated: Not reported			
Responding Agency Personnel # Of Injuries: Not reported			
Responding Agency Personnel # Of Fatalities: Not reported			
Others Number Of Decontaminated: Not reported			
Others Number Of Injuries: Not reported			
Others Number Of Fatalities: Not reported			
Vehicle Make/year: Not reported			
Vehicle License Number: Not reported			
Vehicle State: Not reported			
Vehicle Id Number: Not reported			
CA/DOT/PUC/ICC Number: Not reported			
Company Name: Not reported			
Reporting Officer Name/ID: Not reported			
Report Date: Not reported			
Comments: Not reported			
Facility Telephone: Not reported			
Waterway Involved: YES			
Waterway: Not reported			
Spill Site: Not reported			
Cleanup By: Reporting Party			
Containment: Not reported			
What Happened: Not reported			
Type: PETROLEUM			
Measure: Not reported			

TC3139641.1s Page 198 of 351

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
	TETRA GRAPHICS SITE (Continued)		S106568702
Enf Type: Not reported			
Effective Date: Not reported			
Order No: Not reported			
Region: Not reported			
WDID: Not reported			
Swat R: Not reported			
Waste Discharger System Num: Not reported			
Solid Waste Id Num: Not reported			
Waste Management Unit Name: Not reported			
Agency Name: Not reported			

RESPONSE:	
Facility ID:	19270329
Site Type:	State Response
Site Type Detail:	State Response or NPL
Acres:	0.01
National Priorities List:	NO
Cleanup Oversight Agencies:	SMBRP
Lead Agency:	SMBRP
Lead Agency Description:	DTSC - Site Mitigation And Brownfield Reuse Program
Project Manager:	DANIEL ZOGAIB
Supervisor:	Greg Holmes
Division Branch:	Cleanup Cypress
Site Code:	300990
Site Mgmt. Req.:	NONE SPECIFIED
Assembly:	51
Senate:	25
Special Program Status:	Not reported
Status:	Backlog
Status Date:	2010-11-15 00:00:00
Restricted Use:	NO
Funding:	Not reported
Latitude:	33.942882195448298
Longitude:	-118.371275
APN:	NONE SPECIFIED
Past Use:	ABOVE GROUND STORAGE TANKS, MACHINE SHOP
Potential COC:	10003, 10198
Confirmed COC:	NONE SPECIFIED
Potential Description:	OTH, SOIL, SV
Alias Name:	PRINTMASTERS
Alias Type:	Alternate Name
Alias Name:	TROY FURNITURE COMPANY
Alias Type:	Alternate Name
Alias Name:	300990
Alias Type:	Project Code (Site Code)
Alias Name:	19270329
Alias Type:	Envirostor ID Number

Completed Info:	
Completed Area Name:	PROJECT WIDE
Completed Sub Area Name:	Not reported
Completed Document Type:	Site Screening
Completed Date:	1998-03-11 00:00:00
Comments:	Site Screening Completed
Future Area Name:	
Future Sub Area Name:	

TC3139641.1s Page 200 of 351

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
(Continued)			S105634048
Other: Not reported			
Date/Time: Not reported			
Year: 1994			
Agency: Laxfuel Corp			
Incident Date: 08/0100 Sept 94			
Admin Agency: Not reported			
Amount: 400 gallon			
Contained: NO			
Site Type: AIRPORT			
E Date: Not reported			
Substance: Jet A fuel			
Quantity Released: Not reported			
BBL/S: Not reported			
Cups: Not reported			
CUFT: Not reported			
Gallons: Not reported			
Grams: Not reported			
Pounds: Not reported			
Liters: Not reported			
Ounces: Not reported			
Pints: Not reported			
Quarts: Not reported			
Sheen: Not reported			
Tons: Not reported			
Unknown: Not reported			
Evacuations: NO			
Number of Injuries: NO			
Number of Fatalities: NO			
Description: A undocumented 1" pipeline vent broke off a 14" pipeline during construction excavation. Majority of release was to soil and portion on pavement was contained. No storms drains involved			

72	7001 WORLD WAY WEST/GATE 121 7001 WORLD WAY WEST/GATE 121 LOS ANGELES, CA	ERNS	87463835 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			

73	TETRA GRAPHICS SITE 10310 GLASGOW PLACE LOS ANGELES, CA 90045	Cortese RESPONSE ENVIROSTOR	S106568702 N/A
Cortese:			
Region: CORTESE			
Envirostor Id: 19270329			
Site/Facility Type: STATE RESPONSE			
Cleanup Status: BACKLOG			
Status Date: 11/15/2010			
Site Code: 300990			
Latitude: 33.9428821954483			
Longitude: -118.371275			
EPA Id: Not reported			
Owner: Not reported			

TC3139641.1s Page 199 of 351

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
	TETRA GRAPHICS SITE (Continued)		S106568702
Future Document Type: Not reported			
Future Due Date: Not reported			
Schedule Area Name: Not reported			
Schedule Sub Area Name: Not reported			
Schedule Document Type: Not reported			
Schedule Due Date: Not reported			
Schedule Revised Date: Not reported			

ENVIROSTOR:	
Site Type:	State Response
Site Type Detailed:	State Response or NPL
Acres:	0.01
NPL:	NO
Regulatory Agencies:	SMBRP
Lead Agency:	SMBRP
Program Manager:	DANIEL ZOGAIB
Supervisor:	Greg Holmes
Division Branch:	Cleanup Cypress
Facility ID:	19270329
Site Code:	300990
Assembly:	51
Senate:	25
Special Program:	Not reported
Status:	Backlog
Status Date:	2010-11-15 00:00:00
Restricted Use:	NO
Site Mgmt. Req.:	NONE SPECIFIED
Funding:	Not reported
Latitude:	33.942882195448298
Longitude:	-118.371275
APN:	NONE SPECIFIED
Past Use:	ABOVE GROUND STORAGE TANKS, MACHINE SHOP
Potential COC:	10003, 10198
Confirmed COC:	NONE SPECIFIED
Potential Description:	OTH, SOIL, SV
Alias Name:	PRINTMASTERS
Alias Type:	Alternate Name
Alias Name:	TROY FURNITURE COMPANY
Alias Type:	Alternate Name
Alias Name:	300990
Alias Type:	Project Code (Site Code)
Alias Name:	19270329
Alias Type:	Envirostor ID Number

Completed Info:	
Completed Area Name:	PROJECT WIDE
Completed Sub Area Name:	Not reported
Completed Document Type:	Site Screening
Completed Date:	1998-03-11 00:00:00
Comments:	Site Screening Completed
Future Area Name:	
Future Sub Area Name:	
Future Document Type:	
Future Due Date:	
Schedule Area Name:	
Schedule Sub Area Name:	

TC3139641.1s Page 201 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
TETRA GRAPHICS SITE (Continued)		S106568702
Schedule Document Type: Not reported		
Schedule Due Date: Not reported		
Schedule Revised Date: Not reported		
74	LAX FUEL 6900 WORLD WY W WESTCHESTER, CA 90045	LUST S104891043 SLIC N/A
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	900450170	
Status:	Remedial action (cleanup) Underway	
Substance:	1	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Groundwater	
Abatement Method Used at the Site:	Not reported	
Global ID:	T0603701043	
W Global ID:	Not reported	
Staff:	SLC	
Local Agency:	19050	
Cross Street:	PERSHING	
Enforcement Type:	Not reported	
Date Leak Discovered:	5/13/1987	
Date Leak First Reported:	5/13/1987	
Date Leak Record Entered:	8/13/1987	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	5/13/1987	
Date Case Last Changed on Database:	2/13/1998	
Date the Case was Closed:	Not reported	
How Leak Discovered:	OM	
How Leak Stopped:	Not reported	
Cause of Leak:	Overfill	
Leak Source:	Tank	
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	10341.950216908443267151511886	
Source of Cleanup Funding:	Tank	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	7/14/1988	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	2/13/1998	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	1/1/1965	
Hist Max MTBE Conc in Groundwater:	1	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	<	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	AIRCRAFT SERVICE	
RP Address:	PO BOX 92529, LOS ANGELES, CA 90009	
TC3139641.1s Page 202 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
AMERICAN AIRLINES INC (EIS USE (Continued))		S104574681
Surrounding Area: Not reported		
Estimated Temperature: Not reported		
Property Management: Not reported		
Special Studies 1: Not reported		
Special Studies 2: Not reported		
Special Studies 3: Not reported		
Special Studies 4: Not reported		
Special Studies 5: Not reported		
Special Studies 6: Not reported		
More Than Two Substances Involved?: Not reported		
Resp Agency Personnel # Of Decontaminated: Not reported		
Responding Agency Personnel # Of Injuries: Not reported		
Responding Agency Personnel # Of Fatalities: Not reported		
Others Number Of Decontaminated: Not reported		
Others Number Of Injuries: Not reported		
Others Number Of Fatalities: Not reported		
Vehicle Make/year: Not reported		
Vehicle License Number: Not reported		
Vehicle State: Not reported		
Vehicle Id Number: Not reported		
CA/DOT/PUC/ICC Number: Not reported		
Company Name: Not reported		
Reporting Officer Name/ID: Not reported		
Report Date: Not reported		
Comments: Not reported		
Facility Telephone: Not reported		
Waterway Involved: YES		
Waterway: STORM DRAIN TO CONTAINMENT FIELD		
Spill Site: Not reported		
Cleanup By: AMERICAN AIRLINES		
Containment: Not reported		
What Happened: Not reported		
Type: PETROLEUM		
Measure: Not reported		
Other: Not reported		
Date/Time: Not reported		
Year: 1995		
Agency: AMERICAN AIRLINES		
Incident Date: 1845 22OCT95		
Admin Agency: Not reported		
Amount: 400-600 GALS		
Contained: YES		
Site Type: AIRPORT		
E Date: Not reported		
Substance: JET FUEL "a"		
Quantity Released: Not reported		
BBLs: Not reported		
Cups: Not reported		
CUFT: Not reported		
Gallons: Not reported		
Grams: Not reported		
Pounds: Not reported		
Liters: Not reported		
Ounces: Not reported		
Pints: Not reported		
Quarts: Not reported		
Sheen: Not reported		
TC3139641.1s Page 204 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
LAX FUEL (Continued)		S104891043
Program: SLIC		
Lat/Long: 33.944248 / -1		
Local Agency Staff: PELJ		
Beneficial Use: Not reported		
Priority: LOP/HIGH - KNOWN HEALTH/SAFETY/ENVIRONMENTAL IMPACT		
Cleanup Fund Id: Not reported		
Suspended: Not reported		
Assigned Name: Not reported		
Summary: SAME SITE REFER TO SLIC #303A-LAXFUEL-BFSF		
SLIC:		
Region:	STATE	
Facility Status:	Open - Remediation	
Status Date:	1998-02-13 00:00:00	
Global Id:	T0603701043	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Lead Agency Case Number:	Not reported	
Latitude:	33.944248	
Longitude:	-118.4001617	
Case Type:	Cleanup Program Site	
Case Worker:	SLC	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450170	
File Location:	Not reported	
Potential Media Affected:	Aquifer used for drinking water supply	
Potential Contaminants of Concern:	Aviation	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
74	LAX FUEL CORP 6900 WORLD LOS ANGELES, CA 90045	HIST CORTESE S101297379 N/A
CORTESE:		
Region:	CORTESE	
Facility County Code:	19	
Reg By:	LTMKA	
Reg Id:	900450170	
75	AMERICAN AIRLINES INC (EIS USE 7000 WORLD WAY WEST LOS ANGELES, CA 90009	CHMIRS S104574681 N/A
CHMIRS:		
OES Incident Number:	010606	
OES notification:	Not reported	
OES Date:	10/23/1995	
OES Time:	07:14:52 AM	
Incident Date:	Not reported	
Date Completed:	Not reported	
Property Use:	Not reported	
Agency Id Number:	Not reported	
Agency Incident Number:	Not reported	
Time Notified:	Not reported	
Time Completed:	Not reported	
TC3139641.1s Page 203 of 351		

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
AMERICAN AIRLINES INC (EIS USE (Continued))		S104574681
Tons: Not reported		
Unknown: Not reported		
Evacuations: NO		
Number of Injuries: NO		
Number of Fatalities: NO		
Description: DURING THE CHANGING OF A FUEL PUMP A CHECK VALVE WAS NOT CLOSED ALLOWING THE RELEASE.		
OES Incident Number: 98-4936		
OES notification: 11/2/199810:17:30 AM		
OES Date: Not reported		
OES Time: Not reported		
Incident Date: Not reported		
Date Completed: Not reported		
Property Use: Not reported		
Agency Id Number: Not reported		
Agency Incident Number: Not reported		
Time Notified: Not reported		
Time Completed: Not reported		
Surrounding Area: Not reported		
Estimated Temperature: Not reported		
Property Management: Not reported		
Special Studies 1: Not reported		
Special Studies 2: Not reported		
Special Studies 3: Not reported		
Special Studies 4: Not reported		
Special Studies 5: Not reported		
Special Studies 6: Not reported		
More Than Two Substances Involved?: Not reported		
Resp Agency Personnel # Of Decontaminated: Not reported		
Responding Agency Personnel # Of Injuries: Not reported		
Responding Agency Personnel # Of Fatalities: Not reported		
Others Number Of Decontaminated: Not reported		
Others Number Of Injuries: Not reported		
Others Number Of Fatalities: Not reported		
Vehicle Make/year: Not reported		
Vehicle License Number: Not reported		
Vehicle State: Not reported		
Vehicle Id Number: Not reported		
CA/DOT/PUC/ICC Number: Not reported		
Company Name: Not reported		
Reporting Officer Name/ID: Not reported		
Report Date: Not reported		
Comments: Not reported		
Facility Telephone: Not reported		
Waterway Involved: No		
Waterway: Not reported		
Spill Site: Not reported		
Cleanup By: Undetermined		
Containment: Not reported		
What Happened: Not reported		
Type: Not reported		
Measure: Not reported		
Other: Not reported		
Date/Time: Not reported		
Year: 1998		
Agency: American Airlines		
TC3139641.1s Page 205 of 351		

MAP FINDINGS		EDR ID Number
Map ID		
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

AMERICAN AIRLINES INC (EIS USE) (Continued)

S104574681

Incident Date: 10/26/1998 12:00:00 AM
Admin Agency: Los Angeles City Fire Department
Amount: Not reported
Contained: Unknown
Site Type: Airport
E Date: Not reported
Substance: Unknown
Quantity Released: Not reported
BBLs: 0
Cups: 0
CUFT: 0
Gallons: 0.000000
Grams: 0
Pounds: 0
Liters: 0
Ounces: 0
Pints: 0
Quarts: 0
Sheen: 0
Tons: 0
Unknown: 0
Evacuations: 0
Number of Injuries: 0
Number of Fatalities: 0
Description: While doing borings, crew found contaminated soil below the 50' mark.
A total of 6 borings were drilled but contamination was found in only 1.

75	AMERICAN AIRLINES INCORPORATED 7000 WORLD WAY WEST LOS ANGELES, CA 90045	HIST CORTESE	1000360673 N/A
CORTESE:			
Region: CORTESE			
Facility County Code: 19			
Reg By: LTNKA			
Reg Id: 900450598			

75	AMERICAN AIRLINES, INC. 7000 WORLD WAY W LOS ANGELES, CA 90045	HIST CORTESE	U001561814 N/A
CORTESE:			
Region: CORTESE			
Facility County Code: 19			
Reg By: LTNKA			
Reg Id: 900450625			

TC3139641.1s Page 206 of 351

MAP FINDINGS		EDR ID Number
Map ID		
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

AMERICAN A/L (Continued)

S106517245

LUST REG 4:
Region: 4
Regional Board: 04
County: Los Angeles
Facid: 900450625
Status: Leak being confirmed
Substance: Gasoline
Substance Quantity: Not reported
Local Case No: Not reported
Case Type: Soil
Abatement Method Used at the Site: Not reported
Global ID: T0603701078
W Global ID: Not reported
Staff: UNK
Local Agency: 19050
Cross Street: PERSHING
Enforcement Type: Not reported
Date Leak Discovered: 4/1/1991
Date Leak First Reported: 4/2/1991
Date Leak Record Entered: 10/26/1991
Date Confirmation Began: 4/2/1991
Date Leak Stopped: 4/2/1991
Date Case Last Changed on Database: 10/28/1991
Date the Case was Closed: Not reported
How Leak Discovered: Tank Closure
How Leak Stopped: Not reported
Cause of Leak: Other Cause
Leak Source: Piping
Operator: OLD CASENO WAS 102891-01
Water System: Not reported
Well Name: Not reported
Approx. Dist To Production Well (ft): 10341.950216908443267151511886
Source of Cleanup Funding: Piping
Preliminary Site Assessment Workplan Submitted: Not reported
Preliminary Site Assessment Began: Not reported
Pollution Characterization Began: Not reported
Remediation Plan Submitted: Not reported
Remedial Action Underway: Not reported
Post Remedial Action Monitoring Began: Not reported
Enforcement Action Date: Not reported
Historical Max MTBE Date: Not reported
Hist Max MTBE Conc in Groundwater: Not reported
Hist Max MTBE Conc in Soil: Not reported
Significant Interim Remedial Action Taken: Not reported
GW Qualifier: Not reported
Soil Qualifier: Not reported
Organization: Not reported
Owner Contact: Not reported
Responsible Party: LAX FUEL CORP.
RP Address: 6060 AVION DR, LOS ANGELES, CA 90045
Program: LUST
Lax/Long: 33.944248 / -1
Local Agency Staff: PEJ
Beneficial Use: Not reported
Priority: Not reported
Cleanup Fund Id: Not reported
Suspended: Not reported

TC3139641.1s Page 208 of 351

MAP FINDINGS		EDR ID Number
Map ID		
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

75	AMERICAN A/L 7000 WORLD WY W WESTCHESTER, CA 90045	LUST	S106517245 N/A
----	--	------	-------------------

LUST:
Region: STATE
Global Id: T0603701078
Latitude: 33.944248
Longitude: -118.4001617
Case Type: LUST Cleanup Site
Status: Completed - Case Closed
Status Date: 2008-11-12 00:00:00
Lead Agency: LOS ANGELES, CITY OF
Case Worker: BC
Local Agency: LOS ANGELES, CITY OF
RB Case Number: 900450625
LOC Case Number: Not reported
File Location: Not reported
Potential Media Affect: Soil
Potential Contaminants of Concern: Gasoline
Site History: Not reported

Click here to access the California GeoTracker records for this facility:

LUST:
Global Id: T0603701078
Contact Type: Regional Board Caseworker
Contact Name: YUE RONG
Organization Name: LOS ANGELES RWQCB (REGION 4)
Address: 320 W. 4TH ST., SUITE 200
City: Los Angeles
Email: yrong@waterboards.ca.gov
Phone Number: Not reported
Global Id: T0603701078
Contact Type: Local Agency Caseworker
Contact Name: BRAXTON CLARK
Organization Name: LOS ANGELES, CITY OF
Address: 221 N FIGUEROA ST, STE 1500
City: LOS ANGELES
Email: Not reported
Phone Number: Not reported

LUST:
Global Id: T0603701078
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Stopped

Global Id: T0603701078
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Discovery

Global Id: T0603701078
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Reported

TC3139641.1s Page 207 of 351

MAP FINDINGS		EDR ID Number
Map ID		
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

AMERICAN A/L (Continued)

S106517245

Assigned Name: Not reported
Summary: Not reported

75	7000 WORLD WAY WEST LOS ANGELES AIRPORT LOS ANGELES, CA	CHMIRS	S109040466 N/A
----	--	--------	-------------------

CHMIRS:
OES Incident Number: 06-3301
OES notification: 6/2/2006 01:40:21 PM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personnel # Of Decontaminated: Not reported
Responding Agency Personnel # Of Injuries: Not reported
Responding Agency Personnel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Comments: Not reported
Facility Telephone: Not reported
Waterway Involved: Not reported
Waterway: Storm Drain / Pacific Ocean
Spill Site: Not reported
Cleanup By: Unknown
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Date/Time: Not reported
Year: 2006
Agency: Los Angeles City Fire Dept
Incident Date: 6/2/2006 12:00:00 AM

TC3139641.1s Page 209 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S109040466
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	No	
Site Type:	Airport	
E Date:	Not reported	
Substance:	Jet Fuel	
Quantity Released:	Not reported	
BBLs:	0	
Cups:	0	
CUFF:	0	
Gallons:	0.000000	
Grams:	0	
Pounds:	65	
Liters:	0	
Ounces:	0	
Pints:	0	
Quarts:	0	
Sheen:	0	
Tons:	0	
Unknown:	0	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	Substance is being released from an aircraft due to a fire. Caller states fire is out. Caller states substance is releasing into a storm drain	

75	WORLDWIDE FLIGHT SERVICES 7000 WORLD WY W LOS ANGELES, CA	LUST	S109117773 N/A
LUST:			
Region:			
STATE			
Global Id:			
T0603736969			
Latitude:			
33.939985			
Longitude:			
-118.421341			
Case Type:			
LUST Cleanup Site			
Status:			
Open - Site Assessment			
Status Date:			
1993-07-29 00:00:00			
Lead Agency:			
LOS ANGELES, CITY OF			
Case Worker:			
WR			
Local Agency:			
LOS ANGELES, CITY OF			
RB Case Number:			
Not reported			
LOC Case Number:			
XS0000596			
File Location:			
Not reported			
Potential Media Affect:			
Soil			
Potential Contaminants of Concern:			
Aviation			
Site History:			
Not reported			
Click here to access the California GeoTracker records for this facility:			
LUST:			
Global Id:			
T0603736969			
Contact Type:			
Regional Board Caseworker			
Contact Name:			
YUE RONG			
Organization Name:			
LOS ANGELES RWQCB (REGION 4)			
Address:			
320 W. 4TH ST., SUITE 200			
City:			
Los Angeles			

TC3139641.1s Page 210 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S105665975
Property Use:	Not reported	
Agency Id Number:	Not reported	
Agency Incident Number:	Not reported	
Time Notified:	Not reported	
Time Completed:	Not reported	
Surrounding Area:	Not reported	
Estimated Temperature:	Not reported	
Property Management:	Not reported	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	Not reported	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DOT/PLU/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	Yes	
Waterway:	storm drain	
Spill Site:	Not reported	
Cleanup By:	Contractor	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	2000	
Agency:	City of LA, Dept. of Airport	
Incident Date:	8/27/200012:00:00 AM	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	Yes	
Site Type:	Airport	
E Date:	Not reported	
Substance:	diesel fuel	
Quantity Released:	Not reported	
BBLs:	0	
Cups:	0	
CUFF:	0	
Gallons:	30	
Grams:	0	
Pounds:	0	

TC3139641.1s Page 212 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
WORLDWIDE FLIGHT SERVICES (Continued)		S109117773
Email:	yrong@waterboards.ca.gov	
Phone Number:	Not reported	
Global Id:	T0603736969	
Contact Type:	Local Agency Caseworker	
Contact Name:	TBD	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 N. MAIN ST. RM. 970	
City:	LOS ANGELES	
Email:	Not reported	
Phone Number:	2139783722	
LUST:		
Global Id:		
T0603736969		
Action Type:		
Other		
Date:		
1950-01-01 00:00:00		
Action:		
Leak Discovery		
Global Id:		
T0603736969		
Action Type:		
Other		
Date:		
1950-01-01 00:00:00		
Action:		
Leak Reported		

75	7001 WORLD WAY WEST 7001 WORLD WAY WEST LOS ANGELES, CA 90009	ERNS	92256483 N/A
----	---	------	-----------------

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

75	7001 WORLD WAY WEST 7001 WORLD WAY WEST LOS ANGELES, CA 90009	ERNS	92256837 N/A
----	---	------	-----------------

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

75	LAX, TWA MAINTENANCE BASE, 7001 WORLD WAY WEST LOS ANGELES, CA 90045	CHMIRS	S105665975 N/A
CHMIRS:			
OES Incident Number:			
00-3854			
OES notification:			
8/27/200005:45:00 AM			
OES Date:			
Not reported			
OES Time:			
Not reported			
Incident Date:			
Not reported			
Date Completed:			
Not reported			

TC3139641.1s Page 211 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S105665975
Liters:	0	
Ounces:	0	
Pints:	0	
Quarts:	0	
Sheen:	0	
Tons:	0	
Unknown:	0	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	Overflowed while refueling a ground power unit.	

75	7001 WORLD WAY WEST 7001 WORLD WAY WEST LOS ANGELES, CA	ERNS	92256466 N/A
----	---	------	-----------------

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

75	7001 WORLD WAY WEST (IN HANGER) 7001 WORLD WAY WEST (IN HANGER) LOS ANGELES, CA 90045	ERNS	92256858 N/A
----	---	------	-----------------

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

75	LAXFUEL - DFSF 7265 W. WORLD WY LOS ANGELES, CA 90293	SLIC	S106485524 N/A
----	---	------	-------------------

SLIC:	
Region:	STATE
Facility Status:	Completed - Case Closed
Status Date:	1997-11-08 00:00:00
Global Id:	SLT43202200
Lead Agency:	LOS ANGELES RWQCB (REGION 4)
Lead Agency Case Number:	Not reported
Latitude:	33.9416443
Longitude:	-118.4245134
Case Type:	Cleanup Program Site
Case Worker:	JA
Local Agency:	Not reported
RB Case Number:	0303B
File Location:	Not reported
Potential Media Affect:	Not reported
Potential Contaminants of Concern:	Not reported
Site History:	Not reported

Click here to access the California GeoTracker records for this facility.

TC3139641.1s Page 213 of 351

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Database(s)	EPA ID Number
Distance (ft.)	Site		
75	LAX FUEL-DFSF 7265 WORLD WY W WESTCHESTER, CA 90045	LUST SLIC	S102432556 N/A
LUST REG 4:			
Region:	4		
Regional Board:	04		
County:	Los Angeles		
Facid:	900450198		
Status:	Case Closed		
Substance:	Gasoline		
Substance Quantity:	Not reported		
Local Case No:	Not reported		
Case Type:	Groundwater		
Abatement Method Used at the Site:	FPIT		
Global ID:	T0603701045		
W Global ID:	Not reported		
Staff:	SLC		
Local Agency:	19050		
Cross Street:	Not reported		
Enforcement Type:	Not reported		
Date Leak Discovered:	Not reported		
Date Leak First Reported:	6/11/1992		
Date Leak Record Entered:	5/23/1992		
Date Confirmation Began:	Not reported		
Date Leak Stopped:	Not reported		
Date Case Last Changed on Database:	5/30/1996		
Date the Case was Closed:	11/7/1997		
How Leak Discovered:	Not reported		
How Leak Stopped:	Not reported		
Cause of Leak:	UNK		
Leak Source:	UNK		
Operator:	Not reported		
Water System:	Not reported		
Well Name:	Not reported		
Approx. Dist To Production Well (ft):	10341.950216908443267151511886		
Source of Cleanup Funding:	UNK		
Preliminary Site Assessment Workplan Submitted:	Not reported		
Preliminary Site Assessment Began:	Not reported		
Pollution Characterization Began:	Not reported		
Remediation Plan Submitted:	6/11/1992		
Remedial Action Underway:	Not reported		
Post Remedial Action Monitoring Began:	5/30/1996		
Enforcement Action Date:	Not reported		
Historical Max MTBE Date:	Not reported		
Hist Max MTBE Conc in Groundwater:	Not reported		
Hist Max MTBE Conc in Soil:	Not reported		
Significant Interim Remedial Action Taken:	Not reported		
GW Qualifier:	Not reported		
Soil Qualifier:	Not reported		
Organization:	Not reported		
Owner Contact:	Not reported		
Responsible Party:	BLANK RP		
RP Address:	Not reported		
Program:	33.944248 / -1		
Lat/Long:	33.944248 / -1		
Local Agency Staff:	PEJ		
Beneficial Use:	Not reported		
Priority:	Not reported		

TC3139641.1s Page 214 of 351

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Database(s)	EPA ID Number
Distance (ft.)	Site		
75	7265 WORLD WY WEST LAX (LA AIRPORT) FUEL FACILITY #7 LOS ANGELES, CA 90009	CHMIRS	S106389842 N/A
CHMIRS:			
OES Incident Number:	4221		
OES notification:	Not reported		
OES Date:	9/19/1994		
OES Time:	10:10:08 AM		
Incident Date:	Not reported		
Date Completed:	Not reported		
Property Use:	Not reported		
Agency Id Number:	Not reported		
Agency Incident Number:	Not reported		
Time Notified:	Not reported		
Time Completed:	Not reported		
Surrounding Area:	Not reported		
Estimated Temperature:	Not reported		
Property Management:	Not reported		
Special Studies 1:	Not reported		
Special Studies 2:	Not reported		
Special Studies 3:	Not reported		
Special Studies 4:	Not reported		
Special Studies 5:	Not reported		
Special Studies 6:	Not reported		
More Than Two Substances Involved?:	Not reported		
Resp Agency Personnel # Of Decontaminated:	Not reported		
Responding Agency Personnel # Of Injuries:	Not reported		
Responding Agency Personnel # Of Fatalities:	Not reported		
Others Number Of Decontaminated:	Not reported		
Others Number Of Injuries:	Not reported		
Others Number Of Fatalities:	Not reported		
Vehicle Make/year:	Not reported		
Vehicle License Number:	Not reported		
Vehicle State:	Not reported		
Vehicle Id Number:	Not reported		
CA/DOT/PUC/ICC Number:	Not reported		
Company Name:	Not reported		
Reporting Officer Name/ID:	Not reported		
Report Date:	Not reported		
Comments:	Not reported		
Facility Telephone:	Not reported		
Waterway Involved:	YES		
Waterway:	Not reported		
Spill Site:	Not reported		
Cleanup By:	aircraft service		
Containment:	Not reported		
What Happened:	Not reported		
Type:	Not reported		
Measure:	Not reported		
Other:	Not reported		
Date/Time:	Not reported		
Year:	1994		
Agency:	aircraft service international		
Incident Date:	1730/18sept94		
Admin Agency:	Not reported		
Amount:	about 80 gals		
Contained:	NO		
Site Type:	OTHER		

TC3139641.1s Page 216 of 351

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Database(s)	EPA ID Number
Distance (ft.)	Site		
LAX FUEL-DFSF (Continued)		S102432556	
Cleanup Fund Id:	Not reported		
Suspended:	Not reported		
Assigned Name:	Not reported		
Summary:	REFER TO SLIC #303B		
SLIC:			
Region:	STATE		
Facility Status:	Completed - Case Closed		
Status Date:	1997-11-07 00:00:00		
Global Id:	T0603701045		
Lead Agency:	LOS ANGELES RWQCB (REGION 4)		
Lead Agency Case Number:	Not reported		
Latitude:	33.944248		
Longitude:	-118.4001617		
Case Type:	Cleanup Program Site		
Case Worker:	SLC		
Local Agency:	LOS ANGELES, CITY OF		
RB Case Number:	900450198		
File Location:	Not reported		
Potential Media Affected:	Aquifer used for drinking water supply		
Potential Contaminants of Concern:	Gasoline		
Site History:	Not reported		
Click here to access the California GeoTracker records for this facility:			
75	LAXFUEL - BFSF 7265 WORLD LOS ANGELES, CA 90293	SLIC	S106386984 N/A
SLIC:			
Region:	4		
Facility Status:	Remediation		
SLIC:	0303A		
Substance:	TPH		
Staff:	Jenny Au		
75	LAX FUEL-DFSF 7265 WORLD LOS ANGELES, CA 90045	HIST CORTESE SLIC	S102002382 N/A
CORTESE:			
Region:	CORTESE		
Facility County Code:	19		
Reg By:	LTNKA		
Reg Id:	900450198		
SLIC:			
Region:	4		
Facility Status:	No further action required		
SLIC:	0303B		
Substance:	TPH		
Staff:	Jenny Au		

TC3139641.1s Page 215 of 351

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Database(s)	EPA ID Number
Distance (ft.)	Site		
(Continued)		S106389842	
E Date:	Not reported		
Substance:	jet fuel jet-a		
Quantity Released:	Not reported		
BBLs:	Not reported		
Cups:	Not reported		
CUFT:	Not reported		
Gallons:	Not reported		
Grams:	Not reported		
Pounds:	Not reported		
Liters:	Not reported		
Ounces:	Not reported		
Pints:	Not reported		
Quarts:	Not reported		
Sheen:	Not reported		
Tons:	Not reported		
Unknown:	Not reported		
Evacuations:	NO		
Number of Injuries:	NO		
Number of Fatalities:	NO		
Description:	rubber gasket blew out of the filter vessel causing about 15 gals to spray across ground, rest of spill stayed on concrete		
76	LAX DAY STORAGE 6950 WORLD WAY W LOS ANGELES, CA 90009	LUST	U001560433 N/A
LUST:			
Region:	STATE		
Global Id:	T0603701080		
Latitude:	33.9417477		
Longitude:	-118.4222452		
Case Type:	LUST Cleanup Site		
Status:	Completed - Case Closed		
Status Date:	2000-09-28 00:00:00		
Lead Agency:	LOS ANGELES RWQCB (REGION 4)		
Case Worker:	DMB		
Local Agency:	LOS ANGELES, CITY OF		
RB Case Number:	900450643		
LOC Case Number:	Not reported		
File Location:	Not reported		
Potential Media Affect:	Soil		
Potential Contaminants of Concern:	Aviation		
Site History:	Not reported		
Click here to access the California GeoTracker records for this facility:			
LUST:			
Global Id:	T0603701080		
Contact Type:	Regional Board Caseworker		
Contact Name:	DAVID M. BJOSTAD		
Organization Name:	LOS ANGELES RWQCB (REGION 4)		
Address:	320 W. 4th Street, Suite 200		
City:	Los Angeles		
Email:	Not reported		
Phone Number:	Not reported		
Global Id:	T0603701080		
Contact Type:	Local Agency Caseworker		

TC3139641.1s Page 217 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
LAX DAY STORAGE (Continued)		U001560433
Contact Name:	ELOY LUNA	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 North Main Street, Suite 1780	
City:	LOS ANGELES	
Email:	eloy.luna@lacity.org	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603701080	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Stopped	
Global Id:	T0603701080	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603701080	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	900450643	
Status:	Case Closed	
Substance:	Jet Fuel	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Soil	
Abatement Method Used at the Site:	No Action Required	
Global ID:	T0603701080	
W Global ID:	Not reported	
Staff:	TCS	
Local Agency:	19050	
Cross Street:	Not reported	
Enforcement Type:	Not reported	
Date Leak Discovered:	10/15/1983	
Date Leak First Reported:	6/14/1999	
Date Leak Record Entered:	Not reported	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	10/15/1983	
Date Case Last Changed on Database:	2/16/2001	
Date the Case was Closed:	9/28/2000	
How Leak Discovered:	OM	
How Leak Stopped:	Not reported	
Cause of Leak:	UNK	
Leak Source:	Other Source	
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	14303.204536211447752787690514	

TC3139641.1s Page 218 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
HUGHES AIRCRAFT ARPT SITE (Continued)		1000240978
Assembly:	53	
Senate:	28	
Special Program:	* RCRA 3012 - Past Haz Waste Disp Inven Site	
Status:	Refer: Other Agency	
Status Date:	1984-05-01 00:00:00	
Restricted Use:	NO	
Site Mgmt. Req.:	NONE SPECIFIED	
Funding:	Not reported	
Latitude:	33.941330549354198	
Longitude:	-118.37350952929	
APN:	4129035002	
Past Use:	NONE SPECIFIED	
Potential COC:	10051, 10197, 10198, 30108	
Confirmed COC:	NONE SPECIFIED	
Potential Description:	NONE SPECIFIED	
Alias Name:	4129035002	
Alias Type:	APN	
Alias Name:	CAD071917462	
Alias Type:	EPA Identification Number	
Alias Name:	19360516	
Alias Type:	Envirositor ID Number	
Completed Info:		
Completed Area Name:	PROJECT WIDE	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Preliminary Assessment Report	
Completed Date:	1984-05-01 00:00:00	
Comments:	PRELIM ASSESS DONE RCRA 3012	
Completed Area Name:		
Completed Sub Area Name:	PROJECT WIDE	
Completed Document Type:	Not reported	
Completed Date:	* Discovery	
Comments:	1983-09-26 00:00:00	
Future Area Name:	FACILITY IDENTIFIED ID FROM ERRIS	
Future Sub Area Name:	Not reported	
Future Document Type:	Not reported	
Future Due Date:	Not reported	
Schedule Area Name:	Not reported	
Schedule Sub Area Name:	Not reported	
Schedule Document Type:	Not reported	
Schedule Due Date:	Not reported	
Schedule Revised Date:	Not reported	
77 NATIONAL TECHNICAL SYSTEMS		LUST S109604538
5320 104TH STREET		N/A
LOS ANGELES, CA 90045		
LUST:		
Region:	STATE	
Global Id:	T10000001112	
Latitude:	33.94161704	
Longitude:	-118.256485	
Case Type:	LUST Cleanup Site	
Status:	Open - Inactive	
Status Date:	2009-05-14 00:00:00	
Lead Agency:	LOS ANGELES, CITY OF	

TC3139641.1s Page 220 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
LAX DAY STORAGE (Continued)		U001560433
Source of Cleanup Funding:	Other Source	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	6/14/1999	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	1/1/1965	
Hist Max MTBE Conc in Groundwater:	10	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	<	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	ARCO PRODUCTS CO	
RP Address:	4 CENTERPOINTE DR., LA PALMA CA 90623-0166	
Program:	LUST	
Lat/Long:	33.9425858 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	PRODUCT RECOVERED BY VACUUM TRUCK; 3/20/00 GW MON & ANALYTICAL DATA & REQUEST FOR CLOSURE; 6/19/00 GW MON & ANALYTICAL DATA & REQUEST FOR CLOSURE; 8/21/00 GW MON & ANALYTICAL DATA & REQUEST FOR CLOSURE	
76 ARCO DAY STORAGE FACILITY		HIST CORTESE S103945740
6950 WORLD		N/A
LOS ANGELES, CA 90009		
CORTESE:		
Region:	CORTESE	
Facility County Code:	19	
Reg By:	LTNKA	
Reg Id:	900450643	
77 HUGHES AIRCRAFT ARPT SITE		ENVIROSTOR 1000240978
5340 W 104TH ST		CAD071917462
LOS ANGELES, CA 90009		
ENVIROSTOR:		
Site Type:	Historical	
Site Type Detailed:	* Historical	
Acres:	Not reported	
NPL:	NO	
Regulatory Agencies:	NONE SPECIFIED	
Lead Agency:	NONE SPECIFIED	
Program Manager:	Not reported	
Supervisor:	Referred - Not Assigned	
Division Branch:	Cleanup Chatsworth	
Facility ID:	19360516	
Site Code:	Not reported	

TC3139641.1s Page 219 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
NATIONAL TECHNICAL SYSTEMS (Continued)		S109604538
Case Worker:	WR	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	Not reported	
LOC Case Number:	Not reported	
File Location:	Not reported	
Potential Media Affect:	Soil	
Potential Contaminants of Concern:	Diesel	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T10000001112	
Contact Type:	Local Agency Caseworker	
Contact Name:	TBD	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 N. MAIN ST. RM. 970	
City:	LOS ANGELES	
Email:	Not reported	
Phone Number:	2139783722	
77 5341 W 104 TH ST		ERNS 200919213
5341 W 104 TH ST		N/A
LOS ANGELES, CA 90045		
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		
78 104TH ST & AVIATION BL		CHMIRS S100217955
WEST LOS ANGELES, CA 90025		N/A
CHMIRS:		
OES Incident Number:	8908815	
OES notification:	Not reported	
OES Date:	Not reported	
OES Time:	Not reported	
Incident Date:	12-NOV-89	
Date Completed:	12-NOV-89	
Property Use:	099	
Agency Id Number:	19105	
Agency Incident Number:	331	
Time Notified:	1052	
Time Completed:	1337	
Surrounding Area:	500	
Estimated Temperature:	75	
Property Management:	C	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	

TC3139641.1s Page 221 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S100217955
More Than Two Substances Involved?:		N
Resp Agency Personnel # Of Decontaminated:		0
Responding Agency Personnel # Of Injuries:		0
Responding Agency Personnel # Of Fatalities:		0
Others Number Of Decontaminated:		1
Others Number Of Injuries:		0
Others Number Of Fatalities:		0
Vehicle Make/year:		Not reported
Vehicle License Number:		Not reported
Vehicle State:		Not reported
Vehicle Id Number:		Not reported
CA/DOT/PLC/ICC Number:		Not reported
Company Name:		Not reported
Reporting Officer Name/ID:		DAVID A. RUFF #6215 FS-27-B
Report Date:		12-NOV-89
Comments:		Not reported
Facility Telephone:		213-485-7480
Waterway Involved:		Not reported
Waterway:		Not reported
Spill Site:		Not reported
Cleanup By:		Not reported
Containment:		Not reported
What Happened:		Not reported
Type:		Not reported
Measure:		Not reported
Other:		Not reported
Date/Time:		Not reported
Year:		88-92
Agency:		Not reported
Incident Date:		Not reported
Admin Agency:		Not reported
Amount:		Not reported
Contained:		Not reported
Site Type:		Not reported
E Date:		23-MAY-90
Substance:		Not reported
Quantity Released:		Not reported
BBLs:		Not reported
Cups:		Not reported
CUFT:		Not reported
Gallons:		Not reported
Grams:		Not reported
Pounds:		Not reported
Liters:		Not reported
Ounces:		Not reported
Pints:		Not reported
Quarts:		Not reported
Sheen:		Not reported
Tons:		Not reported
Unknown:		Not reported
Evacuations:		Not reported
Number of Injuries:		Not reported
Number of Fatalities:		Not reported
Description:		Not reported

TC3139641.1s Page 222 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S105643077
E Date:		Not reported
Substance:		unknown type of acid
Quantity Released:		Not reported
BBLs:		Not reported
Cups:		Not reported
CUFT:		Not reported
Gallons:		Not reported
Grams:		Not reported
Pounds:		Not reported
Liters:		Not reported
Ounces:		Not reported
Pints:		Not reported
Quarts:		Not reported
Sheen:		Not reported
Tons:		Not reported
Unknown:		Not reported
Evacuations:		NO
Number of Injuries:		NO
Number of Fatalities:		NO
Description:		a drum containing acid was melted during fire fighting effort and mixed with water. acid stayed in area, did not go down drain.

79	MODERN PLATING COMPANY	ENVIROSTOR	S110494074
5400 104TH STREET			
LOS ANGELES, CA 90045			
ENVIROSTOR:			
Site Type: Tiered Permit			
Site Type Detailed: Tiered Permit			
Acres: 1			
NPL: NO			
Regulatory Agencies: SMBRP			
Lead Agency: SMBRP			
Program Manager: Not reported			
Supervisor: John Geroch			
Division Branch: Cleanup Cypress			
Facility ID: 71003768			
Site Code: 530036			
Assembly: 53			
Senate: 28			
Special Program: Not reported			
Status: Active			
Status Date: 2005-09-28 00:00:00			
Restricted Use: NO			
Site Mgmt. Req.: NONE SPECIFIED			
Funding: Not reported			
Latitude: 33.941223800000003			
Longitude: -118.3718008			
APN: NONE SPECIFIED			
Past Use: METAL PLATING - CHROME			
Potential COC: 30022, 30027			
Confirmed COC: 30022,30027			
Potential Description: AQUIL SOIL			
Alias Name: CAD008250383			
Alias Type: EPA Identification Number			
Alias Name: 530036			
Alias Type: Project Code (Site Code)			
Alias Name: 71003768			

TC3139641.1s Page 224 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
79	5400 WEST 104TH ST LOS ANGELES, CA 90045	CHMIRS S105643077 N/A
CHMIRS:		
OES Incident Number: 016817		
OES notification: Not reported		
OES Date: 12/5/1996		
OES Time: 01:53:34 PM		
Incident Date: Not reported		
Date Completed: Not reported		
Property Use: Not reported		
Agency Id Number: Not reported		
Agency Incident Number: Not reported		
Time Notified: Not reported		
Time Completed: Not reported		
Surrounding Area: Not reported		
Estimated Temperature: Not reported		
Property Management: Not reported		
Special Studies 1: Not reported		
Special Studies 2: Not reported		
Special Studies 3: Not reported		
Special Studies 4: Not reported		
Special Studies 5: Not reported		
Special Studies 6: Not reported		
More Than Two Substances Involved?: Not reported		
Resp Agency Personnel # Of Decontaminated: Not reported		
Responding Agency Personnel # Of Injuries: Not reported		
Responding Agency Personnel # Of Fatalities: Not reported		
Others Number Of Decontaminated: Not reported		
Others Number Of Injuries: Not reported		
Others Number Of Fatalities: Not reported		
Vehicle Make/year: Not reported		
Vehicle License Number: Not reported		
Vehicle State: Not reported		
Vehicle Id Number: Not reported		
CA/DOT/PLC/ICC Number: Not reported		
Company Name: Not reported		
Reporting Officer Name/ID: Not reported		
Report Date: Not reported		
Comments: Not reported		
Facility Telephone: Not reported		
Waterway Involved: YES		
Waterway: Not reported		
Spill Site: Not reported		
Cleanup By: company crew		
Containment: Not reported		
What Happened: Not reported		
Type: CHEMICAL		
Measure: Not reported		
Other: Not reported		
Date/Time: Not reported		
Year: 1996		
Agency: la city fd		
Incident Date: 1646 23 Nov 96		
Admin Agency: Not reported		
Amount: 55 gal		
Contained: NO		
Site Type: IND PLT		

TC3139641.1s Page 223 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
MODERN PLATING COMPANY (Continued)		S110494074
Alias Type: Envirostor ID Number		
Completed Info:		
Completed Area Name: PROJECT WIDE		
Completed Sub Area Name: Not reported		
Completed Document Type: Consent Agreement		
Completed Date: 2005-09-28 00:00:00		
Comments: Not reported		
Completed Area Name: PROJECT WIDE		
Completed Sub Area Name: Not reported		
Completed Document Type: Other		
Completed Date: 2007-12-17 00:00:00		
Comments: Not reported		
Completed Area Name: PROJECT WIDE		
Completed Sub Area Name: Not reported		
Completed Document Type: Consent Agreement		
Completed Date: 2005-09-28 00:00:00		
Comments: Not reported		
Completed Area Name: PROJECT WIDE		
Completed Sub Area Name: Not reported		
Completed Document Type: Phase I Verification		
Completed Date: 2006-04-07 00:00:00		
Comments: Not reported		
Completed Area Name: PROJECT WIDE		
Completed Sub Area Name: Not reported		
Completed Document Type: Letter - Demand		
Completed Date: 2010-03-16 00:00:00		
Comments: First Collection Letter sent.		
Completed Area Name: PROJECT WIDE		
Completed Sub Area Name: Not reported		
Completed Document Type: Letter - Demand		
Completed Date: 2010-05-15 00:00:00		
Comments: Final Collectin Request sent.		
Completed Area Name: PROJECT WIDE		
Completed Sub Area Name: Not reported		
Completed Document Type: Letter - Demand		
Completed Date: 2010-04-15 00:00:00		
Comments: Second Collection Request sent.		
Completed Area Name: PROJECT WIDE		
Completed Sub Area Name: Not reported		
Completed Document Type: Phase 1		
Completed Date: 2006-04-07 00:00:00		
Comments: Not reported		
Completed Area Name: PROJECT WIDE		
Completed Sub Area Name: Not reported		
Completed Document Type: Supplemental Site Investigation Workplan		
Completed Date: 2006-06-13 00:00:00		
Comments: Not reported		
Completed Area Name: PROJECT WIDE		

TC3139641.1s Page 225 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
80	FANSTEEL INC 5235 104TH ST LOS ANGELES, CA 90045	HIST CORTSE SLIC S104549275 N/A
MODERN PLATING COMPANY (Continued) S110494074		
Completed Sub Area Name: Not reported Completed Document Type: Supplemental Site Investigation Report Completed Date: 2007-06-30 00:00:00 Comments: Not reported Future Area Name: Not reported Future Sub Area Name: Not reported Future Document Type: Not reported Future Due Date: Not reported Schedule Area Name: PROJECT WIDE Schedule Sub Area Name: Not reported Schedule Document Type: Fast Sheets Schedule Due Date: 2011-04-30 00:00:00 Schedule Revised Date: Not reported Schedule Area Name: PROJECT WIDE Schedule Sub Area Name: Not reported Schedule Document Type: Corrective Measures Proposal Approval Schedule Due Date: 2011-06-13 00:00:00 Schedule Revised Date: Not reported Schedule Area Name: PROJECT WIDE Schedule Sub Area Name: Not reported Schedule Document Type: Remedy Selection and Statement of Basis Schedule Due Date: 2011-05-19 00:00:00 Schedule Revised Date: Not reported Schedule Area Name: PROJECT WIDE Schedule Sub Area Name: Not reported Schedule Document Type: CEQA - Initial Study/ Neg. Declaration Schedule Due Date: 2011-04-30 00:00:00 Schedule Revised Date: Not reported		

TC3139641.1s Page 226 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
80	FANSTEEL INC (Continued)	S100935114
Cleanup Fund Id: Not reported Suspended: Not reported Assigned Name: Not reported Summary: *CONTAMINATION NOT SIGNIFICANT. NO FURTHER ACTION REQUIRED. CLOSED BY DAB.		
ENVIROSTOR:		
Site Type: Corrective Action Site Type Detailed: Corrective Action Acres: 0 NPL: NO Regulatory Agencies: NONE SPECIFIED Lead Agency: NONE SPECIFIED Program Manager: Not reported Supervisor: * Unknown Division Branch: Cleanup Chatsworth Facility ID: 80001407 Site Code: Not reported Assembly: 53 Senate: 53 Special Program: Not reported Status: * Inactive Status Date: 2008-01-01 00:00:00 Restricted Use: NO Site Mgmt. Req.: NONE SPECIFIED Funding: Not reported Latitude: 33.942104961937702 Longitude: -118.37159156799299 APN: 4129032012 Past Use: NONE SPECIFIED Potential COC: NONE SPECIFIED Confirmed COC: NONE SPECIFIED Potential Description: NONE SPECIFIED Alias Name: 4129032012 Alias Type: APN Alias Name: CAD050810829 Alias Type: EPA Identification Number Alias Name: SL204CV2380 Alias Type: GeoTracker Global ID Alias Name: 80001407 Alias Type: Envirostor ID Number		
Completed Info:		
Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported Completed Document Type: Preliminary Assessment Report Completed Date: 1991-03-08 00:00:00 Comments: Not reported Future Area Name: Not reported Future Sub Area Name: Not reported Future Document Type: Not reported Future Due Date: Not reported Schedule Area Name: Not reported Schedule Sub Area Name: Not reported Schedule Document Type: Not reported Schedule Due Date: Not reported		

TC3139641.1s Page 228 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
80	FANSTEEL INC 5235 W 104TH ST LOS ANGELES, CA 90045	LUST ENVIROSTOR S100935114 N/A
LUST REG 4:		
Region: 4 Regional Board: 04 County: Los Angeles Facid: 900450016 Status: Case Closed Substance: Solvents Substance Quantity: Not reported Local Case No: Not reported Case Type: Soil Abatement Method Used at the Site: Not reported Global ID: T0603701029 W Global ID: Not reported Staff: UNK Local Agency: 19050 Cross Street: Not reported Enforcement Type: Not reported Date Leak Discovered: Not reported Date Leak First Reported: 11/18/1983 Date Leak Record Entered: 12/31/1986 Date Confirmation Began: Not reported Date Leak Stopped: Not reported Date Case Last Changed on Database: 12/12/1988 Date the Case was Closed: 9/23/1988 How Leak Discovered: Not reported How Leak Stopped: Not reported Cause of Leak: UNK Leak Source: UNK Operator: Not reported Water System: Not reported Well Name: Not reported Approx. Dist To Production Well (ft): 3215.1703751082908638634822552 Source of Cleanup Funding: UNK Preliminary Site Assessment Workplan Submitted: Not reported Preliminary Site Assessment Began: Not reported Pollution Characterization Began: Not reported Remediation Plan Submitted: Not reported Remedial Action Underway: Not reported Post Remedial Action Monitoring Began: Not reported Enforcement Action Date: Not reported Historical Max MTBE Date: Not reported Hist Max MTBE Conc in Groundwater: Not reported Hist Max MTBE Conc in Soil: Not reported Significant Interim Remedial Action Taken: Not reported GW Qualifier: Not reported Soil Qualifier: Not reported Organization: Not reported Owner Contact: Not reported Responsible Party: BLANK RP RP Address: Not reported Program: LUST Lat/Long: 33.9420025 / -118.3715916 Local Agency Staff: PEJ Beneficial Use: Not reported Priority: Not reported		

TC3139641.1s Page 227 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
80	FANSTEEL INC (Continued)	S100935114
Schedule Revised Date: Not reported		
LYNDEN AIR FREIGHT INC (SAME AS FANSTEEL SITE, SL2042E1534)		
5235 WEST 104TH ST LOS ANGELES, CA 90045		
SLIC:		
Region: STATE Facility Status: Open - Inactive Status Date: 2000-08-01 00:00:00 Global Id: SL204CV2380 Lead Agency: LOS ANGELES RWQCB (REGION 4) Lead Agency Case Number: CAD050810829, 80001407 Latitude: 33.944228 Longitude: -118.248145 Case Type: Cleanup Program Site Case Worker: PGN Local Agency: Not reported RB Case Number: 0964 File Location: Not reported Potential Media Affected: Not reported Potential Contaminants of Concern: Not reported Site History: Not reported		
Click here to access the California GeoTracker records for this facility:		
Region: STATE Facility Status: Open - Site Assessment Status Date: 1998-03-02 00:00:00 Global Id: SL2042E1534 Lead Agency: LOS ANGELES RWQCB (REGION 4) Lead Agency Case Number: 33.9423808821334 Latitude: -118.37165594101 Longitude: 33.9423808821334 Case Type: Cleanup Program Site Case Worker: SR Local Agency: Not reported RB Case Number: 0759 File Location: Not reported Potential Media Affected: Not reported Potential Contaminants of Concern: Not reported Site History: Not reported		
Click here to access the California GeoTracker records for this facility:		
80	FANSTEEL PRECISION SHEET METAL 5235 W 104TH ST LOS ANGELES, CA 90045	CORRACTS 100038383 CAD050810829
CORRACTS:		
EPA ID: CAD050810829 EPA Region: 09 Area Name: ENTIRE FACILITY Actual Date: 03/08/1991 Action: CA075LO - CA Prioritization, Facility or area was assigned a low		

TC3139641.1s Page 229 of 351

Map ID		MAP FINDINGS		EDR ID Number	
Direction	Distance	Database(s)	EPA ID Number		
Distance (ft.)Site					
FANSTEEL PRECISION SHEET METAL (Continued)			1000388383		
NAICS Code(s):		corrective action priority 33991 336413 Jewelry and Silverware Manufacturing Other Aircraft Parts and Auxiliary Equipment Manufacturing			
Original schedule date:		Not reported			
Schedule end date:		Not reported			
80	5220 W. 104 TH STREET 5220 W. 104 TH STREET LOS ANGELES, CA	ERNS	90167377 N/A		
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.					
80	PRO-TECH DESIGN & MFG INC 5220 WEST 104TH STREET LOS ANGELES, CA 90045	CHMIRS	S100219786 N/A		
CHMIRS:					
OES Incident Number:		9010598			
OES notification:		Not reported			
OES Date:		Not reported			
OES Time:		Not reported			
Incident Date:		28-APR-90			
Date Completed:		28-APR-90			
Property Use:		600			
Agency Id Number:		19105			
Agency Incident Number:		726			
Time Notified:		1852			
Time Completed:		2352			
Surrounding Area:		600			
Estimated Temperature:		65			
Property Management:		P			
Special Studies 1:		Not reported			
Special Studies 2:		Not reported			
Special Studies 3:		Not reported			
Special Studies 4:		Not reported			
Special Studies 5:		Not reported			
Special Studies 6:		Not reported			
More Than Two Substances Involved?:		N			
Resp Agency Personnel # Of Decontaminated:		5			
Responding Agency Personnel # Of Injuries:		3			
Responding Agency Personnel # Of Fatalities:		0			
Others Number Of Decontaminated:		0			
Others Number Of Injuries:		0			
Others Number Of Fatalities:		0			
Vehicle Make/year:		Not reported			
Vehicle License Number:		Not reported			
Vehicle State:		Not reported			
Vehicle Id Number:		Not reported			
CA/DOT/PUC/ICC Number:		Not reported			
Company Name:		Not reported			
Reporting Officer Name/ID:		DOUGLAS A. GRAFT 550-72-2017 FS27-C			
Report Date:		01-MAY-90			
TC3139641.1s Page 230 of 351					

Map ID	MAP FINDINGS		EDR ID Number
Direction			
Distance		Database(s)	EPA ID Number
Distance (ft.)Site			
81	9900 LAX FUEL RD LOS ANGELES, CA 90009	CHMIRS	S105650764 N/A
CHMIRS:			
OES Incident Number:	97-2166		
OES notification:	5/29/199701:41:46 PM		
OES Date:	Not reported		
OES Time:	Not reported		
Incident Date:	Not reported		
Date Completed:	Not reported		
Property Use:	Not reported		
Agency Id Number:	Not reported		
Agency Incident Number:	Not reported		
Time Notified:	Not reported		
Time Completed:	Not reported		
Surrounding Area:	Not reported		
Estimated Temperature:	Not reported		
Property Management:	Not reported		
Special Studies 1:	Not reported		
Special Studies 2:	Not reported		
Special Studies 3:	Not reported		
Special Studies 4:	Not reported		
Special Studies 5:	Not reported		
Special Studies 6:	Not reported		
More Than Two Substances Involved?:	Not reported		
Resp Agency Personnel # Of Decontaminated:	Not reported		
Responding Agency Personnel # Of Injuries:	Not reported		
Responding Agency Personnel # Of Fatalities:	Not reported		
Others Number Of Decontaminated:	Not reported		
Others Number Of Injuries:	Not reported		
Others Number Of Fatalities:	Not reported		
Vehicle Make/Year:	Not reported		
Vehicle License Number:	Not reported		
Vehicle State:	Not reported		
Vehicle Id Number:	Not reported		
CA/DOT/PUC/ICC Number:	Not reported		
Company Name:	Not reported		
Reporting Officer Name/ID:	Not reported		
Report Date:	Not reported		
Comments:	Not reported		
Facility Telephone:	Not reported		
Waterway Involved:	No		
Waterway:	Not reported		
Spill Site:	Not reported		
Cleanup By:	Reporting Party		
Containment:	Not reported		
What Happened:	Not reported		
Type:	Not reported		
Measure:	Not reported		
Other:	Not reported		
Date/Time:	Not reported		
Year:	1997		
Agency:	LAX Fuel		
Incident Date:	5/29/199712:00:00 AM		
Admin Agency:	Los Angeles City Fire Department		
Amount:	Not reported		
Contained:	Yes		
Site Type:	Airport		

TC3139641.1s Page 232 of 351

Map ID		MAP FINDINGS		EDR ID Number	
Direction	Distance	Database(s)	EPA ID Number		
Distance (ft.)Site					
PRO-TECH DESIGN & MFG INC (Continued)			S100219786		
Comments:	Y				
Facility Telephone:	213 485-6003				
Waterway Involved:	Not reported				
Waterway:	Not reported				
Spill Site:	Not reported				
Cleanup By:	Not reported				
Containment:	Not reported				
What Happened:	Not reported				
Type:	Not reported				
Measure:	Not reported				
Other:	Not reported				
Date/Time:	Not reported				
Year:	88-92				
Agency:	Not reported				
Incident Date:	Not reported				
Admin Agency:	Not reported				
Amount:	Not reported				
Contained:	Not reported				
Site Type:	Not reported				
E Date:	13-MAY-91				
Substance:	Not reported				
Quantity Released:	Not reported				
BBLs:	Not reported				
Cups:	Not reported				
CUFT:	Not reported				
Gallons:	Not reported				
Grams:	Not reported				
Pounds:	Not reported				
Liters:	Not reported				
Ounces:	Not reported				
Pints:	Not reported				
Quarts:	Not reported				
Sheen:	Not reported				
Tons:	Not reported				
Unknown:	Not reported				
Evacuations:	Not reported				
Number of Injuries:	Not reported				
Number of Fatalities:	Not reported				
Description:	Not reported				
<hr/>					
81	9900 LAX FUEL ROAD 9900 LAX FUEL ROAD LOS ANGELES, CA	ERNS	2009907650 N/A		
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.					
TC3139641.1s Page 231 of 351					

Map ID	MAP FINDINGS		EDR ID Number	
Direction			Database(s)	EPA ID Number
Distance	(ft.)	Site		
<hr/>				
(Continued)			S105650764	
E Date:	Not reported			
Substance:	Jet fuel			
Quantity Released:	Not reported			
BBLs:	0			
Cups:	0			
CUFT:	0			
Gallons:	110			
Grams:	0			
Pounds:	0			
Liters:	0			
Ounces:	0			
Pints:	0			
Quarts:	0			
Sheen:	0			
Tons:	0			
Unknown:	0			
Evacuations:	0			
Number of Injuries:	0			
Number of Fatalities:	0			
Description:	while working on a valve, the valve closed and the supplier pipeline overpressured and a relief valve popped and the relief line leaked.			
<hr/>				
81	9900 LAX FUEL ROAD 9900 LAX FUEL ROAD LOS ANGELES, CA		ERNS	2009914975 N/A
<p>Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.</p>				
<hr/>				
81	9900 LAX FUEL RD LOS ANGELES, CA 90045		CHMIRS	S110861145 N/A
CHMIRS:				
OES Incident Number:		*10-5038		
OES notification:		8/23/2010 3:59:00 PM		
OES Date:		Not reported		
OES Time:		Not reported		
Incident Date:		Not reported		
Date Completed:		Not reported		
Property Use:		Not reported		
Agency Id Number:		Not reported		
Agency Incident Number:		Not reported		
Time Notified:		Not reported		
Time Completed:		Not reported		
Surrounding Area:		Not reported		
Estimated Temperature:		Not reported		
Property Management:		Not reported		
Special Studies 1:		Not reported		
Special Studies 2:		Not reported		
Special Studies 3:		Not reported		
Special Studies 4:		Not reported		
Special Studies 5:		Not reported		
Special Studies 6:		Not reported		
<hr/>				

TC1319641.1s Page 233 of 35

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S110981145
More Than Two Substances Involved?:		Not reported
Resp Agency Personnel # Of Decontaminated:		Not reported
Responding Agency Personnel # Of Injuries:		Not reported
Responding Agency Personnel # Of Fatalities:		Not reported
Others Number Of Decontaminated:		Not reported
Others Number Of Injuries:		Not reported
Others Number Of Fatalities:		Not reported
Vehicle Make/year:		Not reported
Vehicle License Number:		Not reported
Vehicle State:		Not reported
Vehicle Id Number:		Not reported
CA/DOT/PUC/ICC Number:		Not reported
Company Name:		Not reported
Reporting Officer Name/ID:		Not reported
Report Date:		Not reported
Comments:		Not reported
Facility Telephone:		Not reported
Waterway Involved:		No
Waterway:		Not reported
Spill Site:		Airport
Cleanup By:		Reporting Party
Containment:		Not reported
What Happened:		Not reported
Type:		Not reported
Measure:		Gall(s)
Other:		Not reported
Date/Time:		1:45
Year:		2010
Agency:		LAX Fuel, ASIG
Incident Date:		8/23/2010
Admin Agency:		Not reported
Amount:		Not reported
Contained:		Yes
Site Type:		Not reported
E Date:		Not reported
Substance:		Jet Fuel JP-8
Quantity Released:		50
BBLs:		Not reported
Cups:		Not reported
CUFT:		Not reported
Gallons:		Not reported
Grams:		Not reported
Pounds:		Not reported
Liters:		Not reported
Ounces:		Not reported
Pints:		Not reported
Quarts:		Not reported
Sheen:		Not reported
Tons:		Not reported
Unknown:		Not reported
Evacuations:		Not reported
Number of Injuries:		Not reported
Number of Fatalities:		Not reported
Description:		Caller stated that there was a release of up to 50 gallons of jet A fuel from an off spec. containment tank. The cause was due to a faulty valve. No waterway impact. RP has contained and is cleaning up spill.

TC3139641.1s Page 234 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S110421086
E Date:		Not reported
Substance:		Jet Fuel JP8
Quantity Released:		2
BBLs:		Not reported
Cups:		Not reported
CUFT:		Not reported
Gallons:		Not reported
Grams:		Not reported
Pounds:		Not reported
Liters:		Not reported
Ounces:		Not reported
Pints:		Not reported
Quarts:		Not reported
Sheen:		Not reported
Tons:		Not reported
Unknown:		Not reported
Evacuations:		0
Number of Injuries:		0
Number of Fatalities:		0
Description:		Caller is reporting that jet a discharged from a filter vent due to the operators changing the filter the material began to vent. As a result the material released into a concrete bermed area.
OES Incident Number:		'08-6795
OES notification:		9/17/2008 2:04:59 PM
OES Date:		Not reported
OES Time:		Not reported
Incident Date:		Not reported
Date Completed:		Not reported
Property Use:		Not reported
Agency Id Number:		Not reported
Agency Incident Number:		Not reported
Time Notified:		Not reported
Time Completed:		Not reported
Surrounding Area:		Not reported
Estimated Temperature:		Not reported
Property Management:		Not reported
Special Studies 1:		Not reported
Special Studies 2:		Not reported
Special Studies 3:		Not reported
Special Studies 4:		Not reported
Special Studies 5:		Not reported
Special Studies 6:		Not reported
More Than Two Substances Involved?:		Not reported
Resp Agency Personnel # Of Decontaminated:		Not reported
Responding Agency Personnel # Of Injuries:		Not reported
Responding Agency Personnel # Of Fatalities:		Not reported
Others Number Of Decontaminated:		Not reported
Others Number Of Injuries:		Not reported
Others Number Of Fatalities:		Not reported
Vehicle Make/year:		Not reported
Vehicle License Number:		Not reported
Vehicle State:		Not reported
Vehicle Id Number:		Not reported
CA/DOT/PUC/ICC Number:		Not reported
Company Name:		Not reported
Reporting Officer Name/ID:		Not reported

TC3139641.1s Page 236 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
81	9900 LAXFUEL RD. LOS ANGELES, CA	CHMIRS S110421086 N/A
CHMIRS:		
OES Incident Number:		'08-5881
OES notification:		8/13/2008 10:18:23 AM
OES Date:		Not reported
OES Time:		Not reported
Incident Date:		Not reported
Date Completed:		Not reported
Property Use:		Not reported
Agency Id Number:		Not reported
Agency Incident Number:		Not reported
Time Notified:		Not reported
Time Completed:		Not reported
Surrounding Area:		Not reported
Estimated Temperature:		Not reported
Property Management:		Not reported
Special Studies 1:		Not reported
Special Studies 2:		Not reported
Special Studies 3:		Not reported
Special Studies 4:		Not reported
Special Studies 5:		Not reported
Special Studies 6:		Not reported
More Than Two Substances Involved?:		Not reported
Resp Agency Personnel # Of Decontaminated:		Not reported
Responding Agency Personnel # Of Injuries:		Not reported
Responding Agency Personnel # Of Fatalities:		Not reported
Others Number Of Decontaminated:		Not reported
Others Number Of Injuries:		Not reported
Others Number Of Fatalities:		Not reported
Vehicle Make/year:		Not reported
Vehicle License Number:		Not reported
Vehicle State:		Not reported
Vehicle Id Number:		Not reported
CA/DOT/PUC/ICC Number:		Not reported
Company Name:		Not reported
Reporting Officer Name/ID:		Not reported
Report Date:		Not reported
Comments:		Not reported
Facility Telephone:		Not reported
Waterway Involved:		No
Waterway:		Not reported
Spill Site:		Other
Cleanup By:		Unknown
Containment:		Not reported
What Happened:		Not reported
Type:		Not reported
Measure:		Gall(s)
Other:		Not reported
Date/Time:		0945
Year:		2008
Agency:		NRC
Incident Date:		8/13/2008
Admin Agency:		Los Angeles City Fire Department
Amount:		Not reported
Contained:		Yes
Site Type:		Not reported

TC3139641.1s Page 235 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S110421086
Report Date:		Not reported
Comments:		Not reported
Facility Telephone:		Not reported
Waterway Involved:		No
Waterway:		Not reported
Spill Site:		Other
Cleanup By:		Unknown
Containment:		Not reported
What Happened:		Not reported
Type:		Not reported
Measure:		Gall(s)
Other:		Not reported
Date/Time:		1325
Year:		2008
Agency:		NRC
Incident Date:		9/17/2008
Admin Agency:		Los Angeles City Fire Department
Amount:		Not reported
Contained:		Yes
Site Type:		Not reported
E Date:		Not reported
Substance:		JP 8 Jet Fuel
Quantity Released:		2
BBLs:		Not reported
Cups:		Not reported
CUFT:		Not reported
Gallons:		Not reported
Grams:		Not reported
Pounds:		Not reported
Liters:		Not reported
Ounces:		Not reported
Pints:		Not reported
Quarts:		Not reported
Sheen:		Not reported
Tons:		Not reported
Unknown:		Not reported
Evacuations:		0
Number of Injuries:		0
Number of Fatalities:		0
Description:		Caller is reporting a release of jet fuel from a 4500 gallon vacuum truck due to a leaking valve.

81 9900 LAXFUEL RD
9900 LAXFUEL RD
LOS ANGELES, CA 90045

ERNS 2010931586
N/A

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

TC3139641.1s Page 237 of 351

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
81	9900 LAXFUEL RD 9900 LAXFUEL RD LOS ANGELES, CA 90045	ERNS	2008884343 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
81	9900 LAXFUEL RD 9900 LAXFUEL RD LOS ANGELES, CA 90045	ERNS	2009901969 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
81	9900 LAXFUEL RD 9900 LAXFUEL RD LOS ANGELES, CA 90045	ERNS	2008880461 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
81	LAXFUEL CORP 9900 LAXFUEL RD LOS ANGELES, CA 90045	SLIC CHMIRS	S102807262 N/A
SLIC: Region: STATE Facility Status: Open - Site Assessment Status Date: 2002-06-30 00:00:00 Global Id: SL373462461 Lead Agency: LOS ANGELES RWQCB (REGION 4) Lead Agency Case Number: Not reported Latitude: 33.9422918757164 Longitude: -118.42066526413 Case Type: Cleanup Program Site Case Worker: LM Local Agency: Not reported RB Case Number: 0303A File Location: Regional Board Potential Media Affected: Not reported Potential Contaminants of Concern: * Petroleum - Jet Fuel / Aviation Site History: Not reported			
Click here to access the California GeoTracker records for this facility:			
CHMIRS: OES Incident Number: *10-1260 OES notification: 2/18/2010 10:11:00 AM OES Date: Not reported			
TC3139641.1s Page 238 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
	LAXFUEL CORP (Continued)		S102807262
Gallons: Not reported Grams: Not reported Pounds: Not reported Liters: Not reported Ounces: Not reported Pints: Not reported Quarts: Not reported Sheets: Not reported Tons: Not reported Unknown: Not reported Evacuations: Not reported Number of Injuries: Not reported Number of Fatalities: Not reported Description: per NRC fax: "Caller stated that there was a release of 5 gallons of jet A fuel and water that is contained in a bermed area, the cause was due to operator error. A vac truck that had back pressure in the line lost some of the substance when the valve was opened." Remedial actions: Material contained, clean-up completed.			
81	9900 LAXFUEL RD 9900 LAXFUEL RD LOS ANGELES, CA 90045	ERNS	2008901969 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
81	9900 LAXFUEL RD 9900 LAXFUEL RD LOS ANGELES, CA 90045	ERNS	2008879212 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.			
82	LOS ANGELES MUNICIPAL AIRPORT LOS ANGELES, CA	FUDS	1009484398 N/A
FUDS: Federal Facility ID: CA9799F5490 FUDS #: J09CA0431 INST ID: 61101 Facility Name: LOS ANGELES MUNICIPAL AIRPORT City: LOS ANGELES State: CA EPA Region: 9 County: LOS ANGELES Congressional District: 36 US Army District: Los Angeles District (SPL) Fiscal Year: 2009 Telephone: 213-452-3920			
TC3139641.1s Page 240 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
	LAXFUEL CORP (Continued)		S102807262
OES Time: Not reported Incident Date: Not reported Date Completed: Not reported Property Use: Not reported Agency Id Number: Not reported Agency Incident Number: Not reported Time Notified: Not reported Time Completed: Not reported Surrounding Area: Not reported Estimated Temperature: Not reported Property Management: Not reported Special Studies 1: Not reported Special Studies 2: Not reported Special Studies 3: Not reported Special Studies 4: Not reported Special Studies 5: Not reported Special Studies 6: Not reported More Than Two Substances Involved?: Not reported Resp Agency Personnel # Of Decontaminated: Not reported Responding Agency Personnel # Of Injuries: Not reported Responding Agency Personnel # Of Fatalities: Not reported Others Number Of Decontaminated: Not reported Others Number Of Injuries: Not reported Others Number Of Fatalities: Not reported Vehicle Make/year: Not reported Vehicle License Number: Not reported Vehicle State: Not reported Vehicle Id Number: Not reported CA/DOT/PUC/ICC Number: Not reported Company Name: Not reported Reporting Officer Name/ID: Not reported Report Date: Not reported Comments: Not reported Facility Telephone: Not reported Waterway Involved: No Waterway: Not reported Spill Site: Airport Cleanup By: Unknown Containment: Not reported What Happened: Not reported Type: Not reported Measure: Gall(s) Other: Not reported Date/Time: 930 Year: 2010 Agency: NRC Incident Date: 2/18/2010 Admin Agency: Los Angeles City Fire Department Amount: Not reported Contained: Yes Site Type: Not reported E Date: Not reported Substance: JP-8, jet fuel Quantity Released: 5 BBLs: Not reported Cups: Not reported CUFT: Not reported			
TC3139641.1s Page 239 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
	LOS ANGELES MUNICIPAL AIRPORT (Continued)		1009484398
NPL Status: Not Listed RAB: Not reported CTC: 1100.53593 Current Owner: CITY FUDS Description Details: During World War II, this approximately 570-acre site was used by the U.S. Army Air Force for military flights. The site occupies the majority of a one square mile section near the easternmost portion of the Los Angeles International Airport in the City of Los Angeles, Los Angeles County, California. It is bordered by Imperial Boulevard to the south, Sepulveda Boulevard to the west, Century Boulevard to the north and Aviation Boulevard (formerly Redondo Boulevard) to the east, and it occupies 1 the majority of Section 6, Township 3 South, Range 14 West. In 1943, the City of Los Angeles reportedly turned the operation of the airport over to the federal government for the "duration." During that period, existing hangars, offices, and other facilities were taken over by the Army and Navy air transport. Currently this site is owned by the City of Los Angeles and is entirely within the boundaries of Los Angeles International Airport (LAX). FUDS History Details: In 1940 and 1941, the Army obtained two leases from the City of Los Angeles for land at the Los Angeles Municipal Airport (Mines Field) site. This 570-acre site, which was originally known as Mines Field, was established as a municipal airport in 192 28. During World War II, it was used by the U.S. Army Air Force for military flights. FUDS Current Program Details: FUDS Future Program Details:			
83	LAX FUEL CORP 7259 WORLD LOS ANGELES, CA 90045	HIST CORTESE	S103066162 N/A
CORTESE: Region: CORTESE Facility County Code: 19 Reg By: LTNKA Reg Id: 900450189			
83	LAX FUEL CORP 7261 WORLD LOS ANGELES, CA 90045	HIST CORTESE	S110060697 N/A
CORTESE: Region: CORTESE Facility County Code: 19 Reg By: LTNKA Reg Id: 900450161			
TC3139641.1s Page 241 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
83	LAX FUEL CORP 7251 WORLD LOS ANGELES, CA 90045 CORTESE: Region: CORTESE Facility County Code: 19 Reg By: LTNKA Reg Id: 900450134	HIST CORTESE	S103066161 N/A
83	ALLIED AVIATION SERVICE O 7251 WORLD LOS ANGELES, CA 90045 CORTESE: Region: CORTESE Facility County Code: 19 Reg By: LTNKA Reg Id: 900450207	HIST CORTESE	1000249030 N/A
83	LAX FUEL CORP 7259 WORLD WY W WESTCHESTER, CA 90045 LUST REG 4: Region: 4 Regional Board: 04 County: Los Angeles Facid: 900450189 Status: Remedial action (cleanup) Underway Substance: Hydrocarbons Substance Quantity: Not reported Local Case No: Not reported Case Type: Groundwater Abatement Method Used at the Site: Not reported Global ID: T0603701044 W Global ID: Not reported Staff: SLC Local Agency: 19050 Cross Street: PERSHING Enforcement Type: Not reported Date Leak Discovered: 2/13/1987 Date Leak First Reported: 2/13/1987 Date Leak Record Entered: 8/14/1987 Date Confirmation Began: Not reported Date Leak Stopped: Not reported Date Case Last Changed on Database: 2/13/1998 Date the Case was Closed: Not reported How Leak Discovered: Subsurface Monitoring How Leak Stopped: Not reported Cause of Leak: UNK Leak Source: UNK Operator: Not reported Water System: Not reported Well Name: Not reported Approx. Dist To Production Well (ft): 10341.950216908443267151511886 Source of Cleanup Funding: UNK Preliminary Site Assessment Workplan Submitted: Not reported	LUST SLIC	S101297383 N/A
TC3139641.1s Page 242 of 351			

MAP FINDINGS			
Map ID			EDR ID Number
Direction			
Distance		Database(s)	EPA ID Number
Distance (ft.)Site			
LAX FUEL (Continued)			S104891041
Substance Quantity:	Not reported		
Local Case No:	Not reported		
Case Type:	Groundwater		
Abatement Method Used at the Site:	Not reported		
Global ID:	T0603701042		
W Global ID:	Not reported		
Staff:	SLC		
Local Agency:	19050		
Cross Street:	PERSHING		
Enforcement Type:	Not reported		
Date Leak Discovered:	2/13/1987		
Date Leak First Reported:		2/13/1987	
Date Leak Record Entered:	8/13/1987		
Date Confirmation Began:	Not reported		
Date Leak Stopped:	Not reported		
Date Case Last Changed on Database:		2/13/1998	
Date the Case was Closed:		Not reported	
How Leak Discovered:	Subsurface Monitoring		
How Leak Stopped:	Not reported		
Cause of Leak:	UNK		
Leak Source:	Tank		
Operator:	Not reported		
Water System:	Not reported		
Well Name:	Not reported		
Approx. Dist To Production Well (ft):	10341.950216908443267151511886		
Source of Cleanup Funding:	Tank		
Preliminary Site Assessment Workplan Submitted:	Not reported		
Preliminary Site Assessment Began:	Not reported		
Pollution Characterization Began:	Not reported		
Remediation Plan Submitted:	Not reported		
Remedial Action Underway:	2/13/1998		
Post Remedial Action Monitoring Began:	Not reported		
Enforcement Action Date:	Not reported		
Historical Max MTBE Date:	1/1/1965		
Hist Max MTBE Conc in Groundwater:	1		
Hist Max MTBE Conc in Soil:	Not reported		
Significant Interim Remedial Action Taken:	Not reported		
GW Qualifier:	<		
Soil Qualifier:	Not reported		
Organization:	Not reported		
Owner Contact:	Not reported		
Responsible Party:	LAX FUEL CORP		
RP Address:	PO BOX 90676, LOS ANGELES, CA 90009		
Program:	SLC		
Lat/Long:	33.944248 / -1		
Local Agency Staff:	PEJ		
Beneficial Use:	Not reported		
Priority:	LOP/HIGH - KNOWN HEALTH/SAFETY/ENVIRONMENTAL IMPACT		
Cleanup Fund Id:	Not reported		
Suspended:	Not reported		
Assigned Name:	Not reported		
Summary:	SAME SITE REFER TO SLIC #303A-LAXFUEL-BFSF		
SLIC:			
Region:	STATE		
Facility Status:	Open - Remediation		
Status Date:	1998-02-13 00:00:00		
TC3139641.1s Page 244 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
	LAX FUEL CORP (Continued) Preliminary Site Assessment Began: Not reported Pollution Characterization Began: Not reported Remediation Plan Submitted: Not reported Remedial Action Underway: 2/13/1998 Post Remedial Action Monitoring Began: Not reported Enforcement Action Date: Not reported Historical Max MTBE Date: Not reported Hist Max MTBE Conc in Groundwater: Not reported Hist Max MTBE Conc in Soil: Not reported Significant Interim Remedial Action Taken: Not reported GW Qualifier: Not reported Soil Qualifier: Not reported Organization: Not reported Owner Contact: Not reported Responsible Party: LAX FUEL CORP RP Address: PO BOX 90676, LOS ANGELES, CA 90009 Program: SLC Lat/Long: 33.944248 / -1 Local Agency Staff: PEJ Beneficial Use: Not reported Priority: LOP/HIGH - KNOWN HEALTH/SAFETY/ENVIRONMENTAL IMPACT Cleanup Fund Id: Not reported Suspended: Not reported Assigned Name: Not reported Summary: SAME SITE REFER TO SLIC #303A-LAXFUEL-BFSF		S101297383
	SLIC: Region: STATE Facility Status: Open - Remediation Status Date: 1998-02-13 00:00:00 Global ID: T0603701044 Lead Agency: LOS ANGELES RWQCB (REGION 4) Lead Agency Case Number: Not reported Latitude: 33.944248 Longitude: -118.4001617 Case Type: Cleanup Program Site Case Worker: SLC Local Agency: LOS ANGELES, CITY OF RB Case Number: 900450189 File Location: Not reported Potential Media Affected: Aquifer used for drinking water supply Potential Contaminants of Concern: Other Solvent or Non-Petroleum Hydrocarbon Site History: Not reported Click here to access the California GeoTracker records for this facility:		
83	LAX FUEL 7261 WORLD WY W WESTCHESTER, CA 90045 LUST REG 4: Region: 4 Regional Board: 04 County: Los Angeles Facid: 900450161 Status: Remedial action (cleanup) Underway Substance: Hydrocarbons	LUST SLIC	S104891041 N/A
TC3139641.1s Page 243 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
	LAX FUEL (Continued) Global ID: T0603701042 Lead Agency: LOS ANGELES RWQCB (REGION 4) Lead Agency Case Number: Not reported Latitude: 33.944248 Longitude: -118.4001617 Case Type: Cleanup Program Site Case Worker: SLC Local Agency: LOS ANGELES, CITY OF RB Case Number: 900450161 File Location: Not reported Potential Media Affected: Aquifer used for drinking water supply Potential Contaminants of Concern: Other Solvent or Non-Petroleum Hydrocarbon Site History: Not reported Click here to access the California GeoTracker records for this facility:		S104891041
83	LAX FUEL 7251 WORLD WY W WESTCHESTER, CA 90045 LUST REG 4: Region: 4 Regional Board: 04 County: Los Angeles Facid: 900450207 Status: Remedial action (cleanup) Underway Substance: Hydrocarbons Substance Quantity: Not reported Local Case No: Not reported Case Type: Soil Abatement Method Used at the Site: Not reported Global ID: T0603701046 W Global ID: Not reported Staff: SLC Local Agency: 19050 Cross Street: PERSHING DR Enforcement Type: Not reported Date Leak Discovered: 8/18/1987 Date Leak First Reported: 3/22/1988 Date Leak Record Entered: 5/11/1988 Date Confirmation Began: Not reported Date Leak Stopped: Not reported Date Case Last Changed on Database: 2/13/1998 Date the Case was Closed: Not reported How Leak Discovered: Subsurface Monitoring How Leak Stopped: Not reported Cause of Leak: Not reported Leak Source: Not reported Operator: EVANS, JOE Water System: Not reported Well Name: Not reported Approx. Dist To Production Well (ft): 10341.950216908443267151511886 Source of Cleanup Funding: Not reported Preliminary Site Assessment Workplan Submitted: Not reported Preliminary Site Assessment Began: Not reported Pollution Characterization Began: 3/22/1988 Remediation Plan Submitted: Not reported Remedial Action Underway: 2/13/1998	LUST SLIC	S104891040 N/A
TC3139641.1s Page 245 of 351			

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
		EPA ID Number
LAX FUEL (Continued)		S104891040
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	1/1/1965	
Hist Max MTBE Conc in Groundwater:	1	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	<	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	ALLIED AVIATION SERVICE OF CA	
RP Address:	7251 W WORLD WY, LOS ANGELES, CA 90045	
Program:	SLIC	
Lat/Long:	33.944248 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	LOPHIGH - KNOWN HEALTH/SAFETY/ENVIRONMENTAL IMPACT	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	DISCOVERED DURING SOIL TESTING FOR MONITORING WELL JET "A" FUEL NOH ISSUED 3/22/88 FOR SITE ASSESSMENT. SAME SITE REFER TO SLIC #303A-LAXFUEL-BFSF	
SLIC:		
Region:	STATE	
Facility Status:	Open - Remediation	
Status Date:	1998-02-13 00:00:00	
Global Id:	T0603701046	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Lead Agency Case Number:	Not reported	
Latitude:	33.944248	
Longitude:	-118.4001617	
Case Type:	Cleanup Program Site	
Case Worker:	SLC	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450207	
File Location:	Not reported	
Potential Media Affected:	Soil	
Potential Contaminants of Concern:	Other Solvent or Non-Petroleum Hydrocarbon	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		

83	LAX FUEL 7253 WORLD WY W WESTCHESTER, CA 90045	LUST SLIC	S104891044 N/A
LUST REG 4:			
Region:	4		
Regional Board:	04		
County:	Los Angeles		
Facid:	900450134		
Status:	Remedial action (cleanup) Underway		
Substance:	Hydrocarbons		
Substance Quantity:	Not reported		
Local Case No:	Not reported		

TC3139641.1s Page 246 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
		EPA ID Number
LAX FUEL (Continued)		S104891044
Lead Agency Case Number:	Not reported	
Latitude:	33.944248	
Longitude:	-118.4001617	
Case Type:	Cleanup Program Site	
Case Worker:	SLC	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450134	
File Location:	Not reported	
Potential Media Affected:	Aquifer used for drinking water supply	
Potential Contaminants of Concern:	Other Solvent or Non-Petroleum Hydrocarbon	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
84		
CONTINENTAL AIRLINES INC 7300 W WORLD WY LOS ANGELES, CA 90045		LUST S109117597 N/A
LUST:		
Region:	STATE	
Global Id:	T0603714842	
Latitude:	33.941225	
Longitude:	-118.427814	
Case Type:	LUST Cleanup Site	
Status:	Open - Site Assessment	
Status Date:	2004-05-21 00:00:00	
Lead Agency:	LOS ANGELES, CITY OF	
Case Worker:	WR	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	Not reported	
LOC Case Number:	X50000234	
File Location:	Not reported	
Potential Media Affected:	Soil	
Potential Contaminants of Concern:	Gasoline	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603714842	
Contact Type:	Regional Board Caseworker	
Contact Name:	YUE RONG	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yrong@waterboards.ca.gov	
Phone Number:	Not reported	
Global Id:		
Contact Type:	Local Agency Caseworker	
Contact Name:	TBD	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 N. MAIN ST., RM. 970	
City:	LOS ANGELES	
Email:	Not reported	
Phone Number:	2139783722	

TC3139641.1s Page 248 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
		EPA ID Number
LAX FUEL (Continued)		S104891044
Case Type:	Groundwater	
Abatement Method Used at the Site:	Not reported	
Global ID:	T0603701039	
W Global ID:	Not reported	
Staff:	SLC	
Local Agency:	19050	
Cross Street:	PERSHING	
Enforcement Type:	Not reported	
Date Leak Discovered:	2/13/1987	
Date Leak First Reported:	2/13/1987	
Date Leak Record Entered:	8/14/1987	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	2/13/1998	
Date the Case was Closed:	Not reported	
How Leak Discovered:	Subsurface Monitoring	
How Leak Stopped:	Not reported	
Cause of Leak:	UNK	
Leak Source:	UNK	
Operator:	Not reported	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	10341.95021690843267151511886	
Source of Cleanup Funding:	UNK	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	Not reported	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	2/13/1998	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	1/1/1965	
Hist Max MTBE Conc in Groundwater:	1	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	<	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	LAX FUEL CORP	
RP Address:	PO BOX 90676, LOS ANGELES, CA 90009	
Program:	SLIC	
Lat/Long:	33.944248 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	LOPHIGH - KNOWN HEALTH/SAFETY/ENVIRONMENTAL IMPACT	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	SAME SITE REFER TO SLIC #303A-LAX FUEL-BFSF	
SLIC:		
Region:	STATE	
Facility Status:	Open - Remediation	
Status Date:	1998-02-13 00:00:00	
Global Id:	T0603701039	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	

TC3139641.1s Page 247 of 351

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Distance	
Distance (ft.)	Site	Database(s)	
		EPA ID Number	
CONTINENTAL AIRLINES INC (Continued)		S109117597	
LUST:			
Global Id:	T0603714842		
Action Type:	Other		
Date:	1950-01-01 00:00:00		
Action:	Leak Discovery		
Global Id:			
Action Type:	Other		
Date:	1950-01-01 00:00:00		
Action:	Leak Reported		
84			
LAX - CONTINENTAL AIRLINES MAINTENANCE FACILITY 7300 W WORLD WAY LOS ANGELES, CA 90045		LUST SLIC	S101617502 N/A
LUST REG 4:			
Region:	4		
Regional Board:	04		
County:	Los Angeles		
Facid:	0349B		
Status:	Pollution Characterization		
Substance:	Not reported		
Substance Quantity:	Not reported		
Local Case No:	Not reported		
Case Type:	Not reported		
Abatement Method Used at the Site:	Not reported		
Global ID:	T0603712840		
W Global ID:	Not reported		
Staff:	AHS		
Local Agency:	Not reported		
Cross Street:	Not reported		
Enforcement Type:	Not reported		
Date Leak Discovered:	Not reported		
Date Leak First Reported:	Not reported		
Date Leak Record Entered:	Not reported		
Date Confirmation Began:	Not reported		
Date Leak Stopped:	Not reported		
Date Case Last Changed on Database:	Not reported		
Date the Case was Closed:	Not reported		
How Leak Discovered:	Not reported		
How Leak Stopped:	Not reported		
Cause of Leak:	Not reported		
Leak Source:	Not reported		
Operator:	Not reported		
Water System:	Not reported		
Well Name:	Not reported		
Approx. Dist To Production Well (ft):	Not reported		
Source of Cleanup Funding:	Not reported		
Preliminary Site Assessment Workplan Submitted:	Not reported		
Preliminary Site Assessment Began:	Not reported		
Pollution Characterization Began:	5/13/2003		
Remediation Plan Submitted:	Not reported		
Remedial Action Underway:	Not reported		
Post Remedial Action Monitoring Began:	Not reported		
Enforcement Action Date:	Not reported		
Historical Max MTBE Date:	Not reported		

TC3139641.1s Page 249 of 351

Map ID	MAP FINDINGS	EDR ID Number
Direction		
Distance		
Distance (ft.) Site	Database(s)	EPA ID Number

LAX - CONTINENTAL AIRLINES MAINTENANCE FACILITY (Continued)

S101617502

Hist Max MTBE Conc in Groundwater: Not reported
 Hist Max MTBE Conc in Soil: Not reported
 Significant Interim Remedial Action Taken: Not reported
 GW Qualifier: Not reported
 Soil Qualifier: Not reported
 Organization: Not reported
 Owner Contact: Not reported
 Responsible Party: Not reported
 RP Address: Not reported
 Program: SLIC
 Lat/Long: 0 / 0
 Local Agency Staff: Not reported
 Beneficial Use: Not reported
 Priority: Not reported
 Cleanup Fund Id: Not reported
 Suspended: Not reported
 Assigned Name: Not reported
 Summary: VOC

SLIC:

Region: STATE
 Facility Status: Open - Site Assessment
 Status Date: 2003-05-13 00:00:00
 Global Id: T0603712840
 Lead Agency: LOS ANGELES RWQCB (REGION 4)
 Lead Agency Case Number: Not reported
 Latitude: 33.941225
 Longitude: -118.427814
 Case Type: Cleanup Program Site
 Case Worker: LM
 Local Agency: Not reported
 RB Case Number: 03498
 File Location: Not reported
 Potential Media Affected: Not reported
 Potential Contaminants of Concern: Not reported
 Site History: Site is adjacent to the Continental Airlines site. Several aboveground catch basins were located at the site. The contents of which are unknown. Groundwater monitoring conducted by Continental Airlines indicates HVOCs have been detected. Further assessment is ongoing at this time.

Click here to access the California GeoTracker records for this facility:

84 CONTINENTAL AIRLINES MAINTENANCE (FORMER)
7300 W. WORLD WY
LOS ANGELES, CASLIC S106485892
N/A

SLIC:
 Region: STATE
 Facility Status: Open - Assessment & Interim Remedial Action
 Status Date: 1994-02-04 00:00:00
 Global Id: SLT43694692
 Lead Agency: LOS ANGELES RWQCB (REGION 4)
 Lead Agency Case Number: Not reported
 Latitude: 33.940519742
 Longitude: -118.428027413
 Case Type: Cleanup Program Site

TC3139641.1s Page 250 of 351

Map ID	MAP FINDINGS	EDR ID Number
Direction		
Distance		
Distance (ft.) Site	Database(s)	EPA ID Number

CONTINENTAL AIRLINES - LOS ANGELES INTERNATIONAL AIRPORT MAINT (Continued)

1000412893

Remedial Action Underway: Not reported
 Post Remedial Action Monitoring Began: Not reported
 Enforcement Action Date: Not reported
 Historical Max MTBE Date: Not reported
 Hist Max MTBE Conc in Groundwater: Not reported
 Hist Max MTBE Conc in Soil: Not reported
 Significant Interim Remedial Action Taken: Yes
 GW Qualifier: Not reported
 Soil Qualifier: Not reported
 Organization: Not reported
 Owner Contact: Not reported
 Responsible Party: CONTINENTAL AIRLINES
 RP Address: SAME AS SITE
 Program: SLIC
 Lat/Long: 33.9417888 / -1
 Local Agency Staff: PEJ
 Beneficial Use: Not reported
 Priority: 1
 Cleanup Fund Id: Not reported
 Suspended: Not reported
 Assigned Name: Not reported
 Summary: FIRE DEPARTMENT VIOLATION ISSUED, REQUESTING SA. MOST PROBABLE CAUSE OF LEAK IS FROM PUMPS AND FILTERS. TANKS #6&7 ARE 10000 AND 25000 LEAK APPEARS TO BETWEEN BOTH DIESEL AND SOLVENT. REFER TO SLIC #349

SLIC:

Region: STATE
 Facility Status: Open - Site Assessment
 Status Date: 1998-10-24 00:00:00
 Global Id: T0603701055
 Lead Agency: LOS ANGELES RWQCB (REGION 4)
 Lead Agency Case Number: Not reported
 Latitude: 33.9417888
 Longitude: -118.4179421
 Case Type: Cleanup Program Site
 Case Worker: SLC
 Local Agency: LOS ANGELES, CITY OF
 RB Case Number: 900450325
 File Location: Not reported
 Potential Media Affected: Aquifer used for drinking water supply
 Potential Contaminants of Concern: * Solvents
 Site History: Not reported

Click here to access the California GeoTracker records for this facility:

SLIC:

Region: 4
 Facility Status: Remediation
 SLIC: 0349A
 Substance: TPH/V
 Staff: AH
 Region: 4
 Facility Status: Site Assessment
 SLIC: 0349B
 Substance: VOC

TC3139641.1s Page 252 of 351

Map ID	MAP FINDINGS	EDR ID Number
Direction		
Distance		
Distance (ft.) Site	Database(s)	EPA ID Number

CONTINENTAL AIRLINES MAINTENANCE (FORMER) (Continued)

S106485892

Case Worker: CMC
 Local Agency: Not reported
 RB Case Number: 1061A
 File Location: Regional Board
 Potential Media Affected: Not reported
 Potential Contaminants of Concern: Not reported
 Site History: Not reported

Click here to access the California GeoTracker records for this facility:

85 CONTINENTAL AIRLINES - LOS ANGELES INTERNATIONAL AIRPORT MAINT
7300 WORLD WAY WEST
LOS ANGELES, CA 90009HIST CORTESE 1000412893
LUST CAT000624692
SLIC

CORTESE:
 Region: CORTESE
 Facility County Code: 19
 Reg By: LTNKA
 Reg Id: 900450325
 LUST REG 4:
 Region: 4
 Regional Board: 04
 County: Los Angeles
 Facid: 900450325
 Status: Leak being confirmed
 Substance: Solvents
 Substance Quantity: Not reported
 Local Case No: Not reported
 Case Type: Groundwater
 Abatement Method Used at the Site: Not reported
 Global ID: T0603701055
 W Global ID: Not reported
 Staff: SLC
 Local Agency: 19050
 Cross Street: PERSHING DR
 Enforcement Type: Not reported
 Date Leak Discovered: 5/24/1988
 Date Leak First Reported: 5/24/1988
 Date Leak Record Entered: 9/11/1988
 Date Confirmation Began: 10/24/1988
 Date Leak Stopped: 5/24/1988
 Date Case Last Changed on Database: 6/26/1996
 Date the Case was Closed: Not reported
 How Leak Discovered: Tank Closure
 How Leak Stopped: Not reported
 Cause of Leak: Overfill
 Leak Source: Piping
 Operator: CONTINENTAL
 Water System: Not reported
 Well Name: Not reported
 Approx. Dist To Production Well (ft): 15789.583369485409367133188931
 Source of Cleanup Funding: Piping
 Preliminary Site Assessment Workplan Submitted: Not reported
 Preliminary Site Assessment Began: Not reported
 Pollution Characterization Began: Not reported
 Remediation Plan Submitted: Not reported

TC3139641.1s Page 251 of 351

Map ID	MAP FINDINGS	EDR ID Number
Direction		
Distance		
Distance (ft.) Site	Database(s)	EPA ID Number

CONTINENTAL AIRLINES - LOS ANGELES INTERNATIONAL AIRPORT MAINT (Continued)

1000412893

Staff: AH

85 DOUGLAS AIRCRAFT CO
7300 WORLD WAY WEST
LOS ANGELES, CA 90045SLIC S103961178
N/A

SLIC:
 Region: STATE
 Facility Status: Open - Site Assessment
 Status Date: 1994-04-01 00:00:00
 Global Id: SL184121395
 Lead Agency: LOS ANGELES RWQCB (REGION 4)
 Lead Agency Case Number: Not reported
 Latitude: 33.9411703868894
 Longitude: -118.421223163605
 Case Type: Cleanup Program Site
 Case Worker: LM
 Local Agency: Not reported
 RB Case Number: 0349A
 File Location: Regional Board
 Potential Media Affected: Not reported
 Potential Contaminants of Concern: 1,1,1-Trichloroethane (TCA), Other Solvent or Non-Petroleum Hydrocarbon, Tetrachloroethylene (PCE), Trichloroethylene (TCE), Chromium, Other Metal, Aviation
 Site History: The discharger has completed several phases of site assessment for soil, soil gas, and groundwater. The discharger reported a jet fuel release of approximately 4,000,000 gallons. In 2005 a Vacuum-Enhanced Free Product Recovery System (VEFPS) began operating to recover jet fuel. Several phases of well installation were completed and presently the VEFPRS consists of 221 recovery wells. To date approximately 800,000 gallons of jet fuel have been removed. The discharger is also assessing HVOC impacts in soil and groundwater near the northeastern edge of the jet fuel plume. Los Angeles World Airports (LAWA) is assessing an adjacent off-Site HVOC plume on the southwestern edge of the jet fuel plume. Site remediation efforts are being coordinated with LAWA.

Click here to access the California GeoTracker records for this facility:

85 7300 WORLD WAY WEST
7300 WORLD WAY WEST
LOS ANGELES, CA 90045ERNS 92297952
N/A

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

TC3139641.1s Page 253 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	Database(s)
Distance (ft.)	Site		EPA ID Number
85	AERO CALIFORNIA LAXMTO 7300 WORLD WAY WEST LOS ANGELES, CA 90045	ENVIROSTOR	S104578038 N/A
ENVIROSTOR:			
Site Type:	Tiered Permit		
Site Type Detailed:	Tiered Permit		
Acres:	Not reported		
NPL:	NO		
Regulatory Agencies:	NONE SPECIFIED		
Lead Agency:	NONE SPECIFIED		
Program Manager:	Not reported		
Supervisor:	Not reported		
Division Branch:	Cleanup Cypress		
Facility ID:	71003506		
Site Code:	Not reported		
Assembly:	53		
Senate:	28		
Special Program:	Not reported		
Status:	Refer: Other Agency		
Status Date:	Not reported		
Restricted Use:	NO		
Site Mgmt. Req.:	NONE SPECIFIED		
Funding:	Not reported		
Latitude:	33.941636199999998		
Longitude:	-118.42322679999999		
APN:	NONE SPECIFIED		
Past Use:	NONE SPECIFIED		
Potential COC:	NONE SPECIFIED		
Confirmed COC:	NONE SPECIFIED		
Potential Description:	NONE SPECIFIED		
Alias Name:	CAT000624692		
Alias Type:	EPA Identification Number		
Alias Name:	71003506		
Alias Type:	Envirostor ID Number		
Completed Info:			
Completed Area Name:	PROJECT WIDE		
Completed Sub Area Name:	Not reported		
Completed Document Type:	Phase I Verification		
Completed Date:	1997-12-18 00:00:00		
Comments:	Not reported		
Future Area Name:			
Future Sub Area Name:	Not reported		
Future Document Type:	Not reported		
Future Due Date:	Not reported		
Schedule Area Name:	Not reported		
Schedule Sub Area Name:	Not reported		
Schedule Document Type:	Not reported		
Schedule Due Date:	Not reported		
Schedule Revised Date:	Not reported		

TC3139641.1s Page 254 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	Database(s)
Distance (ft.)	Site		EPA ID Number
(Continued)			S106397682
E Date:	Not reported		
Substance:	jet fuel		
Quantity Released:	Not reported		
BBLs:	0		
Cups:	0		
CUFT:	0		
Gallons:	0.000000		
Grams:	0		
Pounds:	0		
Liters:	0		
Ounces:	0		
Pints:	0		
Quarts:	0		
Sheen:	0		
Tons:	0		
Unknown:	0		
Evacuations:	0		
Number of Injuries:	0		
Number of Fatalities:	0		
Description:	Pressure test was conducted and pressure was before acceptable rate. Pressure loss is based on a formula. One leaking butterfly valve was found.		

85 7300 WORLD WAY WEST
7300 WORLD WAY WEST
LOS ANGELES, CA 90045 ERNS 92265104
N/A

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

86 7401 WORLD WAY WEST
7401 WORLD WAY WEST
LOS ANGELES, CA 90045 ERNS 2004743695
N/A

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

86 LAX, 7401 WORLD WAY WEST
LOS ANGELES, CA 90045 CHMIRS S105668196
N/A

CHMIRS:
OES Incident Number: 00-1534
OES notification: 4/3/200004:51:40 PM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported

TC3139641.1s Page 256 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	Database(s)
Distance (ft.)	Site		EPA ID Number
85	LOS ANGELES AIRPORT 7300 WORLD WAY WEST LOS ANGELES, CA 77002	CHMIRS	S106397682 N/A
CHMIRS:			
OES Incident Number:	03-4637		
OES notification:	9/8/200305:22:26 PM		
OES Date:	Not reported		
OES Time:	Not reported		
Incident Date:	Not reported		
Date Completed:	Not reported		
Property Use:	Not reported		
Agency Id Number:	Not reported		
Agency Incident Number:	Not reported		
Time Notified:	Not reported		
Time Completed:	Not reported		
Surrounding Area:	Not reported		
Estimated Temperature:	Not reported		
Property Management:	Not reported		
Special Studies 1:	Not reported		
Special Studies 2:	Not reported		
Special Studies 3:	Not reported		
Special Studies 4:	Not reported		
Special Studies 5:	Not reported		
Special Studies 6:	Not reported		
More Than Two Substances Involved?:	Not reported		
Resp Agency Personnel # Of Decontaminated:	Not reported		
Responding Agency Personnel # Of Injuries:	Not reported		
Responding Agency Personnel # Of Fatalities:	Not reported		
Others Number Of Decontaminated:	Not reported		
Others Number Of Injuries:	Not reported		
Others Number Of Fatalities:	Not reported		
Vehicle Make/year:	Not reported		
Vehicle License Number:	Not reported		
Vehicle State:	Not reported		
Vehicle Id Number:	Not reported		
CA/DOT/PUC/ICC Number:	Not reported		
Company Name:	Not reported		
Reporting Officer Name/ID:	Not reported		
Report Date:	Not reported		
Comments:	Not reported		
Facility Telephone:	Not reported		
Waterway Involved:	No		
Waterway:	Not reported		
Spill Site:	Not reported		
Cleanup By:	Reporting Party		
Containment:	Not reported		
What Happened:	Not reported		
Type:	Not reported		
Measure:	Not reported		
Other:	Not reported		
Date/Time:	Not reported		
Year:	2003		
Agency:	Continental Airlines		
Incident Date:	9/4/200312:00:00 AM		
Admin Agency:	Los Angeles City Fire Department		
Amount:	Not reported		
Contained:	Yes		
Site Type:	Airport		

TC3139641.1s Page 255 of 351

MAP FINDINGS			EDR ID Number
Map ID	Direction	Distance	Database(s)
Distance (ft.)	Site		EPA ID Number
(Continued)			S105668196
Agency Incident Number:	Not reported		
Time Notified:	Not reported		
Time Completed:	Not reported		
Surrounding Area:	Not reported		
Estimated Temperature:	Not reported		
Property Management:	Not reported		
Special Studies 1:	Not reported		
Special Studies 2:	Not reported		
Special Studies 3:	Not reported		
Special Studies 4:	Not reported		
Special Studies 5:	Not reported		
Special Studies 6:	Not reported		
More Than Two Substances Involved?:	Not reported		
Resp Agency Personnel # Of Decontaminated:	Not reported		
Responding Agency Personnel # Of Injuries:	Not reported		
Responding Agency Personnel # Of Fatalities:	Not reported		
Others Number Of Decontaminated:	Not reported		
Others Number Of Injuries:	Not reported		
Others Number Of Fatalities:	Not reported		
Vehicle Make/year:	Not reported		
Vehicle License Number:	Not reported		
Vehicle State:	Not reported		
Vehicle Id Number:	Not reported		
CA/DOT/PUC/ICC Number:	Not reported		
Company Name:	Not reported		
Reporting Officer Name/ID:	Not reported		
Report Date:	Not reported		
Comments:	Not reported		
Facility Telephone:	Not reported		
Waterway Involved:	No		
Waterway:	Not reported		
Spill Site:	Not reported		
Cleanup By:	Reporting Party		
Containment:	Not reported		
What Happened:	Not reported		
Type:	Not reported		
Measure:	Not reported		
Other:	Not reported		
Date/Time:	Not reported		
Year:	2000		
Agency:	Federal Express		
Incident Date:	4/3/200012:00:00 AM		
Admin Agency:	Los Angeles City Fire Department		
Amount:	Not reported		
Contained:	Yes		
Site Type:	Airport		
E Date:	Not reported		
Substance:	jet fuel		
Quantity Released:	Not reported		
BBLs:	0		
Cups:	0		
CUFT:	0		
Gallons:	30-40		
Grams:	0		
Pounds:	0		
Liters:	0		
Ounces:	0		

TC3139641.1s Page 257 of 351

MAP FINDINGS		
Map ID		EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number
(Continued)		
Pints:	0	S105668196
Quarts:	0	
Sheen:	0	
Tons:	0	
Unknown:	0	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	Caused by a malfunction of a valve on an aircraft. Released in the aircraft hanger on a concrete slab.	

86	7401 WORLD WAY WEST LOS ANGELES, CA	CHMIRS	S107450699 N/A
CHMIRS:			
OES Incident Number:	04-6423		
OES notification:	12/9/200401:31:24 AM		
OES Date:	Not reported		
OES Time:	Not reported		
Incident Date:	Not reported		
Date Completed:	Not reported		
Property Use:	Not reported		
Agency Id Number:	Not reported		
Agency Incident Number:	Not reported		
Time Notified:	Not reported		
Time Completed:	Not reported		
Surrounding Area:	Not reported		
Estimated Temperature:	Not reported		
Property Management:	Not reported		
Special Studies 1:	Not reported		
Special Studies 2:	Not reported		
Special Studies 3:	Not reported		
Special Studies 4:	Not reported		
Special Studies 5:	Not reported		
Special Studies 6:	Not reported		
More Than Two Substances Involved?:	Not reported		
Resp Agency Personnel # Of Decontaminated:	Not reported		
Responding Agency Personnel # Of Injuries:	Not reported		
Responding Agency Personnel # Of Fatalities:	Not reported		
Others Number Of Decontaminated:	Not reported		
Others Number Of Injuries:	Not reported		
Others Number Of Fatalities:	Not reported		
Vehicle Make/year:	Not reported		
Vehicle License Number:	Not reported		
Vehicle State:	Not reported		
Vehicle Id Number:	Not reported		
CA/DOT/PUC/ICC Number:	Not reported		
Company Name:	Not reported		
Reporting Officer Name/ID:	Not reported		
Report Date:	Not reported		
Comments:	Not reported		
Facility Telephone:	Not reported		
Waterway Involved:	Not reported		
Waterway:	STORM DRAIN		
Spill Site:	Not reported		
Cleanup By:	Reporting Party		
Containment:	Not reported		

TC3139641.1s Page 258 of 351

MAP FINDINGS		
Map ID		EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number
86	FEDERAL EXPRESS CORPORATION 7401 WORLD WAY WEST LOS ANGELES, CA 90009	CHMIRS S103671008 N/A

CHMIRS:

OES Incident Number: 015745

OES notification: Not reported

OES Date: 9/28/1996

OES Time: 12:53:01 AM

Incident Date: Not reported

Date Completed: Not reported

Property Use: Not reported

Agency Id Number: Not reported

Agency Incident Number: Not reported

Time Notified: Not reported

Time Completed: Not reported

Surrounding Area: Not reported

Estimated Temperature: Not reported

Property Management: Not reported

Special Studies 1: Not reported

Special Studies 2: Not reported

Special Studies 3: Not reported

Special Studies 4: Not reported

Special Studies 5: Not reported

Special Studies 6: Not reported

More Than Two Substances Involved?: Not reported

Resp Agency Personnel # Of Decontaminated: Not reported

Responding Agency Personnel # Of Injuries: Not reported

Responding Agency Personnel # Of Fatalities: Not reported

Others Number Of Decontaminated: Not reported

Others Number Of Injuries: Not reported

Others Number Of Fatalities: Not reported

Vehicle Make/year: Not reported

Vehicle License Number: Not reported

Vehicle State: Not reported

Vehicle Id Number: Not reported

CA/DOT/PUC/ICC Number: Not reported

Company Name: Not reported

Reporting Officer Name/ID: Not reported

Report Date: Not reported

Comments: Not reported

Facility Telephone: Not reported

Waterway Involved: NO

Waterway: storm drain to water separator

Spill Site: Not reported

Cleanup By: on scene agency and r/p

Containment: Not reported

What Happened: Not reported

Type: PETROLEUM

Measure: Not reported

Other: Not reported

Date/Time: Not reported

Year: 1996

Agency: Fed Express

Incident Date: 2246 9/27/96

Admin Agency: Not reported

Amount: 50 to 70 gal

Contained: YES

Site Type: Not reported

TC3139641.1s Page 260 of 351

MAP FINDINGS		
Map ID		EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number
(Continued)		
What Happened:	Not reported	S107450699
Type:	Not reported	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	2004	
Agency:	NRC	
Incident Date:	12/9/200412:00:00 AM	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	Yes	
Site Type:	Merchant/Business	
E Date:	Not reported	
Substance:	JET FUEL: JP-8	
Quantity Released:	Not reported	
BBLs:	0	
Cups:	0	
CUFT:	0	
Gallons:	20	
Grams:	0	
Pounds:	0	
Liters:	0	
Ounces:	0	
Pints:	0	
Quarts:	0	
Sheen:	0	
Tons:	0	
Unknown:	0	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	CALLER REPORTING WHILE DEFUELING AN AIRCRAFT THE TRUCK OVERFLOWED DUE TO OPERATOR ERROR	

86	7401 WORLD WAY WEST 7401 WORLD WAY WEST LOS ANGELES, CA 90274	ERNS	96508927 N/A
----	---	------	-----------------

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

86	7401 WORLD WAY WEST 7401 WORLD WAY WEST LOS ANGELES, CA 0	ERNS	2000542888 N/A
----	---	------	-------------------

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

TC3139641.1s Page 259 of 351

MAP FINDINGS		
Map ID		EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number
FEDERAL EXPRESS CORPORATION (Continued)		
E Date:	Not reported	S103671008
Substance:	jp 4	
Quantity Released:	Not reported	
BBLs:	Not reported	
Cups:	Not reported	
CUFT:	Not reported	
Gallons:	Not reported	
Grams:	Not reported	
Pounds:	Not reported	
Liters:	Not reported	
Ounces:	Not reported	
Pints:	Not reported	
Quarts:	Not reported	
Sheen:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	
Evacuations:	NO	
Number of Injuries:	NO	
Number of Fatalities:	NO	
Description:	malfunction in aircraft released vent box fuel to overflow	
OES Incident Number:	02-3567	
OES notification:	6/30/200212:17:17 PM	
OES Date:	Not reported	
OES Time:	Not reported	
Incident Date:	Not reported	
Date Completed:	Not reported	
Property Use:	Not reported	
Agency Id Number:	Not reported	
Agency Incident Number:	Not reported	
Time Notified:	Not reported	
Time Completed:	Not reported	
Surrounding Area:	Not reported	
Estimated Temperature:	Not reported	
Property Management:	Not reported	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	Not reported	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DOT/PUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	

TC3139641.1s Page 261 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
FEDERAL EXPRESS CORPORATION (Continued)		S103671008
Facility Telephone:	Not reported	
Waterway Involved:	No	
Waterway:	Not reported	
Spill Site:	Not reported	
Cleanup By:	Reporting Party	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	2002	
Agency:	Federal Express	
Incident Date:	6/30/2002 12:00:00 AM	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	Yes	
Site Type:	Airport	
E Date:	Not reported	
Substance:	Fuel JP 8	
Quantity Released:	Not reported	
BBLs:	0	
Cups:	0	
CUFF:	0	
Gallons:	30	
Grams:	0	
Pounds:	0	
Liters:	0	
Ounces:	0	
Pints:	0	
Quarts:	0	
Sheen:	0	
Tons:	0	
Unknown:	0	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	Substance was release from fuel line on number Two Engine, after turning on fuel pump.	

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
86 7401 WORLD WAY WEST FEDERAL EXPRESS BLDG LA, CA 90009		CHMIRS S105633460 N/A
CHMIRS:		
OES Incident Number:	4685	
OES notification:	Not reported	
OES Date:	10/14/1994	
OES Time:	02:57:39 PM	
Incident Date:	Not reported	
Date Completed:	Not reported	
Property Use:	Not reported	
Agency Id Number:	Not reported	
Agency Incident Number:	Not reported	
Time Notified:	Not reported	
Time Completed:	Not reported	
Surrounding Area:	Not reported	
Estimated Temperature:	Not reported	

TC3139641.1s Page 262 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S105633460
Evacuations:	NO	
Number of Injuries:	NO	
Number of Fatalities:	NO	
Description:	DRAIN HOSE CAME LOOSE	
87 TERMINAL 6 LAX 600 WORLD WY WESTCHESTER, CA 90045		
HIST CORTSE S101297377 LUST N/A		
CORTSE:		
Region:	CORTSE	
Facility County Code:	19	
Reg By:	LTNKA	
Reg Id:	900450616	
LUST:		
Region:	STATE	
Global Id:	T0603701077	
Latitude:	33.944248	
Longitude:	-118.4001617	
Case Type:	LUST Cleanup Site	
Status:	Open - Site Assessment	
Status Date:	1987-06-03 00:00:00	
Lead Agency:	LOS ANGELES, CITY OF	
Case Worker:	ML	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450616	
LOC Case Number:	Not reported	
File Location:	Not reported	
Potential Media Affect:	Soil	
Potential Contaminants of Concern:	Aviation	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603701077	
Contact Type:	Regional Board Caseworker	
Contact Name:	YUE RONG	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yrong@waterboards.ca.gov	
Phone Number:	Not reported	
Global Id:	T0603701077	
Contact Type:	Local Agency Caseworker	
Contact Name:	MARCUS LOOK	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 N. MAIN ST. RM. 970	
City:	LOS ANGELES	
Email:	Not reported	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603701077	
Action Type:	Other	

TC3139641.1s Page 264 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
(Continued)		S105633460
Property Management:	Not reported	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?	Not reported	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/Year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DOT/PUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	YES	
Waterway:	Not reported	
Spill Site:	Not reported	
Cleanup By:	FEDERAL EXPRESS	
Containment:	Not reported	
What Happened:	Not reported	
Type:	PETROLEUM	
Measure:	Not reported	
Other:	Not reported	
Date/Time:	Not reported	
Year:	1994	
Agency:	FEDERAL EXPRESS	
Incident Date:	0915 10/14 94	
Admin Agency:	Not reported	
Amount:	30 GAL	
Contained:	NO	
Site Type:	IND PLT	
E Date:	Not reported	
Substance:	JET A FUEL	
Quantity Released:	Not reported	
BBLs:	Not reported	
Cups:	Not reported	
CUFF:	Not reported	
Gallons:	Not reported	
Grams:	Not reported	
Pounds:	Not reported	
Liters:	Not reported	
Ounces:	Not reported	
Pints:	Not reported	
Quarts:	Not reported	
Sheen:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	

TC3139641.1s Page 263 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
TERMINAL 6 LAX (Continued)		S101297377
Date:	1950-01-01 00:00:00	
Action:	Leak Stopped	
Global Id:	T0603701077	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603701077	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	900450616	
Status:	Leak being confirmed	
Substance:	1	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Soil	
Abatement Method Used at the Site:	Not reported	
Global ID:	T0603701077	
W Global ID:	Not reported	
Staff:	UNK	
Local Agency:	19050	
Cross Street:	SEPULVEDA	
Enforcement Type:	Not reported	
Date Leak Discovered:	6/3/1987	
Date Leak First Reported:	6/3/1987	
Date Leak Record Entered:	8/13/1987	
Date Confirmation Began:	6/3/1987	
Date Leak Stopped:	6/3/1987	
Date Case Last Changed on Database:	6/3/1987	
Date the Case was Closed:	Not reported	
How Leak Discovered:	OM	
How Leak Stopped:	Not reported	
Cause of Leak:	Structure Failure	
Leak Source:	Other Source	
Operator:	OLD CASENO WAS 005039	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	10341 950216908443267151511886	
Source of Cleanup Funding:	Other Source	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	Not reported	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	

TC3139641.1s Page 265 of 351

Map ID	Direction	Distance	Distance (ft.) Site	MAP FINDINGS	EDR ID Number	Database(s)	EPA ID Number
				TERMINAL 6 LAX (Continued)	S101297377		
				Significant Interim Remedial Action Taken:	Not reported		
				GW Qualifier:	Not reported		
				Soil Qualifier:	Not reported		
				Organization:	Not reported		
				Owner Contact:	Not reported		
				Responsible Party:	SWINERTON & WALBERS CONTRACTOR		
				RP Address:	600 WORLD WY, LOS ANGELES, CA 90045		
				Program:	LUST		
				Lat/Long:	33.944248 / -1		
				Local Agency Staff:	PEJ		
				Beneficial Use:	Not reported		
				Priority:	Not reported		
				Cleanup Fund Id:	Not reported		
				Suspended:	Not reported		
				Assigned Name:	Not reported		
				Summary:	Not reported		

87	600 WORLD WAY TERMINAL 6 LOS ANGELES, CA 90045	CHMIRS	S110420417 N/A
	CHMIRS:		
	OES Incident Number:	108-3201	
	OES notification:	5/2/2008 10:01:04 AM	
	OES Date:	Not reported	
	OES Time:	Not reported	
	Incident Date:	Not reported	
	Date Completed:	Not reported	
	Property Use:	Not reported	
	Agency Id Number:	Not reported	
	Agency Incident Number:	Not reported	
	Time Notified:	Not reported	
	Time Completed:	Not reported	
	Surrounding Area:	Not reported	
	Estimated Temperature:	Not reported	
	Property Management:	Not reported	
	Special Studies 1:	Not reported	
	Special Studies 2:	Not reported	
	Special Studies 3:	Not reported	
	Special Studies 4:	Not reported	
	Special Studies 5:	Not reported	
	Special Studies 6:	Not reported	
	More Than Two Substances Involved?:	Not reported	
	Resp Agency Personnel # Of Decontaminated:	Not reported	
	Responding Agency Personnel # Of Injuries:	Not reported	
	Responding Agency Personnel # Of Fatalities:	Not reported	
	Others Number Of Decontaminated:	Not reported	
	Others Number Of Injuries:	Not reported	
	Others Number Of Fatalities:	Not reported	
	Vehicle Make/year:	Not reported	
	Vehicle License Number:	Not reported	
	Vehicle State:	Not reported	
	Vehicle Id Number:	Not reported	
	CA/DOT/PUC/ICC Number:	Not reported	
	Company Name:	Not reported	
	Reporting Officer Name/ID:	Not reported	
	Report Date:	Not reported	
	Comments:	Not reported	

TC3139641.1s Page 266 of 351

Map ID	Direction	Distance	Distance (ft.) Site	MAP FINDINGS	EDR ID Number	Database(s)	EPA ID Number
				LAX FUEL (Continued)	S104891045		
				Local Agency:	19050		
				Cross Street:	PERSHING		
				Enforcement Type:	Not reported		
				Date Leak Discovered:	9/23/1988		
				Date Leak First Reported:	9/23/1988		
				Date Leak Record Entered:	12/9/1991		
				Date Confirmation Began:	Not reported		
				Date Leak Stopped:	Not reported		
				Date Case Last Changed on Database:	2/13/1998		
				Date the Case was Closed:	Not reported		
				How Leak Discovered:	OM		
				How Leak Stopped:	Not reported		
				Cause of Leak:	Not reported		
				Leak Source:	Other Source		
				Operator:	INTERNATIONAL FUELS CORP.		
				Water System:	Not reported		
				Well Name:	Not reported		
				Approx. Dist To Production Well (ft):	18471.297885018441275031955915		
				Source of Cleanup Funding:	Other Source		
				Preliminary Site Assessment Workplan Submitted:	Not reported		
				Preliminary Site Assessment Began:	Not reported		
				Pollution Characterization Began:	Not reported		
				Remediation Plan Submitted:	Not reported		
				Remedial Action Underway:	2/13/1998		
				Post Remedial Action Monitoring Began:	Not reported		
				Enforcement Action Date:	Not reported		
				Historical Max MTBE Date:	1/1/1995		
				Hist Max MTBE Conc in Groundwater:	1		
				Hist Max MTBE Conc in Soil:	Not reported		
				Significant Interim Remedial Action Taken:	Not reported		
				GW Qualifier:	<		
				Soil Qualifier:	Not reported		
				Organization:	Not reported		
				Owner Contact:	Not reported		
				Responsible Party:	INTERNATIONAL FUELS CORP.		
				RP Address:	320 WILSHIRE BLVD, SANTA MONICA, 90401		
				Program:	SLIC		
				Lat/Long:	33.9413966 / -1		
				Local Agency Staff:	PEJ		
				Beneficial Use:	Not reported		
				Priority:	LOF/HIGH - KNOWN HEALTH/SAFETY/ENVIRONMENTAL IMPACT		
				Cleanup Fund Id:	Not reported		
				Suspended:	Not reported		
				Assigned Name:	Not reported		
				Summary:	RUN OFF HOSE FROM SEPARATOR DISCHARGED JET "A" FUEL INTO - GROUND- VISIBLE LEAKS FROM FILTER #3 FAIL PRECISION TEST - PIPES NOH #039042 ISSUED FOR SITE ASSESSMENT REFER TO SLIC #303A - LAX FUEL-BFSF		

SLIC:

Region: STATE

Facility Status: Open - Remediation

Status Date: 1998-02-13 00:00:00

Global Id: T0603701047

Lead Agency: LOS ANGELES RWQCB (REGION 4)

Lead Agency Case Number: Not reported

Latitude: 33.9413966

TC3139641.1s Page 268 of 351

Map ID	Direction	Distance	Distance (ft.) Site	MAP FINDINGS	EDR ID Number	Database(s)	EPA ID Number
				(Continued)	S110420417		
				Facility Telephone:	Not reported		
				Waterway Involved:	No		
				Waterway:	Not reported		
				Spill Site:	Airport		
				Cleanup By:	Responsible Party		
				Containment:	Not reported		
				What Happened:	Not reported		
				Type:	Not reported		
				Measure:	Gall(s)		
				Other:	Not reported		
				Date/Time:	0930		
				Year:	2008		
				Agency:	Continental Airlines		
				Incident Date:	5/1/2008		
				Admin Agency:	Los Angeles City Fire Department		
				Amount:	Not reported		
				Contained:	Yes		
				Site Type:	Not reported		
				E Date:	Not reported		
				Substance:	Jet Fuel A		
				Quantity Released:	15		
				BBLs:	Not reported		
				Cups:	Not reported		
				CUFT:	Not reported		
				Gallons:	Not reported		
				Grams:	Not reported		
				Pounds:	Not reported		
				Liters:	Not reported		
				Ounces:	Not reported		
				Pints:	Not reported		
				Quarts:	Not reported		
				Sheen:	Not reported		
				Tons:	Not reported		
				Unknown:	Not reported		
				Evacuations:	0		
				Number of Injuries:	0		
				Number of Fatalities:	0		
				Description:	RP States: The fuel filter on a refueling truck was loose and caused the release.		

88	LAX FUEL 7451 WORLD WY W WESTCHESTER, CA 90045	LUST	S104891045 N/A
	LUST REG 4:		
	Region:	4	
	Regional Board:	04	
	County:	Los Angeles	
	Facid:	900450216	
	Status:	Remedial action (cleanup) Underway	
	Substance:	Hydrocarbons	
	Substance Quantity:	Not reported	
	Local Case No:	Not reported	
	Case Type:	Groundwater	
	Abatement Method Used at the Site:	Not reported	
	Global ID:	T0603701047	
	W Global ID:	Not reported	
	Staff:	SLC	

TC3139641.1s Page 267 of 351

Map ID	Direction	Distance	Distance (ft.) Site	MAP FINDINGS	EDR ID Number	Database(s)	EPA ID Number
				LAX FUEL (Continued)	S104891045		
				Longitude:	-118.4268713		
				Case Type:	Cleanup Program Site		
				Case Worker:	SLC		
				Local Agency:	LOS ANGELES, CITY OF		
				RB Case Number:	900450216		
				File Location:	Not reported		
				Potential Media Affected:	Aquifer used for drinking water supply		
				Potential Contaminants of Concern:	Other Solvent or Non-Petroleum Hydrocarbon		
				Site History:	Not reported		
				Click here to access the California GeoTracker records for this facility:			

88	INTERNATIONAL FUELS CORP 7451 WORLD LOS ANGELES, CA 90004	HIST CORTESE	S101297387 N/A
	CORTESE:		
	Region:	CORTESE	
	Facility County Code:	19	
	Reg By:	LTNKA	
	Reg Id:	900450216	

89	10501 LA CIENEGA INGLEWOOD, CA	HMIRS	91060156 N/A
	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.		

90	11001 AVIATION BLVD. LA CA 11001 AVIATION BLVD. LA CA LOS ANGELES, CA	HMIRS	2005700050 N/A
	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.		

91	11105 LA CIENEGA PROPERTIES 11105 S. LA CIENEGA BLVD. LOS ANGELES, CA 90045	SLIC	S107473129 N/A
	SLIC:		
	Region:	STATE	
	Facility Status:	Open - Site Assessment	
	Status Date:	2006-09-02 00:00:00	
	Global Id:	SL0603709431	
	Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
	Lead Agency Case Number:	Not reported	
	Latitude:	33.934159	

TC3139641.1s Page 269 of 351

Map ID	MAP FINDINGS	EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

11105 LA CIENEGA PROPERTIES (Continued)**S107473129**

Longitude: -118.37078
Case Type: Cleanup Program Site
Case Worker: SH
Local Agency: Not reported
RB Case Number: 1125B
File Location: Regional Board
Potential Media Affected: Other Groundwater (uses other than drinking water), Soil, Soil Vapor
Potential Contaminants of Concern: Tetrachloroethylene (PCE), Trichloroethylene (TCE)
Site History: The property at 11105 S. LA Cienega Blvd. (Site) was occupied by Hughes Aircraft Company (Hughes) from 1957 to 1988, and operated the Microwave Tube and Radar System Divisions. Hughes operations involved the use of spray booths, exterior chemical storage rooms, acid waste tank, and chemical mixing room. From 1958 to 1967, Hughes operated an underground storage tank (UST) with waste solvent, and was removed in 1967. In 1991, the Site's buildings were demolished and two new ones built, which are currently occupied by air freight companies for office and warehouse use. Site investigations started in 1990. Soil vapor, soil, and groundwater is impacted with mostly trichloroethylene (TCE), and tetrachloroethylene (PCE). Off-Site investigation is on-going to further evaluate the extent of volatile organic compounds (VOCs) in groundwater. A pilot test for a soil vapor extraction system, and groundwater pump tests are scheduled for the Summer/Fall of 2010.

Click here to access the California GeoTracker records for this facility:

92	11101 AVIATION AVE LOS ANGELES, CA	HMIRS	94060863 N/A
----	---------------------------------------	-------	-----------------

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

92	11101 SOUTH AVIATION BLVD. LOS ANGELES, CA	CHMIRS	S105649404 N/A
----	---	--------	-------------------

CHMIRS:
OES Incident Number: 97-3539
OES notification: 9/10/199707:15:29 AM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported

TC3139641.1s Page 270 of 351

Map ID	MAP FINDINGS	EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

(Continued)

Description: While unloading from trucks packing was ruptured

S105649404

93	RICHARD K. SQUIRE TRUST 11100 HINDRY AVENUE LOS ANGELES, CA 90045	SLIC	S107473169 N/A
----	---	------	-------------------

SLIC:
Region: STATE
Facility Status: Open - Site Assessment
Status Date: 2005-12-08 00:00:00
Global Id: SL0603739567
Lead Agency: LOS ANGELES RWQCB (REGION 4)
Lead Agency Case Number: Not reported
Latitude: 33.934215
Longitude: -118.371814
Case Type: Cleanup Program Site
Case Worker: SH
Local Agency: Not reported
RB Case Number: 1125C
File Location: Regional Board
Potential Media Affected: Other Groundwater (uses other than drinking water), Soil, Soil Vapor, Under Investigation
Potential Contaminants of Concern: Tetrachloroethylene (PCE), Trichloroethylene (TCE)
Site History: The property at 11100 Hindry Avenue (Site) was occupied from the mid 1950's to 1972 by Hughes Aircraft Company as a machine shop to manufacture aircraft parts. In 1972 the existing building was subdivided for office/warehouse use, and is currently occupied by an air freight company and a print shop. Site investigations started in 1999. The soil vapor, soil and groundwater beneath the Site is impacted with Trichloroethylene (TCE) and Tetrachloroethylene (PCE). Off-Site investigation is on-going for further delineation of the volatile organic compounds (VOCs) in groundwater.

Click here to access the California GeoTracker records for this facility:

94	11101 S AVIATION BLVD 11101 S AVIATION BLVD LOS ANGELES, CA 90045	ERNS	92273611 N/A
----	---	------	-----------------

Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.

95	11221 S HINDRY AVE LOS ANGELES, CA	HMIRS	2003121774 N/A
----	---------------------------------------	-------	-------------------

Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

TC3139641.1s Page 272 of 351

Map ID	MAP FINDINGS	EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

(Continued)**S105649404**

Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personnel # Of Decontaminated: Not reported
Responding Agency Personnel # Of Injuries: Not reported
Responding Agency Personnel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Comments: Not reported
Facility Telephone: Not reported
Waterway Involved: No
Waterway: Not reported
Spill Site: Not reported
Cleanup By: Contractor
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Date/Time: Not reported
Year: 1997
Agency: Los Angeles City Fire Dept
Incident Date: 9/8/199712:00:00 AM
Admin Agency: Los Angeles City Fire Department
Amount: Not reported
Contained: Unknown
Site Type: Airport
E Date: Not reported
Substance: Benzoguinone
Quantity Released: Not reported
BBLs: 0
Cups: 0
CUFT: 0
Gallons: 0.000000
Grams: 0
Pounds: 5
Liters: 0
Ounces: 0
Pints: 0
Quarts: 0
Sheen: 0
Tons: 0
Unknown: 0
Evacuations: 0
Number of Injuries: 0
Number of Fatalities: 0

TC3139641.1s Page 271 of 351

Map ID	MAP FINDINGS	EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

95	WATCH HOLDINGS, LLC 11200 HINDRY AVENUE LOS ANGELES, CA 90045	SLIC	S106487326 N/A
----	---	------	-------------------

SLIC:
Region: STATE
Facility Status: Open - Site Assessment
Status Date: 2003-08-14 00:00:00
Global Id: SL0603730784
Lead Agency: LOS ANGELES RWQCB (REGION 4)
Lead Agency Case Number: Not reported
Latitude: 33.933316
Longitude: -118.371356
Case Type: Cleanup Program Site
Case Worker: SH
Local Agency: Not reported
RB Case Number: 1125A1
File Location: Regional Board
Potential Media Affected: Other Groundwater (uses other than drinking water), Soil, Soil Vapor
Potential Contaminants of Concern: Other Solvent or Non-Petroleum Hydrocarbon, Tetrachloroethylene (PCE), Trichloroethylene (TCE)
Site History: The property located at 11200 Hindry Avenue (Site) was occupied in the early 1960's by Pastushin Industries in the manufacturing of wing fuel tanks for aircrafts, and used/stored chlorinated solvents. Later, the Site was occupied from 1965 to 1991 by Hughes Aircraft for office space and assembly of radar equipment, and used/stored chlorinated solvents. In 1991, the former building was demolished and three new buildings were built, and currently occupied are by offices, freight transportation services companies, and other commercial businesses. Soil vapor, soil and groundwater is impacted with volatile organic compounds (VOCs), mostly trichloroethylene (TCE) and 1,2-dichloroethane (1,2-DCA). Off-Site investigation is on-going for the delineation of the VOCs plume in soil and groundwater.

Click here to access the California GeoTracker records for this facility:

95	WATCH HOLDINGS, LLC/RAYTHEON COMPANY 11200 HINDRY AVENUE LOS ANGELES, CA 90045	SLIC	S107620010 N/A
----	--	------	-------------------

SLIC:
Region: STATE
Facility Status: Open - Site Assessment
Status Date: 2003-08-14 00:00:00
Global Id: SL0603712744
Lead Agency: LOS ANGELES RWQCB (REGION 4)
Lead Agency Case Number: Not reported
Latitude: 33.933316
Longitude: -118.371356
Case Type: Cleanup Program Site
Case Worker: SH
Local Agency: Not reported
RB Case Number: 1125A2
File Location: Regional Board
Potential Media Affected: Other Groundwater (uses other than drinking water), Soil, Soil Vapor
Potential Contaminants of Concern: Other Solvent or Non-Petroleum Hydrocarbon, Tetrachloroethylene (PCE), Trichloroethylene (TCE)
Site History: The property located at 11200 Hindry Avenue (Site) was occupied in the early 1960's by Pastushin Industries in the manufacturing of wing fuel tanks for aircrafts, and used/stored chlorinated solvents.

TC3139641.1s Page 273 of 351

MAP FINDINGS			
Map ID Direction Distance Distance (ft.)Site	Database(s)	EDR ID Number EPA ID Number	
WATCH HOLDINGS, LLC/RAYTHEON COMPANY (Continued)			
		S107620010	
Later, the Site was occupied from 1965 to 1991 by Hughes Aircraft for office space and assembly of radar equipment, and used/stored chlorinated solvents. In 1991, the former building at the Site was demolished, and three new buildings were built and currently occupied by offices, freight transportation services companies, and other commercial businesses. Soil vapor, soil and groundwater is impacted with volatile organic compounds (VOCs), mostly trichloroethylene (TCE) and 1,2-dichloroethane (1,2-DCA). Off-Site investigation is on-going for the delineation of the VOCs plume in soil and groundwater.			
Click here to access the California GeoTracker records for this facility:			
<hr/>			
95	WATCH HOLDINGS, LLC 11200 HINDRY LOS ANGELES, CA 90045	SLIC S106023330 N/A	
SLIC: Region: 4 Facility Status: Site Assessment SLIC: 1125 Substance: TCE Staff: Rebecca Chou			
<hr/>			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS 200114270 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS 2002034048 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS 200114915 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
TC3139641.1s Page 274 of 351			

MAP FINDINGS			
Map ID Direction Distance Distance (ft.)Site	Database(s)	EDR ID Number EPA ID Number	
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS 20017848 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS 200114913 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS 2001040608 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS 200113404 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS 2001244 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
TC3139641.1s Page 276 of 351			

MAP FINDINGS			
Map ID Direction Distance Distance (ft.)Site	Database(s)	EDR ID Number EPA ID Number	
96	5927 IMPERIAL HWY LOS ANGELES, CA	HMIRS 97050595 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS 2002044775 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS 20018047 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS 2002045455 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS 20018654 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
TC3139641.1s Page 275 of 351			

MAP FINDINGS			
Map ID Direction Distance Distance (ft.)Site	Database(s)	EDR ID Number EPA ID Number	
96	5927 W IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS 2001040613 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS 200113457 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS 200113456 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS 200113403 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
96	5927 W. IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS 97030451 N/A	
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
<hr/>			
TC3139641.1s Page 277 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance (ft.)	Site	Database(s)	EPA ID Number
96	5927 IMPERIAL HWY LOS ANGELES, CA	HMIRS	97031231 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	20017347 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	20017009 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	20016166 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	20017021 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance (ft.)	Site	Database(s)	EPA ID Number
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	20014897 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	2002078442 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2002045465 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	97071218 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2002081628 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance (ft.)	Site	Database(s)	EPA ID Number
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	20016796 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9900008441 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HWY 5927 W. IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2010110011 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	95020440 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2010110630 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance (ft.)	Site	Database(s)	EPA ID Number
96	5927 W IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	97061019 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	95110988 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	20014896 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	20014898 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	20014968 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2008433878 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	9990081514 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2001010094 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2008436476 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 IMPERIAL HWY LOS ANGELES, CA	HMIRS	94061340 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
TC3139641.1s Page 282 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	2003126480 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2003129839 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2003135212 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2001030674 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2004050789 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
TC3139641.1s Page 284 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2008440495 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2008431775 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2008443650 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	94120953 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2001010105 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
TC3139641.1s Page 283 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	2005010254 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	97071219 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	9990091656 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HWY LOS ANGELES, CA	HMIRS	2004060296 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	20011909 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
TC3139641.1s Page 285 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance (ft.)	Site	Database(s)	EPA ID Number
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	9611037711 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2002083557 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	20011906 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	200116066 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	9611037710 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance (ft.)	Site	Database(s)	EPA ID Number
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2005704034 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2007435412 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2001011278 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2005708630 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2007438365 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance (ft.)	Site	Database(s)	EPA ID Number
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	20014895 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 IMPERIAL HWY LOS ANGELES, CA	HMIRS	96120254 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	20011195 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2001011255 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2007433261 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance (ft.)	Site	Database(s)	EPA ID Number
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2007437526 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2007439661 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HIGHWAY 5927 W. IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2007445398 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HWY. 5927 W. IMPERIAL HWY. LOS ANGELES, CA 90045	HMIRS	2010107495 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2000100400 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
96	5927 W IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2000100401 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HWY. LOS ANGELES, CA	HMIRS	2000080989 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2000080812 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9999061506 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2000028614 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
TC3139641.1s Page 290 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
96	5927 IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9999030561 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2008447048 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2000028612 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	94030405 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HWY 5927 W. IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2009046671 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
TC3139641.1s Page 292 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	2000080388 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9999071400 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9999050312 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HWY LOS ANGELES, CA	HMIRS	9999072018 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2000028613 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
TC3139641.1s Page 291 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2000028611 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HWY 5927 W. IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2009046729 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2008444713 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HWY 5927 W. IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2009046754 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HWY 5927 W. IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2009047158 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
TC3139641.1s Page 293 of 351			

MAP FINDINGS			
Map ID Direction Distance Distance (ft.)Site	Database(s)	EDR ID Number EPA ID Number	
96 5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2009050133 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	97100161 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2009057801 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2009051928 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	2000023728 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

MAP FINDINGS			
Map ID Direction Distance Distance (ft.)Site	Database(s)	EDR ID Number EPA ID Number	
96 5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	94050916 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	9998120596 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	2000023720 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2000120658 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9998110101 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

MAP FINDINGS			
Map ID Direction Distance Distance (ft.)Site	Database(s)	EDR ID Number EPA ID Number	
96 5927 W. IMPERIAL HWY 5927 W. IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2009058337 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	9999072028 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	9999010314 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2009058395 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9998120867 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

MAP FINDINGS			
Map ID Direction Distance Distance (ft.)Site	Database(s)	EDR ID Number EPA ID Number	
96 5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	9998090940 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	2000023727 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	9998090939 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 IMPERIAL HWY LOS ANGELES, CA	HMIRS	2000023667 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.
96 5927 W. IMPERIAL HWY 5927 W. IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2010107025 N/A	Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2010105944 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	2000023719 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HWY 5927 W. IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2010106610 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	92100959 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	9998080229 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
TC3139641.1s Page 298 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2010107761 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HWY LOS ANGELES, CA	HMIRS	9900009005 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	FLYING TIGERS FREIGHT 5927 IMPERIAL LOS ANGELES, CA 90045	HIST CORTESE SLIC	S103557170 N/A
CORTESE: Region: 4 Facility County Code: 19 Reg By: LTNKA Reg Id: 900450061 SLIC: Region: 4 Facility Status: No further action required SLIC: 0359 Substance: Not reported Staff: Manjulika Chakarbarti			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9900004293 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
TC3139641.1s Page 300 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
96	5927 W IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9900006888 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HWY 5927 W. IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2010106384 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9900002113 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	2000021380 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2000021795 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
TC3139641.1s Page 299 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
96	5927 IMPERIAL HWY LOS ANGELES, CA	HMIRS	2000023668 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2000021796 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY 5927 W IMPERIAL HWY LOS ANGELES, CA 90045	HMIRS	2010107450 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	9900009015 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	92100638 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
TC3139641.1s Page 301 of 351			

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Database(s)	EPA ID Number
Distance (ft.)	Site		
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9998090690 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	2000017880 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	2000021379 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9998081390 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W. IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9998081385 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			

TC3139641.1s Page 302 of 351

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Database(s)	EPA ID Number
Distance (ft.)	Site		
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9998070871 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	FLYING TIGERS 5927 W. IMPERIAL HWY LOS ANGELES, CA 90045	SLIC	S106485539 N/A
SLIC: Region: STATE Facility Status: Open Status Date: 1965-01-01 00:00:00 Global Id: SLT43227225 Lead Agency: LOS ANGELES RWQCB (REGION 4) Lead Agency Case Number: Not reported Latitude: 33.932937 Longitude: -118.38835 Case Type: Cleanup Program Site Case Worker: MC Local Agency: Not reported RB Case Number: 0359 File Location: Not reported Potential Media Affected: Not reported Potential Contaminants of Concern: Not reported Site History: Not reported			
Click here to access the California GeoTracker records for this facility.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9998050995 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9998060003 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			

TC3139641.1s Page 304 of 351

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Database(s)	EPA ID Number
Distance (ft.)	Site		
96	5927 IMPERIAL HWY LOS ANGELES, CA	HMIRS	91090572 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS	9998080706 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	9900010618 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	91060654 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	9900012847 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			

TC3139641.1s Page 303 of 351

MAP FINDINGS		EDR ID Number	
Map ID	Direction	Database(s)	EPA ID Number
Distance (ft.)	Site		
96	5927 IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9900015027 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	9998031311 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5927 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	9900015590 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5937 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2002080760 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
96	5937 WEST IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2002034049 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			

TC3139641.1s Page 305 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
97	GARRETT AVIATION SVCS. - CFC AVIATION SVCS. 6201 W. IMPERIAL HIGHWAY LOS ANGELES, CA 90045	ENVIROSTOR S110493859 N/A
ENVIROSTOR:		
Site Type:	Tiered Permit	
Site Type Detailed:	Tiered Permit	
Acres:	Not reported	
NPL:	NO	
Regulatory Agencies:	NONE SPECIFIED	
Lead Agency:	NONE SPECIFIED	
Program Manager:	Not reported	
Supervisor:	Not reported	
Division Branch:	Cleanup Cypress	
Facility ID:	71003574	
Site Code:	Not reported	
Assembly:	53	
Senate:	28	
Special Program:	Not reported	
Status:	Not reported	
Status Date:	Not reported	
Restricted Use:	NO	
Site Mgmt. Req.:	NONE SPECIFIED	
Funding:	Not reported	
Latitude:	33.931483200000002	
Longitude:	-118.41874180000001	
APN:	NONE SPECIFIED	
Past Use:	NONE SPECIFIED	
Potential COC:	NONE SPECIFIED	
Confirmed COC:	NONE SPECIFIED	
Potential Description:	NONE SPECIFIED	
Alias Name:	CA000546630	
Alias Type:	EPA Identification Number	
Alias Name:	71003574	
Alias Type:	Envirostor ID Number	
Completed Info:		
Completed Area Name:	Not reported	
Completed Sub Area Name:	Not reported	
Completed Document Type:	Not reported	
Completed Date:	Not reported	
Comments:	Not reported	
Future Area Name:		
Future Sub Area Name:	Not reported	
Future Document Type:	Not reported	
Future Due Date:	Not reported	
Schedule Area Name:	Not reported	
Schedule Sub Area Name:	Not reported	
Schedule Document Type:	Not reported	
Schedule Due Date:	Not reported	
Schedule Revised Date:	Not reported	

TC3139641.1s Page 306 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
	GARRETT AIRESEARCH (Continued)	S103891107
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	900450570	
Status:	Case Closed	
Substance:	1	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Soil	
Abatement Method Used at the Site:	Not reported	
Global ID:	T0603701073	
W Global ID:	Not reported	
Staff:	UNK	
Local Agency:	19050	
Cross Street:	SEPULVEDA	
Enforcement Type:	Not reported	
Date Leak Discovered:	9/3/1986	
Date Leak First Reported:	7/24/1987	
Date Leak Record Entered:	8/14/1987	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	12/6/1996	
Date the Case was Closed:	12/6/1996	
How Leak Discovered:	OM	
How Leak Stopped:	Not reported	
Cause of Leak:	UNK	
Leak Source:	UNK	
Operator:	OLD CASENO WAS 005058	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	15361.511333526333633489755481	
Source of Cleanup Funding:	UNK	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	Not reported	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	AIRESEARCH, GARRETT	
RP Address:	6201 W IMPERIAL HWY, LOS ANGELES, CA 90045	
Program:	LUST	
Lat/Long:	33.931002 - / 1	

TC3139641.1s Page 308 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
97	GARRETT AIRESEARCH 6201 IMPERIAL LOS ANGELES, CA 90045	HIST CORTESE S105024630 N/A
CORTESE:		
Region:	CORTESE	
Facility County Code:	19	
Reg By:	LTNKA	
Reg Id:	900450570	
97	GARRETT AIRESEARCH 6201 IMPERIAL HWY E WESTCHESTER, CA 90045	LUST S103891107 N/A
LUST:		
Region:	STATE	
Global Id:	T0603701073	
Latitude:	33.931002	
Longitude:	-118.4177399	
Case Type:	LUST Cleanup Site	
Status:	Completed - Case Closed	
Status Date:	1996-12-06 00:00:00	
Lead Agency:	LOS ANGELES, CITY OF	
Case Worker:	EL	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450570	
LOC Case Number:	Not reported	
File Location:	Not reported	
Potential Media Affect:	Soil	
Potential Contaminants of Concern:	Aviation	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603701073	
Contact Type:	Regional Board Caseworker	
Contact Name:	YUE RONG	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yrong@waterboards.ca.gov	
Phone Number:	Not reported	
Global Id:	T0603701073	
Contact Type:	Local Agency Caseworker	
Contact Name:	ELOY LUNA	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 North Main Street, Suite 1780	
City:	LOS ANGELES	
Email:	eloy.luna@lacity.org	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603701073	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603701073	

TC3139641.1s Page 307 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
	GARRETT AIRESEARCH (Continued)	S103891107
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	Not reported	
98	6641 W. IMPERIAL HWY LOS ANGELES, CA 90045	CHMIRS S100219830 N/A
CHMIRS:		
OES Incident Number:	9010719	
OES notification:	Not reported	
OES Date:	Not reported	
OES Time:	Not reported	
Incident Date:	23-APR-90	
Date Completed:	23-APR-90	
Property Use:	500	
Agency Id Number:	19105	
Agency Incident Number:	505	
Time Notified:	1515	
Time Completed:	1830	
Surrounding Area:	400	
Estimated Temperature:	Not reported	
Property Management:	Not reported	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	N	
Resp Agency Personnel # Of Decontaminated:	0	
Responding Agency Personnel # Of Injuries:	0	
Responding Agency Personnel # Of Fatalities:	0	
Others Number Of Decontaminated:	0	
Others Number Of Injuries:	0	
Others Number Of Fatalities:	0	
Vehicle Make/year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DOT/PUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	TIM KEPHART F327-A	
Report Date:	22-APR-90	
Comments:	N	
Facility Telephone:	213 485-6003	
Waterway Involved:	Not reported	
Waterway:	Not reported	
Spill Site:	Not reported	
Cleanup By:	Not reported	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Not reported	

TC3139641.1s Page 309 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
(Continued)		S100219830
Other:	Not reported	
Date/Time:	Not reported	
Year:	88-92	
Agency:	Not reported	
Incident Date:	Not reported	
Admin Agency:	Not reported	
Amount:	Not reported	
Contained:	Not reported	
Site Type:	Not reported	
E Date:	10-MAY-91	
Substance:	Not reported	
Quantity Released:	Not reported	
BBLs:	Not reported	
Cups:	Not reported	
CUFF:	Not reported	
Gallons:	Not reported	
Grams:	Not reported	
Pounds:	Not reported	
Liters:	Not reported	
Ounces:	Not reported	
Pints:	Not reported	
Quarts:	Not reported	
Sheen:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	
Evacuations:	Not reported	
Number of Injuries:	Not reported	
Number of Fatalities:	Not reported	
Description:	Not reported	

98 6041 WEST IMPERIAL HWY SUITE C
6041 WEST IMPERIAL HWY SUITE C
LOS ANGELES, CA 90045 HMIRS 2010101050
N/A

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

98 6041 W. IMPERIAL HWY
6041 W. IMPERIAL HWY
LOS ANGELES, CA HMIRS 2008437300
N/A

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

TC3139641.1s Page 310 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
100	6555 W IMPERIAL HWY 6555 W IMPERIAL HWY LOS ANGELES, CA 90045	ERNS 99630065 N/A
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.		
100	6555 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS 9900009841 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.		
100	6555 WEST IMPERIAL HWY LOS ANGELES, CA	HMIRS 9999080690 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.		
100	6555 WEST IMPERIAL LOS ANGELES, CA 90045	CHMIRS S103983048 N/A

CHMIRS:
OES Incident Number: 99-2887
OES notification: 7/9/199908:18:02 PM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Incident Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personnel # Of Decontaminated: Not reported
Responding Agency Personnel # Of Injuries: Not reported

TC3139641.1s Page 312 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
99	PAN AMERICAN WORLD AIRWAYS, INC 6501 W IMPERIAL HWY EL SEGUNDO, CA 90045	LUST S109117692 N/A
LUST:		
Region:	STATE	
Global Id:	T0603727663	
Latitude:	33.931811	
Longitude:	-118.400241	
Case Type:	LUST Cleanup Site	
Status:	Open - Remediation	
Status Date:	1995-08-07 00:00:00	
Lead Agency:	LOS ANGELES, CITY OF	
Case Worker:	TP	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	Not reported	
LOC Case Number:	XS0001155	
File Location:	Not reported	
Potential Media Affect:	Soil	
Potential Contaminants of Concern:	Waste Oil / Motor / Hydraulic / Lubricating	
Site History:	Not reported	

[Click here to access the California GeoTracker records for this facility:](#)

LUST:
Global Id: T0603727663
Contact Type: Local Agency Caseworker
Contact Name: TERRENCE PALMER
Organization Name: LOS ANGELES, CITY OF
Address: 221 N FIGUEROA ST STE 1500
City: LOS ANGELES
Email: Not reported
Phone Number: 2134826520
Global Id: T0603727663
Regional Board Caseworker
Contact Name: YUE RONG
Organization Name: LOS ANGELES RWQCB (REGION 4)
Address: 320 W. 4TH ST., SUITE 200
City: Los Angeles
Email: yrong@waterboards.ca.gov
Phone Number: Not reported

LUST:
Global Id: T0603727663
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Discovery
Global Id: T0603727663
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Reported

TC3139641.1s Page 311 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	EDR ID Number
Distance	(ft.)Site	Database(s)
EPA ID Number		
(Continued)		S103983048
Responding Agency Personnel # Of Fatalities:		Not reported
Others Number Of Decontaminated:		Not reported
Others Number Of Injuries:		Not reported
Others Number Of Fatalities:		Not reported
Vehicle Make/year:		Not reported
Vehicle License Number:		Not reported
Vehicle State:		Not reported
Vehicle Id Number:		Not reported
CA/DOT/PUC/ICC Number:		Not reported
Company Name:		Not reported
Reporting Officer Name/ID:		Not reported
Report Date:		Not reported
Comments:		Not reported
Facility Telephone:		Not reported
Waterway Involved:		No
Waterway:		Not reported
Spill Site:		Not reported
Cleanup By:		Unknown
Containment:		Not reported
What Happened:		Not reported
Type:		Not reported
Measure:		Not reported
Other:		Not reported
Date/Time:		Not reported
Year:		1999
Agency:		Aero Ground
Incident Date:		7/9/199912:00:00 AM
Admin Agency:		Not reported
Amount:		Not reported
Contained:		Yes
Site Type:		Industrial Plant
E Date:		Not reported
Substance:		un3082 Pyrethrins
Quantity Released:		Not reported
BBLs:		0
Cups:		0
CUFF:		0
Gallons:		55
Grams:		0
Pounds:		0
Liters:		0
Ounces:		0
Pints:		0
Quarts:		0
Sheen:		0
Tons:		0
Unknown:		0
Evacuations:		0
Number of Injuries:		1
Number of Fatalities:		0
Description:		fork lift punched a hole in drum, one injury from exposure.

TC3139641.1s Page 313 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
101	ATLANTIC AVIATION (FORMER MERCURY SERVICES) 6851 IMPERIAL HWY W WESTCHESTER, CA 90045	LUST S104406305 N/A
LUST:		
Region:	STATE	
Global Id:	T0603701041	
Latitude:	33.9313911	
Longitude:	-118.4109457	
Case Type:	LUST Cleanup Site	
Status:	Open - Remediation	
Status Date:	2009-01-02 00:00:00	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Case Worker:	DMB	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450152	
LOC Case Number:	Not reported	
File Location:	Regional Board	
Potential Media Affect:	Aquifer used for drinking water supply	
Potential Contaminants of Concern:	Other Solvent or Non-Petroleum Hydrocarbon	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603701041	
Contact Type:	Local Agency Caseworker	
Contact Name:	ELOY LUNA	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 North Main Street, Suite 1780	
City:	LOS ANGELES	
Email:	eloy.luna@lacity.org	
Phone Number:	Not reported	
Global Id:		
Contact Type:	Regional Board Caseworker	
Contact Name:	DAVID M. BJOSTAD	
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4th Street, Suite 200	
City:	Los Angeles	
Email:	Not reported	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603701041	
Action Type:	ENFORCEMENT	
Date:	2009-02-26 00:00:00	
Action:	Staff Letter	
Global Id:		
Action Type:	RESPONSE	
Date:	2005-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:		
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Stopped	

TC3139641.1s Page 314 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
	ATLANTIC AVIATION (FORMER MERCURY SERVICES) (Continued)	S104406305
Date:		2009-10-15 00:00:00
Action:		Corrective Action Plan / Remedial Action Plan
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2010-07-15 00:00:00
Action:		Remedial Progress Report
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2011-01-15 00:00:00
Action:		Monitoring Report - Annually
Global Id:		T0603701041
Action Type:		ENFORCEMENT
Date:		2007-10-22 00:00:00
Action:		* Verbal Communication
Global Id:		T0603701041
Action Type:		ENFORCEMENT
Date:		2000-04-04 00:00:00
Action:		Staff Letter
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2009-10-15 00:00:00
Action:		Remedial Progress Report
Global Id:		T0603701041
Action Type:		ENFORCEMENT
Date:		1990-07-02 00:00:00
Action:		Staff Letter
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2009-10-15 00:00:00
Action:		CAP/RAP - Feasibility Study Report
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		1995-12-02 00:00:00
Action:		Soil and Water Investigation Workplan
Global Id:		T0603701041
Action Type:		ENFORCEMENT
Date:		1995-11-13 00:00:00
Action:		Staff Letter
Global Id:		T0603701041
Action Type:		ENFORCEMENT
Date:		2002-07-15 00:00:00
Action:		Staff Letter
Global Id:		T0603701041
Action Type:		Other
Date:		1950-01-01 00:00:00
Action:		Leak Reported

TC3139641.1s Page 316 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
	ATLANTIC AVIATION (FORMER MERCURY SERVICES) (Continued)	S104406305
Global Id:		T0603701041
Action Type:		ENFORCEMENT
Date:		1998-04-23 00:00:00
Action:		Staff Letter
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2004-07-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		1998-07-10 00:00:00
Action:		Soil and Water Investigation Workplan
Global Id:		T0603701041
Action Type:		Other
Date:		1950-01-01 00:00:00
Action:		Leak Discovery
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2008-10-15 00:00:00
Action:		Remedial Progress Report
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2009-01-15 00:00:00
Action:		Monitoring Report - Annually
Global Id:		T0603701041
Action Type:		ENFORCEMENT
Date:		2010-02-01 00:00:00
Action:		Staff Letter
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2008-07-15 00:00:00
Action:		Remedial Progress Report
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2010-01-15 00:00:00
Action:		Monitoring Report - Annually
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2009-04-15 00:00:00
Action:		Remedial Progress Report
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2009-04-15 00:00:00
Action:		Corrective Action Plan / Remedial Action Plan
Global Id:		T0603701041
Action Type:		RESPONSE

TC3139641.1s Page 315 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
	ATLANTIC AVIATION (FORMER MERCURY SERVICES) (Continued)	S104406305
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2002-07-31 00:00:00
Action:		Other Report / Document
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2003-04-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2000-01-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2000-04-15 00:00:00
Action:		Monitoring Report - Quarterly
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2000-05-17 00:00:00
Action:		Interim Remedial Action Plan
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2004-08-25 00:00:00
Action:		Interim Remedial Action Report
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2003-09-15 00:00:00
Action:		Interim Remedial Action Report
Global Id:		T0603701041
Action Type:		REMEDATION
Date:		1950-01-01 00:00:00
Action:		Remove free product
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		2009-01-15 00:00:00
Action:		Remedial Progress Report
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		1990-07-31 00:00:00
Action:		Soil and Water Investigation Workplan
Global Id:		T0603701041
Action Type:		RESPONSE
Date:		1998-04-16 00:00:00
Action:		Soil and Water Investigation Workplan
Global Id:		T0603701041
Action Type:		RESPONSE

TC3139641.1s Page 317 of 351

MAP FINDINGS		
Map ID		EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

ATLANTIC AVIATION (FORMER MERCURY SERVICES) (Continued)

S104406305

Date: 1998-07-15 00:00:00
Action: Well Installation Report

Global Id: T0603701041
Action Type: RESPONSE
Date: 2008-04-15 00:00:00
Action: Remedial Progress Report

Global Id: T0603701041
Action Type: RESPONSE
Date: 2008-01-15 00:00:00
Action: Monitoring Report - Annually

LUST REG 4:

Region: 4
Regional Board: 04
County: Los Angeles
Facid: 900450152
Status: Remediation Plan
Substance: Hydrocarbons
Substance Quantity: Not reported
Local Case No: Not reported
Case Type: Groundwater
Abatement Method Used at the Site: Not reported
Global ID: T0603701041
W Global ID: Not reported
Staff: WXT
Local Agency: 19050
Cross Street: AVIATION BLVD
Enforcement Type: LET
Date Leak Discovered: 2/6/1989
Date Leak First Reported: 2/6/1989
Date Leak Record Entered: 5/11/1994
Date Confirmation Began: 2/6/1989
Date Leak Stopped: 2/6/1989
Date Case Last Changed on Database: 7/16/2002
Date the Case was Closed: Not reported
How Leak Discovered: Not reported
How Leak Stopped: Not reported
Cause of Leak: Spill
Leak Source: Other Source
Operator: LANCASTER, SCOTT
Water System: Not reported
Well Name: Not reported
Approx. Dist To Production Well (ft): 14165, 181377644996129486273103
Source of Cleanup Funding: Other Source
Preliminary Site Assessment Workplan Submitted: 4/12/1992
Preliminary Site Assessment Began: 5/15/1992
Pollution Characterization Began: 4/23/1998
Remediation Plan Submitted: 5/5/2000
Remedial Action Underway: 10/14/1999
Post Remedial Action Monitoring Began: 2/6/1989
Enforcement Action Date: Not reported
Historical Max MTBE Date: 1/1/1965
Hist Max MTBE Conc in Groundwater: 1.4
Hist Max MTBE Conc in Soil: .035

TC3139641.1s Page 318 of 351

MAP FINDINGS		
Map ID		EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

(Continued)

S105657588

Resp Agency Personnel # Of Decontaminated: Not reported
Responding Agency Personnel # Of Injuries: Not reported
Responding Agency Personnel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported

Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Comments: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: STORM DRAIN
Spill Site: Not reported
Cleanup By: Reporting Party
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Date/Time: Not reported
Year: 1998
Agency: AIRPORT OPERATIONS, LA AIRPORT
Incident Date: 2/20/1998 12:00:00 AM
Admin Agency: Los Angeles City Fire Department
Amount: Not reported
Contained: Yes
Site Type: Other
E Date: Not reported
Substance: JET A, JET FUEL
Quantity Released: Not reported
BBLs: 0
Cups: 0
CUFT: 0
Gallons: 60
Grams: 0
Pounds: 0
Liters: 0
Ounces: 0
Pints: 0
Quarts: 0
Sheen: 0
Tons: 0
Unknown: 0
Evacuations: 0
Number of Injuries: 0
Number of Fatalities: 0
Description: WHILE REFUELING TANKER TRUCK, VALVE FAILED CAUSING THE SPILL.

TC3139641.1s Page 320 of 351

MAP FINDINGS		
Map ID		EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

ATLANTIC AVIATION (FORMER MERCURY SERVICES) (Continued)

S104406305

Significant Interim Remedial Action Taken: Not reported
GW Qualifier: Not reported
Soil Qualifier: <
Organization: Not reported
Owner Contact: Not reported
Responsible Party: JULIAN GRANIRER
RP Address: 7000 WORLD WAY WEST
Program: LUST
Lat/Long: 33.9313911 / -1
Local Agency Staff: PEJ
Beneficial Use: Not reported
Priority: Not reported
Cleanup Fund Id: Not reported
Suspended: Not reported
Assigned Name: Not reported
Summary: SUBSTANCES: 76-JET FUEL, FREE PRODUCT PRESENT; 10/18/99 ADDENDUM TO ADOL SITE ASSESSMENT; 5/12/00 2ND QTR FEE-PHASE PRODUCT REMOVAL & GW MON RPT; 8/16/00 2ND QTR FREE-PHASE PRODUCT REMOVAL & GW MON RPT; 3/14/01 4TH QTR FREE

101 MERCURY SERVICES/LAX
6851 IMPERIAL
LOS ANGELES, CA 90045
CORTSE:
Region: CORTSE
Facility County Code: 19
Reg By: LTNKA
Reg Id: 900450152

HIST CORTSE S105024631
N/A

101 6851 WEST IMPERIAL
LOS ANGELES, CA 90045
CHMIRS:
OES Incident Number: 98-0864
OES notification: 2/20/1998 04:40:33 AM
OES Date: Not reported
OES Time: Not reported
Incident Date: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
More Than Two Substances Involved?: Not reported

CHMIRS S105657588
N/A

TC3139641.1s Page 319 of 351

MAP FINDINGS		
Map ID		EDR ID Number
Direction		
Distance		
Distance (ft.)Site	Database(s)	EPA ID Number

102 5721 W. IMPERIAL HWY
5721 W. IMPERIAL HWY
LOS ANGELES, CA 90045
ERNS 2008879458
N/A

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

102 5721 W. IMPERIAL HWY
LOS ANGELES, CA 90045
CHMIRS: S100220380
N/A

CHMIRS:
OES Incident Number: 9012596
OES notification: Not reported
OES Date: Not reported
OES Time: Not reported
Incident Date: 25-AUG-90
Date Completed: 25-AUG-90
Property Use: 800
Agency Id Number: 19105
Agency Incident Number: 632
Time Notified: 1643
Time Completed: 2000
Surrounding Area: 800
Estimated Temperature: 75
Property Management: P
Special Studies 1: Not reported
Special Studies 2: Not reported
Special Studies 3: Not reported
Special Studies 4: Not reported
Special Studies 5: Not reported
Special Studies 6: Not reported
More Than Two Substances Involved?: N
Resp Agency Personnel # Of Decontaminated: 0
Responding Agency Personnel # Of Injuries: 0
Responding Agency Personnel # Of Fatalities: 0
Others Number Of Decontaminated: 0
Others Number Of Injuries: 0
Others Number Of Fatalities: 0
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA/DOT/PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: GREGORY E. NEWLAND #168 FSAC
Report Date: 25-AUG-90
Comments: Y
Facility Telephone: 213 485-6003
Waterway Involved: Not reported
Waterway: Not reported
Spill Site: Not reported
Cleanup By: Not reported
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported

TC3139641.1s Page 321 of 351

Map ID	MAP FINDINGS		EDR ID Number	
Direction			Database(s)	EPA ID Number
Distance	(ft.)	Site		
(Continued)				S100220380
Other:		Not reported		
Date/Time:		Not reported		
Year:		88-92		
Agency:		Not reported		
Incident Date:		Not reported		
Admin Agency:		Not reported		
Amount:		Not reported		
Contained:		Not reported		
Site Type:		Not reported		
E Date:		04-JUN-91		
Substance:		Not reported		
Quantity Released:		Not reported		
BBLs:		Not reported		
Cups:		Not reported		
CUFT:		Not reported		
Gallons:		Not reported		
Grams:		Not reported		
Pounds:		Not reported		
Liters:		Not reported		
Ounces:		Not reported		
Pints:		Not reported		
Quarts:		Not reported		
Sheen:		Not reported		
Tons:		Not reported		
Unknown:		Not reported		
Evacuations:		Not reported		
Number of Injuries:		Not reported		
Number of Fatalities:		Not reported		
Description:		Not reported		
<hr/>				
102	5721 W IMPERIAL HWY LOS ANGELES, CA		HMIRS	2004400171 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.				
<hr/>				
102	5721 W. IMPERIAL HIGHWAY LOS ANGELES, CA 90045		CHMIRS	S110420358 N/A
CHMIRS:				
OES Incident Number:		'08-5646		
OES notification:		8/4/2008 11:00:12 AM		
OES Date:		Not reported		
OES Time:		Not reported		
Incident Date:		Not reported		
Date Completed:		Not reported		
Property Use:		Not reported		
Agency Id Number:		Not reported		
Agency Incident Number:		Not reported		
Time Notified:		Not reported		
Time Completed:		Not reported		
Surrounding Area:		Not reported		
<hr/>				
TC3139641.1s Page 322 of 351				

Map ID		MAP FINDINGS		EDR ID Number	
Direction	Distance			Database(s)	EPA ID Number
Distance (ft.)	Site				
(Continued)		S110420358			
Unknown:		Not reported			
Evacuations:		0			
Number of Injuries:		0			
Number of Fatalities:		0			
Description:		RP States: A cargo loader was parked and was discovered to be leaking hydraulic fluid.			
<hr/>					
102	5721 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	2004400170 N/A		
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.					
<hr/>					
102	5721 W. IMPERIAL HIGHWAY LOS ANGELES, CA	HMIRS	2008451539 N/A		
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.					
<hr/>					
102	5729 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	95110989 N/A		
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.					
<hr/>					
102	5729 IMPERIAL HWY LOS ANGELES, CA	HMIRS	94061337 N/A		
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.					

TC3139641.1sPage 324 of 351

Map ID	MAP FINDINGS		EDR ID Number
Direction			
Distance			
Distance (ft.)	Site	Database(s)	EPA ID Number
(Continued)			S110420358
Estimated Temperature:	Not reported		
Property Management:	Not reported		
Special Studies 1:	Not reported		
Special Studies 2:	Not reported		
Special Studies 3:	Not reported		
Special Studies 4:	Not reported		
Special Studies 5:	Not reported		
Special Studies 6:	Not reported		
More Than Two Substances Involved?:	Not reported		
Resp Agency Personnel # Of Decontaminated:	Not reported		
Responding Agency Personnel # Of Injuries:	Not reported		
Responding Agency Personnel # Of Fatalities:	Not reported		
Others Number Of Decontaminated:	Not reported		
Others Number Of Injuries:	Not reported		
Others Number Of Fatalities:	Not reported		
Vehicle Make/year:	Not reported		
Vehicle License Number:	Not reported		
Vehicle State:	Not reported		
Vehicle Id Number:	Not reported		
CA/DOT/PUC/ICC Number:	Not reported		
Company Name:	Not reported		
Reporting Officer Name/ID:	Not reported		
Report Date:	Not reported		
Comments:	Not reported		
Facility Telephone:	Not reported		
Waterway Involved:	Unknown		
Waterway:	storm drain		
Spill Site:	Airport		
Cleanup By:	Contractor		
Containment:	Not reported		
What Happened:	Not reported		
Type:	Not reported		
Measure:	Gall(s)		
Other:	Not reported		
Date/Time:	0900		
Year:	2008		
Agency:	Evergreen		
Incident Date:	8/4/2008		
Admin Agency:	Los Angeles City Fire Department		
Amount:	Not reported		
Contained:	Yes		
Site Type:	storm drain		
E Date:	Not reported		
Substance:	hydraulic fluid		
Quantity Released:	6		
BBLs:	Not reported		
Cups:	Not reported		
CUFT:	Not reported		
Gallons:	Not reported		
Grams:	Not reported		
Pounds:	Not reported		
Liters:	Not reported		
Ounces:	Not reported		
Pints:	Not reported		
Quarts:	Not reported		
Sheen:	Not reported		
Tons:	Not reported		

Map ID		MAP FINDINGS		EDR ID Number	
Direction	Distance	Database(s)	EPA ID Number		
Distance (ft.)	Site				
102	5761 W IMPERIAL HWY LAX AIRPORT SINGAPORE AIR WAREHOUSE 5761 W IMPERIAL HWY LAX AIRPORT SINGAPORE AIR WAREHOUSE LOS ANGELES, CA 90045	ERNS	94373949 N/A		
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.					
102	5761 W IMPERIAL HWY LAX AIRPORT SINGAPORE AIR WAREHOUSE 5761 W IMPERIAL HWY LAX AIRPORT SINGAPORE AIR WAREHOUSE LOS ANGELES, CA 90045	ERNS	94373990 N/A		
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.					
102	5761 WEST IMPERIAL HWY 5761 WEST IMPERIAL HWY LOS ANGELES, CA 90045	ERNS	2009921905 N/A		
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.					
103	5625 W. IMPERIAL HWY. 5625 W. IMPERIAL HWY. LOS ANGELES, CA	HMIRS	2008448406 N/A		
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.					
104	5811 IMPERIAL HWY 5811 IMPERIAL HWY LOS ANGELES, CA	ERNS	2008889740 N/A		
Click this hyperlink while viewing on your computer to access additional ERNS detail in the EDR Site Report.					

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
104	5811 IMPERIAL HWY LOS ANGELES, CA	CHMIRS S110420381 N/A
CHMIRS:		
OES Incident Number:	08-8111	
OES notification:	11/11/2008 1:50:50 PM	
OES Date:	Not reported	
OES Time:	Not reported	
Incident Date:	Not reported	
Date Completed:	Not reported	
Property Use:	Not reported	
Agency Id Number:	Not reported	
Agency Incident Number:	Not reported	
Time Notified:	Not reported	
Time Completed:	Not reported	
Surrounding Area:	Not reported	
Estimated Temperature:	Not reported	
Property Management:	Not reported	
Special Studies 1:	Not reported	
Special Studies 2:	Not reported	
Special Studies 3:	Not reported	
Special Studies 4:	Not reported	
Special Studies 5:	Not reported	
Special Studies 6:	Not reported	
More Than Two Substances Involved?:	Not reported	
Resp Agency Personnel # Of Decontaminated:	Not reported	
Responding Agency Personnel # Of Injuries:	Not reported	
Responding Agency Personnel # Of Fatalities:	Not reported	
Others Number Of Decontaminated:	Not reported	
Others Number Of Injuries:	Not reported	
Others Number Of Fatalities:	Not reported	
Vehicle Make/year:	Not reported	
Vehicle License Number:	Not reported	
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DOT/PUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	No	
Waterway:	Not reported	
Spill Site:	Airport	
Cleanup By:	Unknown	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Gall(s)	
Other:	Not reported	
Date/Time:	1220	
Year:	2008	
Agency:	NRC	
Incident Date:	11/8/2008	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	Unknown	
Site Type:	Not reported	

TC3139641.1s Page 326 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
(Continued)		S110978315
Vehicle State:	Not reported	
Vehicle Id Number:	Not reported	
CA/DOT/PUC/ICC Number:	Not reported	
Company Name:	Not reported	
Reporting Officer Name/ID:	Not reported	
Report Date:	Not reported	
Comments:	Not reported	
Facility Telephone:	Not reported	
Waterway Involved:	No	
Waterway:	Not reported	
Spill Site:	Airport	
Cleanup By:	Contractor	
Containment:	Not reported	
What Happened:	Not reported	
Type:	Not reported	
Measure:	Gall(s)	
Other:	Not reported	
Date/Time:	445	
Year:	2010	
Agency:	Aircraft Service Int. -LAX Fuel	
Incident Date:	2/27/2010	
Admin Agency:	Los Angeles City Fire Department	
Amount:	Not reported	
Contained:	Yes	
Site Type:	Not reported	
E Date:	Not reported	
Substance:	Jet A	
Quantity Released:	50	
BBLs:	Not reported	
Cups:	Not reported	
CUFT:	Not reported	
Gallons:	Not reported	
Grams:	Not reported	
Pounds:	Not reported	
Liters:	Not reported	
Ounces:	Not reported	
Pints:	Not reported	
Quarts:	Not reported	
Sheen:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	
Evacuations:	Not reported	
Number of Injuries:	Not reported	
Number of Fatalities:	Not reported	
Description:	The oil and water separator backed up causing the product to overflow into a containment area. Clean up is underway.	

105 6501 W IMPERIAL
LOS ANGELES, CA

HMIRS 94030920
N/A

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

TC3139641.1s Page 328 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
(Continued)		S110420381
E Date:	Not reported	
Substance:	Jet Fuel / Water Mix	
Quantity Released:	1	
BBLs:	Not reported	
Cups:	Not reported	
CUFT:	Not reported	
Gallons:	Not reported	
Grams:	Not reported	
Pounds:	Not reported	
Liters:	Not reported	
Ounces:	Not reported	
Pints:	Not reported	
Quarts:	Not reported	
Sheen:	Not reported	
Tons:	Not reported	
Unknown:	Not reported	
Evacuations:	0	
Number of Injuries:	0	
Number of Fatalities:	0	
Description:	Quoting the NRC report, "A mixture of jet fuel and water has spilled onto the concrete from an overflowed below ground storage tank." Under REMEDIAL ACTIONS the report goes on to state, "Clean-up completed."	

104 5801 IMPERIAL HIGHWAY
LOS ANGELES, CA

CHMIRS S110978315
N/A

CHMIRS:

OES Incident Number: 10-1437

OES notification: 2/27/2010 8:55:00 AM

OES Date: Not reported

OES Time: Not reported

Incident Date: Not reported

Date Completed: Not reported

Property Use: Not reported

Agency Id Number: Not reported

Agency Incident Number: Not reported

Time Notified: Not reported

Time Completed: Not reported

Surrounding Area: Not reported

Estimated Temperature: Not reported

Property Management: Not reported

Special Studies 1: Not reported

Special Studies 2: Not reported

Special Studies 3: Not reported

Special Studies 4: Not reported

Special Studies 5: Not reported

Special Studies 6: Not reported

More Than Two Substances Involved?: Not reported

Resp Agency Personnel # Of Decontaminated: Not reported

Responding Agency Personnel # Of Injuries: Not reported

Responding Agency Personnel # Of Fatalities: Not reported

Others Number Of Decontaminated: Not reported

Others Number Of Injuries: Not reported

Others Number Of Fatalities: Not reported

Vehicle Make/year: Not reported

Vehicle License Number: Not reported

TC3139641.1s Page 327 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
106	5827 WEST IMPERIAL DR LOS ANGELES, CA	HMIRS 9998030692 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.		
106	5927 WEST IMPERIAL FREEWAY LOS ANGELES, CA	HMIRS 9998031305 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.		
107	5924 W IMPERIAL HWY LOS ANGELES, CA	HMIRS 9998080946 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.		

107 FAA
5885 IMPERIAL HWY W
WESTCHESTER, CA 90045

LUST S102769616
N/A

LUST:

Region: STATE

Global Id: T0603701070

Latitude: 33.9311555

Longitude: -118.3849511

Case Type: LUST Cleanup Site

Status: Open - Remediation

Status Date: 1993-01-11 00:00:00

Lead Agency: LOS ANGELES, CITY OF

Case Worker: WR

Local Agency: LOS ANGELES, CITY OF

RB Case Number: 900450543

LOC Case Number: Not reported

File Location: Not reported

Potential Media Affect: Soil

Potential Contaminants of Concern: Aviation

Site History: Not reported

[Click here to access the California GeoTracker records for this facility.](#)

LUST:

Global Id: T0603701070

Contact Type: Regional Board Caseworker

Contact Name: YUE RONG

Organization Name: LOS ANGELES RWQCB (REGION 4)

TC3139641.1s Page 329 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
FAA (Continued)		S102769616
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yjong@waterboards.ca.gov	
Phone Number:	Not reported	
Global Id:	T0603701070	
Contact Type:	Local Agency Caseworker	
Contact Name:	TBD	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 N. MAIN ST. RM. 970	
City:	LOS ANGELES	
Email:	Not reported	
Phone Number:	2139783722	
LUST:		
Global Id:	T0603701070	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603701070	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	900450543	
Status:	Pollution Characterization	
Substance:	1	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Soil	
Abatement Method Used at the Site:	Not reported	
Global ID:	T0603701070	
W Global ID:	Not reported	
Staff:	UNK	
Local Agency:	19050	
Cross Street:	AVIATION	
Enforcement Type:	Not reported	
Date Leak Discovered:	6/17/1987	
Date Leak First Reported:	6/18/1987	
Date Leak Record Entered:	11/17/1987	
Date Confirmation Began:	Not reported	
Date Leak Stopped:	Not reported	
Date Case Last Changed on Database:	3/2/1994	
Date the Case was Closed:	Not reported	
How Leak Discovered:	OM	
How Leak Stopped:	Not reported	
Cause of Leak:	UNK	
Leak Source:	Piping	
Operator:	OLD CASENO WAS 090001	
Water System:	Not reported	

TC3139641.1s Page 330 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
SO. BAY PETROLEUM (Continued)		S101297056
Organization Name:	LOS ANGELES RWQCB (REGION 4)	
Address:	320 W. 4TH ST., SUITE 200	
City:	Los Angeles	
Email:	yjong@waterboards.ca.gov	
Phone Number:	Not reported	
Global Id:	T0603701071	
Contact Type:	Local Agency Caseworker	
Contact Name:	ELOY LUNA	
Organization Name:	LOS ANGELES, CITY OF	
Address:	200 North Main Street, Suite 1780	
City:	LOS ANGELES	
Email:	elcyluna@lacity.org	
Phone Number:	Not reported	
LUST:		
Global Id:	T0603701071	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Stopped	
Global Id:	T0603701071	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Discovery	
Global Id:	T0603701071	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
LUST REG 4:		
Region:	4	
Regional Board:	04	
County:	Los Angeles	
Facid:	900450552	
Status:	Leak being confirmed	
Substance:	Gasoline	
Substance Quantity:	Not reported	
Local Case No:	Not reported	
Case Type:	Soil	
Abatement Method Used at the Site:	Not reported	
Global ID:	T0603701071	
W Global ID:	Not reported	
Staff:	UNK	
Local Agency:	19050	
Cross Street:	AVIATION	
Enforcement Type:	Not reported	
Date Leak Discovered:	9/3/1986	
Date Leak First Reported:	7/24/1987	
Date Leak Record Entered:	8/14/1987	
Date Confirmation Began:	7/24/1987	
Date Leak Stopped:	10/24/1986	
Date Case Last Changed on Database:	7/24/1987	
Date the Case was Closed:	Not reported	

TC3139641.1s Page 332 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
FAA (Continued)		S102769616
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	7646.2814057767072978866953851	
Source of Cleanup Funding:	Piping	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	6/18/1987	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	FAA	
RP Address:	5885 W IMPERIAL HWY, LOS ANGELES, CA 90045	
Program:	LUST	
Lat/Long:	33.9311555 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	Not reported	
107 SO. BAY PETROLEUM	LUST	S101297056
5899 IMPERIAL HWY W	N/A	
WESTCHESTER, CA 90045		
LUST:		
Region:	STATE	
Global Id:	T0603701071	
Latitude:	33.9311525	
Longitude:	-118.3852881	
Case Type:	LUST Cleanup Site	
Status:	Completed - Case Closed	
Status Date:	2009-04-06 00:00:00	
Lead Agency:	LOS ANGELES, CITY OF	
Case Worker:	HQ	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450652	
LOC Case Number:	Not reported	
File Location:	Not reported	
Potential Media Affect:	Soil	
Potential Contaminants of Concern:	Gasoline	
Site History:	Not reported	
Click here to access the California GeoTracker records for this facility:		
LUST:		
Global Id:	T0603701071	
Contact Type:	Regional Board Caseworker	
Contact Name:	YUE RONG	

TC3139641.1s Page 331 of 351

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
SO. BAY PETROLEUM (Continued)		S101297056
How Leak Discovered:	OM	
How Leak Stopped:	Not reported	
Cause of Leak:	UNK	
Leak Source:	UNK	
Operator:	OLD CASENO WAS 005059	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	7719.5631681344344206824986392	
Source of Cleanup Funding:	UNK	
Preliminary Site Assessment Workplan Submitted:	Not reported	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	Not reported	
Remediation Plan Submitted:	Not reported	
Remedial Action Underway:	Not reported	
Post Remedial Action Monitoring Began:	Not reported	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	Not reported	
Hist Max MTBE Conc in Groundwater:	Not reported	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Not reported	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	DEPT OF AIRPORTS	
RP Address:	1 WORLD WY, LOS ANGELES, CA 90009	
Program:	LUST	
Lat/Long:	33.9311525 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	Not reported	
107 FLYING TIGERS FREIGHT	LUST	S101297057
5927 IMPERIAL HWY W	N/A	
WESTCHESTER, CA 90045		
LUST:		
Region:	STATE	
Global Id:	T0603701033	
Latitude:	33.9311505	
Longitude:	-118.3859011	
Case Type:	LUST Cleanup Site	
Status:	Completed - Case Closed	
Status Date:	1996-05-08 00:00:00	
Lead Agency:	LOS ANGELES RWQCB (REGION 4)	
Case Worker:	YR	
Local Agency:	LOS ANGELES, CITY OF	
RB Case Number:	900450061	
LOC Case Number:	Not reported	
File Location:	Not reported	
Potential Media Affect:	Soil	
Potential Contaminants of Concern:	Gasoline	
Site History:	Not reported	

TC3139641.1s Page 333 of 351

Map ID
Direction
Distance
Distance (ft.) Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

FLYING TIGERS FREIGHT (Continued)

S101297057

Click here to access the California GeoTracker records for this facility:

LUST:

Global Id: T0603701033
Contact Type: Local Agency Caseworker
Contact Name: ELOY LUNA
Organization Name: LOS ANGELES, CITY OF
Address: 200 North Main Street, Suite 1780
City: LOS ANGELES
Email: eloy.luna@lacity.org
Phone Number: Not reported

Global Id: T0603701033
Contact Type: Regional Board Caseworker
Contact Name: YUE RONG
Organization Name: LOS ANGELES RWQCB (REGION 4)
Address: 320 W. 4TH ST., SUITE 200
City: Los Angeles
Email: yrong@waterboards.ca.gov
Phone Number: Not reported

LUST:

Global Id: T0603701033
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Stopped

Global Id: T0603701033
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Discovery

Global Id: T0603701033
Action Type: Other
Date: 1950-01-01 00:00:00
Action: Leak Reported

LUST REG 4:

Region: 4
Regional Board: 04
County: Los Angeles
Facid: 900450061
Status: Case Closed
Substance: Gasoline
Substance Quantity: Not reported
Local Case No.: Not reported
Case Type: Soil
Abatement Method Used at the Site: Excavate and Dispose
Global Id: T0603701033
W Global ID: Not reported
Staff: UNK
Local Agency: 19050
Cross Street: AVIATION
Enforcement Type: Not reported
Date Leak Discovered: 12/16/1985

TC3139641.1s Page 334 of 351

Map ID
Direction
Distance
Distance (ft.) Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

KOREAN AIRLINES FREIGHT (Continued)

S103891106

W Global ID: Not reported
Staff: SLC
Local Agency: 19050
Cross Street: SEPULVEDA BLVD
Enforcement Type: Not reported
Date Leak Discovered: 2/7/1990
Date Leak First Reported: 10/27/1988
Date Leak Record Entered: 5/25/1995
Date Confirmation Began: 2/7/1990
Date Leak Stopped: 2/7/1990
Date Case Last Changed on Database: 5/25/1995
Date the Case was Closed: Not reported
How Leak Discovered: Nuisance Conditions
How Leak Stopped: Not reported
Cause of Leak: Structure Failure
Leak Source: Piping
Operator: Not reported
Water System: Not reported
Well Name: Not reported
Approx. Dist To Production Well (ft): 15197.214364892028950045049137
Source of Cleanup Funding: Piping
Preliminary Site Assessment Workplan Submitted: Not reported
Preliminary Site Assessment Began: Not reported
Pollution Characterization Began: Not reported
Remediation Plan Submitted: Not reported
Remedial Action Underway: Not reported
Post Remedial Action Monitoring Began: Not reported
Enforcement Action Date: Not reported
Historical Max MTBE Date: Not reported
Hist Max MTBE Conc in Groundwater: Not reported
Hist Max MTBE Conc in Soil: Not reported
Significant Interim Remedial Action Taken: Not reported
GW Qualifier: Not reported
Soil Qualifier: Not reported
Organization: Not reported
Owner Contact: Not reported
Responsible Party: KOREAN AIRLINES
RP Address: 6101 W IMPERIAL HWY LA CA 90049
Program: LUST
Lat/Long: 33.931002 / -1
Local Agency Staff: PEJ
Beneficial Use: Not reported
Priority: Not reported
Cleanup Fund Id: Not reported
Suspended: Not reported
Assigned Name: Not reported
Summary: INVENTORY LOSS REPORTED TO BE APPX 20,000 GAL. POSSIBLE PIPERUPTURE OCCURED. FUEL WAS SEEN COMING FROM GROUND.

SLIC:

Region: STATE
Facility Status: Open - Site Assessment
Status Date: 1990-02-07 00:00:00
Global Id: T0603701072
Lead Agency: LOS ANGELES RWQCB (REGION 4)
Lead Agency Case Number: Not reported
Latitude: 33.931002

TC3139641.1s Page 336 of 351

Map ID
Direction
Distance
Distance (ft.) Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

FLYING TIGERS FREIGHT (Continued)

S101297057

Date Leak First Reported: 12/20/1985
Date Leak Record Entered: 4/23/1987
Date Confirmation Began: Not reported
Date Leak Stopped: 12/16/1985
Date Case Last Changed on Database: 2/15/1996
Date the Case was Closed: 5/8/1996
How Leak Discovered: Tank Test
How Leak Stopped: Not reported
Cause of Leak: Structure Failure
Leak Source: Tank
Operator: FLYING TIGERS
Water System: Not reported
Well Name: Not reported
Approx. Dist To Production Well (ft): 7855.3469920709961454401127375
Source of Cleanup Funding: Tank
Preliminary Site Assessment Workplan Submitted: Not reported
Preliminary Site Assessment Began: Not reported
Pollution Characterization Began: 8/10/1987
Remediation Plan Submitted: Not reported
Remedial Action Underway: Not reported
Post Remedial Action Monitoring Began: Not reported
Enforcement Action Date: Not reported
Historical Max MTBE Date: Not reported
Hist Max MTBE Conc in Groundwater: Not reported
Hist Max MTBE Conc in Soil: Not reported
Significant Interim Remedial Action Taken: Yes
GW Qualifier: Not reported
Soil Qualifier: Not reported
Organization: Not reported
Owner Contact: Not reported
Responsible Party: FLYING TIGERS
RP Address: 5927 W IMPERIAL HWY, LOS ANGELES, CA 90045
Program: LUST
Lat/Long: 33.9311505 / -1
Local Agency Staff: PEJ
Beneficial Use: Not reported
Priority: Not reported
Cleanup Fund Id: Not reported
Suspended: Not reported
Assigned Name: Not reported
Summary: ADDITIONAL SITE ASSESSMENT WORK NEEDED.

108 KOREAN AIRLINES FREIGHT
6101 IMPERIAL HWY E
WESTCHESTER, CA 90045LUST
SLIC S103891106
N/A

LUST REG 4:

Region: 4
Regional Board: 04
County: Los Angeles
Facid: 900450561
Status: Leak being confirmed
Substance: Kerosene
Substance Quantity: Not reported
Local Case No.: Not reported
Case Type: Soil
Abatement Method Used at the Site: Not reported
Global Id: T0603701072

TC3139641.1s Page 335 of 351

Map ID
Direction
Distance
Distance (ft.) Site

MAP FINDINGS

EDR ID Number
Database(s)
EPA ID Number

KOREAN AIRLINES FREIGHT (Continued)

S103891106

Longitude: -118.4169329
Case Type: Cleanup Program Site
Case Worker: SLC
Local Agency: LOS ANGELES, CITY OF
RB Case Number: 900450561
File Location: Not reported
Potential Media Affected: Soil
Potential Contaminants of Concern: Kerosene
Site History: Not reported

Click here to access the California GeoTracker records for this facility:

108 KOREAN AIRLINES FREIGHT
6101 IMPERIAL
LOS ANGELES, CA 90045HIST CORTESE
S105024629
N/A

CORTESE:

Region: CORTESE
Facility County Code: 19
Reg By: LTNKA
Reg Id: 900450561

108 LAX - KOREAN AIRLINES
6101 WEST IMPERIAL HIGHWAY
LOS ANGELES, CA 90045SLIC S106568479
N/A

SLIC:

Region: STATE
Facility Status: Open - Site Assessment
Status Date: 2002-07-12 00:00:00
Global Id: SL0603769898
Lead Agency: LOS ANGELES RWQCB (REGION 4)
Lead Agency Case Number: Not reported
Latitude: 33.9317350546797
Longitude: -118.39161157608
Case Type: Cleanup Program Site
Case Worker: YR
Local Agency: LOS ANGELES COUNTY
RB Case Number: 1061B
File Location: Regional Board
Potential Media Affected: Not reported
Potential Contaminants of Concern: Site operated several underground storage tanks (USTs), which have been removed. Presently the site is doing routine groundwater monitoring.
Site History: Not reported

Click here to access the California GeoTracker records for this facility:

TC3139641.1s Page 337 of 351

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
108	LAX - KOREAN AIRLINES 6101 IMPERIAL LOS ANGELES, CA 90045	SLIC	S105520939 N/A
SLIC: Region: 4 Facility Status: Not reported SLIC: 1061B Substance: Not reported Staff: LACFD			
109	5600 W. IMPERIAL HWY LOS ANGELES, CA 90040	CHMIRS	S106395959 N/A
CHMIRS: OES Incident Number: 03-1036 OES notification: 2/23/200308:19:20 AM OES Date: Not reported OES Time: Not reported Incident Date: Not reported Date Completed: Not reported Property Use: Not reported Agency Id Number: Not reported Agency Incident Number: Not reported Time Notified: Not reported Time Completed: Not reported Surrounding Area: Not reported Estimated Temperature: Not reported Property Management: Not reported Special Studies 1: Not reported Special Studies 2: Not reported Special Studies 3: Not reported Special Studies 4: Not reported Special Studies 5: Not reported Special Studies 6: Not reported More Than Two Substances Involved?: Not reported Resp Agncy Personnel # Of Decontaminated: Not reported Responding Agency Personnel # Of Injuries: Not reported Responding Agency Personnel # Of Fatalities: Not reported Others Number Of Decontaminated: Not reported Others Number Of Injuries: Not reported Others Number Of Fatalities: Not reported Vehicle Make/year: Not reported Vehicle License Number: Not reported Vehicle State: Not reported Vehicle Id Number: Not reported CA/DOT/PLU/COC Number: Not reported Company Name: Not reported Reporting Officer Name/ID: Not reported Report Date: Not reported Comments: Not reported Facility Telephone: Not reported Waterway Involved: No Waterway: Not reported Spill Site: Not reported Cleanup By: Responsible Party Containment: Not reported What Happened: Not reported Type: Not reported			
TC3139641.1s Page 338 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
110	FAA 5885 IMPERIAL LOS ANGELES, CA 90045	HIST CORTESE	S105024626 N/A
CORTESE: Region: CORTESE Facility County Code: 19 Reg By: LTNKA Reg Id: 900450543			
111	5247 W. IMPERIAL HWY LOS ANGELES, CA	HMIRS	9998030649 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
111	INTERWEB 5251 W IMPERIAL HWY LOS ANGELES, CA 90045	ENVIROSTOR	1000220050 CAD092516772
ENVIROSTOR: Site Type: Historical Site Type Detailed: * Historical Acres: 0 NPL: NO Regulatory Agencies: NONE SPECIFIED Lead Agency: NONE SPECIFIED Program Manager: Not reported Supervisor: * UNKNOWNROY Division Branch: Cleanup Chatsworth Facility ID: 19270325 Site Code: Not reported Assembly: 53 Sarathe: 28 Special Program: * RCRA 3012 - Past Haz Waste Disp Inven Site Status: No Further Action Status Date: 1994-10-25 00:00:00 Restricted Use: NO Site Mgmt. Req.: NONE SPECIFIED Funding: Not reported Latitude: 33.9313546894467 Longitude: -118.371738024526 APN: 4129038001 Past Use: WASTE - INDUSTRIAL TREATMENT FACILITY Potential COC: 30021, 30152, 30153, 30156, 30160, 30407 Confirmed COC: 30021-NO,30152-NO,30153-NO,30156-NO,30160-NO,30407-NO Potential Description: OTH, SOIL Alias Name: CREATIVE WEB Alias Type: Alternate Name Alias Name: 4129038001 Alias Type: APN Alias Name: CAD092516772 Alias Type: EPA Identification Number Alias Name: 110002663608 Alias Type: EPA (FRS #)			
TC3139641.1s Page 340 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
(Continued)			S106395959
Measure: Not reported Other: Not reported Date/Time: Not reported Year: 2003 Agency: Los Angeles City Fire Dept. Incident Date: 2/21/200312:00:00 AM Admin Agency: Los Angeles City Fire Department Amount: Not reported Contained: Yes Site Type: Road E Date: Not reported Substance: Aviation Fuel Quantity Released: Not reported BBLs: 0 Cups: 0 CUFT: 0 Gallons: 50 Grams: 0 Pounds: 0 Liters: 0 Ounces: 0 Pints: 0 Quarts: 0 Sheen: 0 Tons: 0 Unknown: 0 Evacuations: 0 Number of Injuries: 0 Number of Fatalities: 0 Description: A tanker truck involved in traffic accident.			
110	SO, BAY PETROLEUM 5899 IMPERIAL LOS ANGELES, CA 90045	HIST CORTESE	S105024628 N/A
CORTESE: Region: CORTESE Facility County Code: 19 Reg By: LTNKA Reg Id: 900450552			
110	CATRANS SAND/SALT FACILIT 5885 IMPERIAL LOS ANGELES, CA 90045	HIST CORTESE	S105024627 N/A
CORTESE: Region: CORTESE Facility County Code: 19 Reg By: LTNKA Reg Id: 090001			
TC3139641.1s Page 339 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
INTERWEB (Continued)			1000220050
Alias Name: CAD092516772 Alias Type: HWTS Identification Code Alias Name: 19270325 Alias Type: Envirostor ID Number			
Completed Info: Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported Completed Document Type: Site Screening Completed Date: 1994-10-25 00:00:00 Comments: Database verification project confirms NFA for DTSC.			
Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported Completed Document Type: Preliminary Assessment Report Completed Date: 1984-03-21 00:00:00 Comments: Facility Drive-by (Abandoned Site Assessment Program): In- side of building unknown. Site referred to DHS/SCS. Preliminary Assessment (RCRA 3012) submitted to EPA.			
Completed Area Name: PROJECT WIDE Completed Sub Area Name: Not reported Completed Document Type: * Discovery Completed Date: 1983-09-26 00:00:00 Comments: Facility identified from ERRIS.			
Future Area Name: Not reported Future Sub Area Name: Not reported Future Document Type: Not reported Future Due Date: Not reported Schedule Area Name: Not reported Schedule Sub Area Name: Not reported Schedule Document Type: Not reported Schedule Due Date: Not reported Schedule Revised Date: Not reported			
112	5427 W. IMPERIAL HWY LOS ANGELES, CA	HMIRS	9998090942 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
112	5429 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	9900002105 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
TC3139641.1s Page 341 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
112	5429 W IMPERIAL HWY LOS ANGELES, CA	HMIRS	9999030553 N/A
Click this hyperlink while viewing on your computer to access additional HMIRS detail in the EDR Site Report.			
113	SHELL 5201 IMPERIAL LOS ANGELES, CA 90045	HIST CORTESE	S105024625 N/A
CORTESE: Region: CORTESE Facility County Code: 19 Reg By: LTNKA Reg Id: I-09021			
113	CHEVRON #9-7795 5201 IMPERIAL LOS ANGELES, CA 90045	HIST CORTESE	S105024624 N/A
CORTESE: Region: CORTESE Facility County Code: 19 Reg By: LTNKA Reg Id: 900450089			
113	CHEVRON STATION 97795 5201 W IMPERIAL HWY LOS ANGELES, CA 90045	LUST	1000686528 CAD983638487
LUST: Region: STATE Global Id: T0603701034 Latitude: 33.9307827 Longitude: -118.3700688 Case Type: LUST Cleanup Site Status: Open - Remediation Status Date: 2011-01-19 00:00:00 Lead Agency: LOS ANGELES RWQCB (REGION 4) Case Worker: MSH Local Agency: LOS ANGELES, CITY OF RB Case Number: 900450089 LOC Case Number: Not reported File Location: Regional Board Potential Media Affect: Aquifer used for drinking water supply Potential Contaminants of Concern: Gasoline Site History: Not reported Click here to access the California GeoTracker records for this facility:			
LUST: Global Id: T0603701034 Contact Type: Local Agency Caseworker Contact Name: ELOY LUNA			
TC3139641.1s Page 342 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
	CHEVRON STATION 97795 (Continued)		1000686528
Action Type: RESPONSE Date: 2003-07-15 00:00:00 Action: Monitoring Report - Quarterly			
Global Id: T0603701034 Action Type: RESPONSE Date: 2004-02-03 00:00:00 Action: Remedial Progress Report			
Global Id: T0603701034 Action Type: RESPONSE Date: 2011-01-15 00:00:00 Action: Monitoring Report - Semi-Annually			
Global Id: T0603701034 Action Type: RESPONSE Date: 2011-07-15 00:00:00 Action: Monitoring Report - Semi-Annually			
Global Id: T0603701034 Action Type: RESPONSE Date: 2010-12-21 00:00:00 Action: Corrective Action Plan / Remedial Action Plan - Addendum			
Global Id: T0603701034 Action Type: RESPONSE Date: 2006-04-15 00:00:00 Action: Monitoring Report - Quarterly			
Global Id: T0603701034 Action Type: RESPONSE Date: 2006-10-15 00:00:00 Action: Monitoring Report - Quarterly			
Global Id: T0603701034 Action Type: RESPONSE Date: 2005-04-15 00:00:00 Action: Remedial Progress Report			
Global Id: T0603701034 Action Type: RESPONSE Date: 2005-07-15 00:00:00 Action: Monitoring Report - Quarterly			
Global Id: T0603701034 Action Type: ENFORCEMENT Date: 2008-08-18 00:00:00 Action: Staff Letter			
Global Id: T0603701034 Action Type: ENFORCEMENT Date: 2009-06-15 00:00:00 Action: Staff Letter			
Global Id: T0603701034 Action Type: RESPONSE Date: 2009-04-15 00:00:00			
TC3139641.1s Page 344 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
	CHEVRON STATION 97795 (Continued)		1000686528
Organization Name: LOS ANGELES, CITY OF Address: 200 North Main Street, Suite 1780 City: LOS ANGELES Email: eloy.luna@lacity.org Phone Number: Not reported			
Global Id: T0603701034 Contact Type: Regional Board Caseworker Contact Name: CHANDRA CANSLER Organization Name: LOS ANGELES RWQCB (REGION 4) Address: Not reported City: R4 UNKNOWN Email: ccansler@waterboards.ca.gov Phone Number: Not reported			
LUST: Global Id: T0603701034 Action Type: RESPONSE Date: 2010-03-15 00:00:00 Action: Clean Up Fund - 5-Year Review Summary			
Global Id: T0603701034 Action Type: RESPONSE Date: 2004-02-03 00:00:00 Action: Monitoring Report - Quarterly			
Global Id: T0603701034 Action Type: RESPONSE Date: 2008-01-15 00:00:00 Action: Remedial Progress Report			
Global Id: T0603701034 Action Type: Other Date: 1950-01-01 00:00:00 Action: Leak Stopped			
Global Id: T0603701034 Action Type: RESPONSE Date: 2004-04-15 00:00:00 Action: Monitoring Report - Quarterly			
Global Id: T0603701034 Action Type: RESPONSE Date: 2004-02-03 00:00:00 Action: Remedial Progress Report			
Global Id: T0603701034 Action Type: RESPONSE Date: 2004-10-15 00:00:00 Action: Monitoring Report - Quarterly			
Global Id: T0603701034 Action Type: RESPONSE Date: 2005-01-15 00:00:00 Action: Monitoring Report - Quarterly			
Global Id: T0603701034			
TC3139641.1s Page 343 of 351			

MAP FINDINGS			
Map ID	Direction	EDR ID Number	
Distance	(ft.)Site	Database(s)	EPA ID Number
	CHEVRON STATION 97795 (Continued)		1000686528
Action: Monitoring Report - Quarterly			
Global Id: T0603701034 Action Type: RESPONSE Date: 2009-07-22 00:00:00 Action: Remedial Progress Report			
Global Id: T0603701034 Action Type: RESPONSE Date: 2008-10-15 00:00:00 Action: Remedial Progress Report			
Global Id: T0603701034 Action Type: RESPONSE Date: 2009-10-15 00:00:00 Action: Monitoring Report - Semi-Annually			
Global Id: T0603701034 Action Type: Other Date: 1950-01-01 00:00:00 Action: Leak Discovery			
Global Id: T0603701034 Action Type: RESPONSE Date: 2005-07-15 00:00:00 Action: Remedial Progress Report			
Global Id: T0603701034 Action Type: RESPONSE Date: 2005-10-15 00:00:00 Action: Monitoring Report - Quarterly			
Global Id: T0603701034 Action Type: RESPONSE Date: 2007-01-15 00:00:00 Action: Monitoring Report - Quarterly			
Global Id: T0603701034 Action Type: RESPONSE Date: 2005-10-15 00:00:00 Action: Remedial Progress Report			
Global Id: T0603701034 Action Type: RESPONSE Date: 2006-01-15 00:00:00 Action: Remedial Progress Report			
Global Id: T0603701034 Action Type: RESPONSE Date: 2009-07-15 00:00:00 Action: Monitoring Report - Semi-Annually			
Global Id: T0603701034 Action Type: RESPONSE Date: 2009-01-15 00:00:00 Action: Monitoring Report - Quarterly			
TC3139641.1s Page 345 of 351			

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
CHEVRON STATION 97795 (Continued)		1000686528
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2004-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2011-02-11 00:00:00	
Action:	Pilot Study/ Treatability Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2006-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2011-07-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	ENFORCEMENT	
Date:	2000-09-14 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2009-04-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2009-10-29 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2010-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2007-10-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2010-04-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2010-07-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701034	
Action Type:	RESPONSE	

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
CHEVRON STATION 97795 (Continued)		1000686528
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2008-04-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2008-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2008-07-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2007-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2007-07-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	REMEDICATION	
Date:	1950-01-01 00:00:00	
Action:	Remove free product	
Global Id:	T0603701034	
Action Type:	ENFORCEMENT	
Date:	2011-01-19 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2003-07-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2003-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2003-01-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2003-04-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
CHEVRON STATION 97795 (Continued)		1000686528
Date:	2010-07-20 00:00:00	
Action:	Soil and Water Investigation Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2002-10-23 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2002-10-23 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2006-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2002-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2002-04-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2002-07-31 00:00:00	
Action:	Other Report / Document	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2006-10-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	Other	
Date:	1950-01-01 00:00:00	
Action:	Leak Reported	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2006-07-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2003-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2002-07-15 00:00:00	
Action:	Monitoring Report - Quarterly	

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
EPA ID Number		
CHEVRON STATION 97795 (Continued)		1000686528
Date:	2007-04-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	ENFORCEMENT	
Date:	2004-01-20 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701034	
Action Type:	ENFORCEMENT	
Date:	2002-06-25 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701034	
Action Type:	ENFORCEMENT	
Date:	2010-08-04 00:00:00	
Action:	Staff Letter	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2008-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2008-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2010-10-15 00:00:00	
Action:	Interim Remedial Action Plan	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2011-01-15 00:00:00	
Action:	Monitoring Report - Semi-Annually	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2007-04-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2006-04-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2007-01-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	REMEDICATION	
Date:	1950-01-01 00:00:00	
Action:	Soil Vapor Extraction w/Catalytic Oxidation	

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
Database(s)		EPA ID Number
CHEVRON STATION 97795 (Continued)		1000686528
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2007-10-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2010-01-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2004-01-15 00:00:00	
Action:	Monitoring Report - Quarterly	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2011-01-15 00:00:00	
Action:	Remedial Progress Report	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2010-09-20 00:00:00	
Action:	Soil and Water Investigation Workplan	
Global Id:	T0603701034	
Action Type:	RESPONSE	
Date:	2002-07-15 00:00:00	
Action:	Remedial Progress Report	

LUST REG 4:
Region: 4
Regional Board: 04
County: Los Angeles
Facid: 900450089
Status: Remediation Plan
Substance: Gasoline
Substance Quantity: Not reported
Local Case No: Not reported
Case Type: Groundwater
Abatement Method Used at the Site: Remove Free Product
Global ID: T0603701034
W Global ID: Not reported
Staff: MSH
Local Agency: 19050
Cross Street: LA CIENEGA
Enforcement Type: SEL
Date Leak Discovered: 9/5/1987
Date Leak First Reported: 9/15/1987
Date Leak Record Entered: 10/14/1987
Date Confirmation Began: Not reported
Date Leak Stopped: 9/15/1987
Date Case Last Changed on Database: 7/15/2002
Date the Case was Closed: Not reported
How Leak Discovered: Tank Test
How Leak Stopped: Not reported

TC3139641.1s Page 350 of 351

ORPHAN SUMMARY

Site Name	Site Address	Zip	Database(s)
2 MILES OFF SHORE OF LAX	2 MILES OFF SHORE OF LAX	90245	ERNS
LAX INTERNATIONAL AIRPORT	LAX INTERNATIONAL AIRPORT		HMIRS
LAX INTERNATIONAL AIRPORT	LAX INTERNATIONAL AIRPORT		HMIRS
LAX	LAX		ERNS
LAX	LAX		HMIRS
9900 LAX FUEL ROAD	9900 LAXFUEL RD	90045	ERNS
9900 LAX FUEL ROAD	9900 LAXFUEL RD	90045	ERNS
9900 LAX FUEL ROAD	9900 LAXFUEL RD	90045	ERNS
9900 LAX FUEL ROAD	9900 LAXFUEL RD	90045	ERNS
SHELL LAX FACILITY	1 ONE WORLD		HIST CORTESE

TC3139641.1s Page 1 of 1

MAP FINDINGS		EDR ID Number
Map ID	Direction	Distance
Distance (ft.)	Site	Database(s)
Database(s)		EPA ID Number
CHEVRON STATION 97795 (Continued)		1000686528
Cause of Leak:	UNK	
Leak Source:	Tank	
Operator:	MILLER, MIKE	
Water System:	Not reported	
Well Name:	Not reported	
Approx. Dist To Production Well (ft):	4445.1520555006107719695860307	
Source of Cleanup Funding:	Tank	
Preliminary Site Assessment Workplan Submitted:	9/15/1987	
Preliminary Site Assessment Began:	Not reported	
Pollution Characterization Began:	4/25/2000	
Remediation Plan Submitted:	1/20/2004	
Remedial Action Underway:	10/17/2003	
Post Remedial Action Monitoring Began:	9/15/1987	
Enforcement Action Date:	Not reported	
Historical Max MTBE Date:	1/26/1999	
Hist Max MTBE Conc in Groundwater:	9340	
Hist Max MTBE Conc in Soil:	Not reported	
Significant Interim Remedial Action Taken:	Yes	
GW Qualifier:	Not reported	
Soil Qualifier:	Not reported	
Organization:	Not reported	
Owner Contact:	Not reported	
Responsible Party:	Y. M. TUAN	
RP Address:	P.O. BOX 2292	
Program:	LUST	
Lat/Long:	33.9307627 / -1	
Local Agency Staff:	PEJ	
Beneficial Use:	Not reported	
Priority:	Not reported	
Cleanup Fund Id:	Not reported	
Suspended:	Not reported	
Assigned Name:	Not reported	
Summary:	FP AND GW MONITORING RPT; FREE PRODUCT WAS PRESENT IN UPGRADIENT WELLS (MW-4,7,9) 2 OFFSITE WELLS (MW-16 & MW-17) INSTALLED IN 8/98; 12/6/00 GW MON WELL INSTALLED LTR. RPT; 12/27/00 4TH QTR GW MON RPT 2000; 4/11/01 1ST QTR	

TC3139641.1s Page 351 of 351

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

FEDERAL RECORDS

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 03/31/2011
Date Data Arrived at EDR: 04/13/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 62

Source: EPA
Telephone: N/A
Last EDR Contact: 07/12/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)

Telephone: 202-564-7333

EPA Region 1

Telephone 617-918-1143

EPA Region 3

Telephone 215-814-5418

EPA Region 4

Telephone 404-562-8033

EPA Region 5

Telephone 312-886-6686

EPA Region 10

Telephone 206-553-8665

EPA Region 6

Telephone: 214-655-6659

EPA Region 7

Telephone: 913-551-7247

EPA Region 8

Telephone: 303-312-6774

EPA Region 9

Telephone: 415-947-4246

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 03/31/2011
Date Data Arrived at EDR: 04/13/2011
Date Made Active in Reports: 06/14/2011
Number of Days to Update: 62

Source: EPA
Telephone: N/A
Last EDR Contact: 07/12/2011
Next Scheduled EDR Contact: 10/24/2011
Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 05/16/2011
Next Scheduled EDR Contact: 08/29/2011
Data Release Frequency: No Update Planned

TC3139641.1s Page GR-1

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 02/25/2011
 Date Data Arrived at EDR: 03/01/2011
 Date Made Active in Reports: 05/02/2011
 Number of Days to Update: 62

Source: EPA
 Telephone: 703-412-9810
 Last EDR Contact: 06/14/2011
 Next Scheduled EDR Contact: 09/12/2011
 Data Release Frequency: Quarterly

LIENS 2: CERCLA Lien Information

A Federal CERCLA ("Superfund") lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 02/01/2011
 Date Data Arrived at EDR: 02/04/2011
 Date Made Active in Reports: 05/02/2011
 Number of Days to Update: 87

Source: Environmental Protection Agency
 Telephone: 202-564-6023
 Last EDR Contact: 08/01/2011
 Next Scheduled EDR Contact: 11/14/2011
 Data Release Frequency: Varies

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 03/09/2011
 Date Data Arrived at EDR: 03/15/2011
 Date Made Active in Reports: 06/14/2011
 Number of Days to Update: 91

Source: EPA
 Telephone: 800-424-9346
 Last EDR Contact: 05/16/2011
 Next Scheduled EDR Contact: 08/29/2011
 Data Release Frequency: Quarterly

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 04/05/2011
 Date Data Arrived at EDR: 04/05/2011
 Date Made Active in Reports: 06/14/2011
 Number of Days to Update: 70

Source: National Response Center, United States Coast Guard
 Telephone: 202-267-2180
 Last EDR Contact: 07/05/2011
 Next Scheduled EDR Contact: 10/17/2011
 Data Release Frequency: Annually

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 12/31/2010
 Date Data Arrived at EDR: 01/05/2011
 Date Made Active in Reports: 02/25/2011
 Number of Days to Update: 51

Source: U.S. Department of Transportation
 Telephone: 202-366-4555
 Last EDR Contact: 07/05/2011
 Next Scheduled EDR Contact: 10/17/2011
 Data Release Frequency: Annually

DOT OPS: Incident and Accident Data

Department of Transportation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 01/12/2011
 Date Data Arrived at EDR: 02/11/2011
 Date Made Active in Reports: 05/02/2011
 Number of Days to Update: 80

Source: Department of Transportation, Office of Pipeline Safety
 Telephone: 202-366-4595
 Last EDR Contact: 08/09/2011
 Next Scheduled EDR Contact: 11/21/2011
 Data Release Frequency: Varies

TC3139641.1s Page GR-2

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
 Date Data Arrived at EDR: 08/09/2004
 Date Made Active in Reports: 09/17/2004
 Number of Days to Update: 39

Source: Environmental Protection Agency
 Telephone: 800-424-9346
 Last EDR Contact: 08/09/2004
 Next Scheduled EDR Contact: N/A
 Data Release Frequency: No Update Planned

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2009
 Date Data Arrived at EDR: 03/01/2011
 Date Made Active in Reports: 05/02/2011
 Number of Days to Update: 62

Source: EPA/NTIS
 Telephone: 800-424-9346
 Last EDR Contact: 05/27/2011
 Next Scheduled EDR Contact: 09/12/2011
 Data Release Frequency: Biennially

STATE AND LOCAL RECORDS

HIST CAL-SITES: Calsites Database

The Calsites database contains potential or confirmed hazardous substance release properties. In 1996, California EPA reevaluated and significantly reduced the number of sites in the Calsites database. No longer updated by the state agency. It has been replaced by ENVIROSTOR.

Date of Government Version: 08/08/2005
 Date Data Arrived at EDR: 08/03/2006
 Date Made Active in Reports: 08/24/2006
 Number of Days to Update: 21

Source: Department of Toxic Substance Control
 Telephone: 916-323-3400
 Last EDR Contact: 02/23/2009
 Next Scheduled EDR Contact: 05/25/2009
 Data Release Frequency: No Update Planned

SCS: School Property Evaluation Program

This category contains proposed and existing school sites that are being evaluated by DTSC for possible hazardous materials contamination. In some cases, these properties may be listed in the CalSites category depending on the level of threat to public health and safety or the environment they pose.

Date of Government Version: 06/15/2011
 Date Data Arrived at EDR: 06/16/2011
 Date Made Active in Reports: 07/15/2011
 Number of Days to Update: 29

Source: Department of Toxic Substances Control
 Telephone: 916-323-3400
 Last EDR Contact: 08/09/2011
 Next Scheduled EDR Contact: 11/21/2011
 Data Release Frequency: Quarterly

TOXIC PITS: Toxic Pits Cleanup Act Sites

Toxic PITS Cleanup Act Sites. TOXIC PITS identifies sites suspected of containing hazardous substances where cleanup has not yet been completed.

Date of Government Version: 07/01/1995
 Date Data Arrived at EDR: 08/30/1995
 Date Made Active in Reports: 09/26/1995
 Number of Days to Update: 27

Source: State Water Resources Control Board
 Telephone: 916-227-4364
 Last EDR Contact: 01/26/2009
 Next Scheduled EDR Contact: 04/27/2009
 Data Release Frequency: No Update Planned

WMUDS/SWAT: Waste Management Unit Database

Waste Management Unit Database System. WMUDS is used by the State Water Resources Control Board staff and the Regional Water Quality Control Boards for program tracking and inventory of waste management units. WMUDS is composed of the following databases: Facility Information, Scheduled Inspections Information, Waste Management Unit Information, SWAT Program Information, SWAT Report Summary Information, SWAT Report Summary Data, Chapter 15 (formerly Subchapter 15) Information, Chapter 15 Monitoring Parameters, TPCA Program Information, RCRA Program Information, Closure Information, and Interested Parties Information.

The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste Board (SWFLS), and the Department of Toxic Substances Control (Cal-SITES). This listing is no longer updated by the state agency.

Date of Government Version: 07/01/2011
 Date Data Arrived at EDR: 07/01/2011
 Date Made Active in Reports: 07/15/2011
 Number of Days to Update: 14

Source: CAL EPA/Office of Emergency Information
 Telephone: 916-323-3400
 Last EDR Contact: 07/01/2011
 Next Scheduled EDR Contact: 10/17/2011
 Data Release Frequency: Quarterly

HIST CORTESE: Hazardous Waste & Substance Site List

The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste Board (SWFLS), and the Department of Toxic Substances Control (Cal-SITES). This listing is no longer updated by the state agency.

Date of Government Version: 04/01/2000
 Date Data Arrived at EDR: 04/10/2000
 Date Made Active in Reports: 05/10/2000
 Number of Days to Update: 30

Source: State Water Resources Control Board
 Telephone: 916-227-4448
 Last EDR Contact: 05/16/2011
 Next Scheduled EDR Contact: 08/29/2011
 Data Release Frequency: No Update Planned

CORTESE: "Cortese" Hazardous Waste & Substances Sites List

The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste Board (SWFLS), and the Department of Toxic Substances Control (Cal-SITES). This listing is no longer updated by the state agency.

Date of Government Version: 07/01/2011
 Date Data Arrived at EDR: 07/01/2011
 Date Made Active in Reports: 07/15/2011
 Number of Days to Update: 14

Source: CAL EPA/Office of Emergency Information
 Telephone: 916-323-3400
 Last EDR Contact: 07/01/2011
 Next Scheduled EDR Contact: 10/17/2011
 Data Release Frequency: Quarterly

HIST CORTESE: Hazardous Waste & Substance Site List

The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste Board (SWFLS), and the Department of Toxic Substances Control (Cal-SITES). This listing is no longer updated by the state agency.

Date of Government Version: 04/01/2000
 Date Data Arrived at EDR: 04/10/2000
 Date Made Active in Reports: 05/10/2000
 Number of Days to Update: 30

Source: State Water Resources Control Board
 Telephone: 916-227-4448
 Last EDR Contact: 05/16/2011
 Next Scheduled EDR Contact: 08/29/2011
 Data Release Frequency: No Update Planned

CORTESE: "Cortese" Hazardous Waste & Substances Sites List

The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste Board (SWFLS), and the Department of Toxic Substances Control (Cal-SITES). This listing is no longer updated by the state agency.

Date of Government Version: 07/01/2011
 Date Data Arrived at EDR: 07/01/2011
 Date Made Active in Reports: 07/15/2011
 Number of Days to Update: 14

Source: CAL EPA/Office of Emergency Information
 Telephone: 916-323-3400
 Last EDR Contact: 07/01/2011
 Next Scheduled EDR Contact: 10/17/2011
 Data Release Frequency: Quarterly

HIST CORTESE: Hazardous Waste & Substance Site List

The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste Board (SWFLS), and the Department of Toxic Substances Control (Cal-SITES). This listing is no longer updated by the state agency.

Date of Government Version: 04/01/2000
 Date Data Arrived at EDR: 04/10/2000
 Date Made Active in Reports: 04/08/2009
 Number of Days to Update: 76

Source: Department of Toxic Substances Control
 Telephone: 916-323-3400
 Last EDR Contact: 01/22/2009
 Next Scheduled EDR Contact: N/A
 Data Release Frequency: No Update Planned

LUST: Geotracker's Leaking Underground Fuel Tank Report

Leaking Underground Storage Tank Incident Reports. LUST records contain an inventory of reported leaking underground storage tank incidents. Not all states maintain these records, and the information stored varies by state. For more information on a particular leaking underground storage tank sites, please contact the appropriate regulatory agency.

Date of Government Version: 06/20/2011
 Date Data Arrived at EDR: 06/21/2011
 Date Made Active in Reports: 07/08/2011
 Number of Days to Update: 17

Source: State Water Resources Control Board
 Telephone: see region list
 Last EDR Contact: 06/21/2011
 Next Scheduled EDR Contact: 10/03/2011
 Data Release Frequency: Quarterly

LUST REG 1: Active Toxic Site Investigation

Del Norte, Humboldt, Lake, Mendocino, Modoc, Siskiyou, Sonoma, Trinity counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 02/01/2001
 Date Data Arrived at EDR: 02/28/2001
 Date Made Active in Reports: 03/29/2001
 Number of Days to Update: 29

Source: California Regional Water Quality Control Board North Coast (1)
 Telephone: 707-570-3769
 Last EDR Contact: 08/01/2011
 Next Scheduled EDR Contact: 11/14/2011
 Data Release Frequency: No Update Planned

LUST REG 2: Fuel Leak List

Leaking Underground Storage Tank locations. Alameda, Contra Costa, Marin, Napa, San Francisco, San Mateo, Santa Clara, Solano, Sonoma counties.

Date of Government Version: 09/30/2004
 Date Data Arrived at EDR: 10/20/2004
 Date Made Active in Reports: 11/19/2004
 Number of Days to Update: 30

Source: California Regional Water Quality Control Board San Francisco Bay Region (2)
 Telephone: 510-622-2433
 Last EDR Contact: 06/20/2011
 Next Scheduled EDR Contact: 09/05/2011
 Data Release Frequency: Quarterly

TC3139641.1s Page GR-5

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

US BROWNFIELDS: A Listing of Brownfields Sites

Included in the listing are brownfields properties addresses by Cooperative Agreement Recipients and brownfields properties addressed by Targeted Brownfields Assessments. Targeted Brownfields Assessments-EPA's Targeted Brownfields Assessments (TBA) program is designed to help states, tribes, and municipalities-especially those without EPA Brownfields Assessment Demonstration Pilots-minimize the uncertainties of contamination often associated with brownfields. Under the TBA program, EPA provides funding and/or technical assistance for environmental assessments at brownfields sites throughout the country. Targeted Brownfields Assessments supplement and work with other efforts under EPA's Brownfields Initiative to promote cleanup and redevelopment of brownfields. Cooperative Agreement Recipients-States, political subdivisions, territories, and Indian tribes become Brownfields Cleanup Revolving Loan Fund (BCRLF) cooperative agreement recipients when they enter into BCRLF cooperative agreements with the U.S. EPA. EPA selects BCRLF cooperative agreement recipients based on a proposal and application process. BCRLF cooperative agreement recipients must use EPA funds provided through BCRLF cooperative agreement for specified brownfields-related cleanup activities.

Date of Government Version: 03/29/2011
 Date Data Arrived at EDR: 03/29/2011
 Date Made Active in Reports: 06/14/2011
 Number of Days to Update: 77

Source: Environmental Protection Agency
 Telephone: 202-566-2777
 Last EDR Contact: 06/27/2011
 Next Scheduled EDR Contact: 10/10/2011
 Data Release Frequency: Semi-Annually

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/31/2009
 Date Data Arrived at EDR: 08/12/2010
 Date Made Active in Reports: 12/02/2010
 Number of Days to Update: 112

Source: U.S. Army Corps of Engineers
 Telephone: 202-528-4285
 Last EDR Contact: 06/14/2011
 Next Scheduled EDR Contact: 09/26/2011
 Data Release Frequency: Varies

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 12/31/2010
 Date Data Arrived at EDR: 04/05/2011
 Date Made Active in Reports: 06/14/2011
 Number of Days to Update: 70

Source: Department of Justice, Consent Decree Library
 Telephone: Varies
 Last EDR Contact: 07/01/2011
 Next Scheduled EDR Contact: 10/17/2011
 Data Release Frequency: Varies

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 09/14/2010
 Date Data Arrived at EDR: 10/21/2010
 Date Made Active in Reports: 01/28/2011
 Number of Days to Update: 99

Source: Department of Energy
 Telephone: 505-845-0011
 Last EDR Contact: 06/02/2011
 Next Scheduled EDR Contact: 09/12/2011
 Data Release Frequency: Varies

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
 Date Data Arrived at EDR: 05/07/2009
 Date Made Active in Reports: 09/21/2009
 Number of Days to Update: 137

Source: EPA, Region 9
 Telephone: 415-947-4219
 Last EDR Contact: 06/27/2011
 Next Scheduled EDR Contact: 10/10/2011
 Data Release Frequency: No Update Planned

TC3139641.1s Page GR-3

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

LUST REG 3: Leaking Underground Storage Tank Database
Leaking Underground Storage Tank locations. Monterey, San Benito, San Luis Obispo, Santa Barbara, Santa Cruz counties.

Date of Government Version: 05/19/2003
Date Data Arrived at EDR: 05/19/2003
Date Made Active in Reports: 06/02/2003
Number of Days to Update: 14

Source: California Regional Water Quality Control Board Central Coast Region (3)
Telephone: 805-542-4786
Last EDR Contact: 07/18/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: No Update Planned

LUST REG 9: Leaking Underground Storage Tank Report
Orange, Riverside, San Diego counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 03/01/2001
Date Data Arrived at EDR: 04/23/2001
Date Made Active in Reports: 05/21/2001
Number of Days to Update: 28

Source: California Regional Water Quality Control Board San Diego Region (9)
Telephone: 858-637-5595
Last EDR Contact: 06/27/2011
Next Scheduled EDR Contact: 10/10/2011
Data Release Frequency: No Update Planned

LUST REG 5: Leaking Underground Storage Tank Database
Leaking Underground Storage Tank locations. Alameda, Alpine, Amador, Butte, Colusa, Contra Costa, Calaveras, El Dorado, Fresno, Glenn, Kern, Kings, Lake, Lassen, Madera, Mariposa, Merced, Modoc, Napa, Nevada, Placer, Plumas, Sacramento, San Joaquin, Shasta, Solano, Stanislaus, Sutter, Tehama, Tulare, Tuolumne, Yolo, Yuba counties.

Date of Government Version: 07/01/2008
Date Data Arrived at EDR: 07/22/2008
Date Made Active in Reports: 07/31/2008
Number of Days to Update: 9

Source: California Regional Water Quality Control Board Central Valley Region (5)
Telephone: 916-464-4834
Last EDR Contact: 07/01/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Quarterly

LUST REG 6L: Leaking Underground Storage Tank Case Listing
For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 09/09/2003
Date Data Arrived at EDR: 09/10/2003
Date Made Active in Reports: 10/07/2003
Number of Days to Update: 27

Source: California Regional Water Quality Control Board Lahontan Region (6)
Telephone: 530-542-5572
Last EDR Contact: 06/13/2011
Next Scheduled EDR Contact: 09/26/2011
Data Release Frequency: No Update Planned

LUST REG 6V: Leaking Underground Storage Tank Case Listing
Leaking Underground Storage Tank locations. Inyo, Kern, Los Angeles, Mono, San Bernardino counties.

Date of Government Version: 06/07/2005
Date Data Arrived at EDR: 06/07/2005
Date Made Active in Reports: 06/29/2005
Number of Days to Update: 22

Source: California Regional Water Quality Control Board Victorville Branch Office (6)
Telephone: 760-241-7365
Last EDR Contact: 06/13/2011
Next Scheduled EDR Contact: 09/26/2011
Data Release Frequency: No Update Planned

LUST REG 7: Leaking Underground Storage Tank Case Listing
Leaking Underground Storage Tank locations. Imperial, Riverside, San Diego, Santa Barbara counties.

Date of Government Version: 02/26/2004
Date Data Arrived at EDR: 02/26/2004
Date Made Active in Reports: 03/24/2004
Number of Days to Update: 27

Source: California Regional Water Quality Control Board Colorado River Basin Region (7)
Telephone: 760-778-8943
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: No Update Planned

LUST REG 8: Leaking Underground Storage Tanks
California Regional Water Quality Control Board Santa Ana Region (8). For more current information, please refer to the State Water Resources Control Board's LUST database.

TC3139641.1s Page GR-6

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

95

Date of Government Version: 11/17/2004
Date Data Arrived at EDR: 11/18/2004
Date Made Active in Reports: 01/04/2005
Number of Days to Update: 47

Source: Region Water Quality Control Board Los Angeles Region (4)
Telephone: 213-576-6600
Last EDR Contact: 07/01/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Varies

SLIC REG 5: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing
The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 04/01/2005
Date Data Arrived at EDR: 04/05/2005
Date Made Active in Reports: 04/21/2005
Number of Days to Update: 16

Source: Regional Water Quality Control Board Central Valley Region (5)
Telephone: 916-464-3291
Last EDR Contact: 06/13/2011
Next Scheduled EDR Contact: 09/26/2011
Data Release Frequency: Semi-Annual

SLIC REG 6V: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing
The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 05/24/2005
Date Data Arrived at EDR: 05/25/2005
Date Made Active in Reports: 06/16/2005
Number of Days to Update: 22

Source: Regional Water Quality Control Board, Victorville Branch
Telephone: 619-241-6583
Last EDR Contact: 05/16/2011
Next Scheduled EDR Contact: 08/29/2011
Data Release Frequency: Semi-Annual

SLIC REG 6L: SLIC Sites
The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 09/07/2004
Date Data Arrived at EDR: 09/07/2004
Date Made Active in Reports: 10/12/2004
Number of Days to Update: 35

Source: California Regional Water Quality Control Board, Lahontan Region
Telephone: 530-542-5574
Last EDR Contact: 05/16/2011
Next Scheduled EDR Contact: 08/29/2011
Data Release Frequency: No Update Planned

SLIC REG 7: SLIC List
The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 11/24/2004
Date Data Arrived at EDR: 11/29/2004
Date Made Active in Reports: 01/04/2005
Number of Days to Update: 36

Source: California Regional Quality Control Board, Colorado River Basin Region
Telephone: 760-346-7491
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: No Update Planned

SLIC REG 8: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing
The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 04/03/2008
Date Data Arrived at EDR: 04/03/2008
Date Made Active in Reports: 04/14/2008
Number of Days to Update: 11

Source: California Region Water Quality Control Board Santa Ana Region (8)
Telephone: 951-782-3298
Last EDR Contact: 06/13/2011
Next Scheduled EDR Contact: 09/13/2011
Data Release Frequency: Semi-Annual

SLIC REG 9: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing
The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

TC3139641.1s Page GR-8

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 02/14/2005
Date Data Arrived at EDR: 02/15/2005
Date Made Active in Reports: 03/28/2005
Number of Days to Update: 41

Source: California Regional Water Quality Control Board Santa Ana Region (8)
Telephone: 909-782-4496
Last EDR Contact: 07/18/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: Varies

LUST REG 4: Underground Storage Tank Leak List
Los Angeles, Ventura counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 09/07/2004
Date Data Arrived at EDR: 09/07/2004
Date Made Active in Reports: 10/12/2004
Number of Days to Update: 35

Source: California Regional Water Quality Control Board Los Angeles Region (4)
Telephone: 213-576-6710
Last EDR Contact: 06/06/2011
Next Scheduled EDR Contact: 09/19/2011
Data Release Frequency: No Update Planned

SLIC: Statewide SLIC Cases
The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 06/20/2011
Date Data Arrived at EDR: 06/21/2011
Date Made Active in Reports: 07/08/2011
Number of Days to Update: 17

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 06/21/2011
Next Scheduled EDR Contact: 10/03/2011
Data Release Frequency: Varies

SLIC REG 1: Active Toxic Site Investigations
The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 04/03/2003
Date Data Arrived at EDR: 04/07/2003
Date Made Active in Reports: 04/25/2003
Number of Days to Update: 18

Source: California Regional Water Quality Control Board, North Coast Region (1)
Telephone: 707-576-2220
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: No Update Planned

SLIC REG 2: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing
The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 09/30/2004
Date Data Arrived at EDR: 10/20/2004
Date Made Active in Reports: 11/19/2004
Number of Days to Update: 30

Source: Regional Water Quality Control Board San Francisco Bay Region (2)
Telephone: 510-286-0467
Last EDR Contact: 06/20/2011
Next Scheduled EDR Contact: 09/05/2011
Data Release Frequency: Quarterly

SLIC REG 3: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing
The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 05/18/2006
Date Data Arrived at EDR: 05/18/2006
Date Made Active in Reports: 06/15/2006
Number of Days to Update: 28

Source: California Regional Water Quality Control Board Central Coast Region (3)
Telephone: 805-549-3147
Last EDR Contact: 07/18/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: Semi-Annual

SLIC REG 4: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing
The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

TC3139641.1s Page GR-7

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 09/10/2007
Date Data Arrived at EDR: 09/11/2007
Date Made Active in Reports: 09/28/2007
Number of Days to Update: 17

Source: California Regional Water Quality Control Board San Diego Region (9)
Telephone: 858-467-2980
Last EDR Contact: 08/08/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Annually

CHMIRS: California Hazardous Material Incident Report System
California Hazardous Material Incident Reporting System. CHMIRS contains information on reported hazardous material incidents (accidental releases or spills).

Date of Government Version: 12/31/2010
Date Data Arrived at EDR: 05/03/2011
Date Made Active in Reports: 06/15/2011
Number of Days to Update: 43

Source: Office of Emergency Services
Telephone: 916-845-8400
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: Varies

MCS: Military Cleanup Sites Listing
The State Water Resources Control Board and nine Regional Water Quality Control Boards partner with the Department of Defense (DoD) through the Defense and State Memorandum of Agreement (DSMOA) to oversee the investigation and remediation of water quality issues at military facilities.

Date of Government Version: 06/20/2011
Date Data Arrived at EDR: 06/21/2011
Date Made Active in Reports: 07/08/2011
Number of Days to Update: 17

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 06/21/2011
Next Scheduled EDR Contact: 10/03/2011
Data Release Frequency: Quarterly

VCP: Voluntary Cleanup Program Properties
Contains low threat level properties with either confirmed or unconfirmed releases and the project proponents have request that DTSC oversee investigation and/or cleanup activities and have agreed to provide coverage for DTSC's costs.

Date of Government Version: 06/15/2011
Date Data Arrived at EDR: 06/16/2011
Date Made Active in Reports: 07/15/2011
Number of Days to Update: 29

Source: Department of Toxic Substances Control
Telephone: 916-323-3400
Last EDR Contact: 08/09/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Quarterly

RESPONSE: State Response Sites
Identifies confirmed release sites where DTSC is involved in remediation, either in a lead or oversight capacity. These confirmed release sites are generally high-priority and high potential risk.

Date of Government Version: 06/15/2011
Date Data Arrived at EDR: 06/16/2011
Date Made Active in Reports: 07/15/2011
Number of Days to Update: 29

Source: Department of Toxic Substances Control
Telephone: 916-323-3400
Last EDR Contact: 08/09/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Quarterly

ENVIROSTOR: EnviroStor Database
The Department of Toxic Substances Control's (DTSC's) Site Mitigation and Brownfields Reuse Program's (SMBRP's) EnviroStor database identifies sites that have known contamination or sites for which there may be reasons to investigate further. The database includes the following site types: Federal Superfund sites (National Priorities List (NPL)); State Response, including Military Facilities and State Superfund; Voluntary Cleanup; and School sites. EnviroStor provides similar information to the information that was available in CalSites, and provides additional site information, including, but not limited to, identification of formerly-contaminated properties that have been released for reuse, properties where environmental deed restrictions have been recorded to prevent inappropriate land uses, and risk characterization information that is used to assess potential impacts to public health and the environment at contaminated sites.

TC3139641.1s Page GR-9

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 06/15/2011
 Date Data Arrived at EDR: 06/16/2011
 Date Made Active in Reports: 07/15/2011
 Number of Days to Update: 29

Source: Department of Toxic Substances Control
 Telephone: 916-323-3400
 Last EDR Contact: 09/09/2011
 Next Scheduled EDR Contact: 11/21/2011
 Data Release Frequency: Quarterly

TRIBAL RECORDS

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land
 LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 03/03/2011
 Date Data Arrived at EDR: 03/18/2011
 Date Made Active in Reports: 05/02/2011
 Number of Days to Update: 45

Source: EPA Region 4
 Telephone: 404-562-8677
 Last EDR Contact: 08/01/2011
 Next Scheduled EDR Contact: 11/14/2011
 Data Release Frequency: Semi-Annually

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land
 LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 11/04/2009
 Date Data Arrived at EDR: 05/04/2010
 Date Made Active in Reports: 07/07/2010
 Number of Days to Update: 64

Source: EPA Region 7
 Telephone: 913-551-7003
 Last EDR Contact: 08/02/2011
 Next Scheduled EDR Contact: 11/14/2011
 Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
 A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 03/07/2011
 Date Data Arrived at EDR: 05/20/2011
 Date Made Active in Reports: 06/14/2011
 Number of Days to Update: 25

Source: EPA Region 1
 Telephone: 617-918-1313
 Last EDR Contact: 08/03/2011
 Next Scheduled EDR Contact: 11/14/2011
 Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land
 LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 05/16/2011
 Date Data Arrived at EDR: 05/17/2011
 Date Made Active in Reports: 06/14/2011
 Number of Days to Update: 28

Source: EPA Region 8
 Telephone: 303-312-6271
 Last EDR Contact: 08/01/2011
 Next Scheduled EDR Contact: 11/14/2011
 Data Release Frequency: Quarterly

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land
 LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 01/31/2011
 Date Data Arrived at EDR: 02/01/2011
 Date Made Active in Reports: 03/21/2011
 Number of Days to Update: 48

Source: Environmental Protection Agency
 Telephone: 415-972-3372
 Last EDR Contact: 08/01/2011
 Next Scheduled EDR Contact: 11/14/2011
 Data Release Frequency: Quarterly

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land
 LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 05/17/2011
 Date Data Arrived at EDR: 05/19/2011
 Date Made Active in Reports: 06/14/2011
 Number of Days to Update: 26

Source: EPA Region 10
 Telephone: 206-553-2857
 Last EDR Contact: 08/01/2011
 Next Scheduled EDR Contact: 11/14/2011
 Data Release Frequency: Quarterly

TC3139641.1s Page GR-10

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Local Oversight Facilities

A listing of leaking underground storage tank sites located in San Francisco county.

Date of Government Version: 09/19/2008
 Date Data Arrived at EDR: 09/19/2008
 Date Made Active in Reports: 09/29/2008
 Number of Days to Update: 10

Source: Department Of Public Health San Francisco County
 Telephone: 415-252-3920
 Last EDR Contact: 05/16/2011
 Next Scheduled EDR Contact: 08/16/2011
 Data Release Frequency: Quarterly

SAN MATEO COUNTY:

Fuel Leak List

A listing of leaking underground storage tank sites located in San Mateo county.

Date of Government Version: 06/20/2011
 Date Data Arrived at EDR: 06/21/2011
 Date Made Active in Reports: 07/15/2011
 Number of Days to Update: 24

Source: San Mateo County Environmental Health Services Division
 Telephone: 650-363-1921
 Last EDR Contact: 06/20/2011
 Next Scheduled EDR Contact: 09/05/2011
 Data Release Frequency: Semi-Annually

SANTA CLARA COUNTY:

LOP Listing

A listing of leaking underground storage tanks located in Santa Clara county.

Date of Government Version: 05/29/2009
 Date Data Arrived at EDR: 06/01/2009
 Date Made Active in Reports: 06/15/2009
 Number of Days to Update: 14

Source: Department of Environmental Health
 Telephone: 408-918-3417
 Last EDR Contact: 07/20/2011
 Next Scheduled EDR Contact: 09/19/2011
 Data Release Frequency: Annually

SOLANO COUNTY:

Leaking Underground Storage Tanks

A listing of leaking underground storage tank sites located in Solano county.

Date of Government Version: 06/09/2011
 Date Data Arrived at EDR: 06/29/2011
 Date Made Active in Reports: 07/08/2011
 Number of Days to Update: 9

Source: Solano County Department of Environmental Management
 Telephone: 707-784-6770
 Last EDR Contact: 06/20/2011
 Next Scheduled EDR Contact: 09/05/2011
 Data Release Frequency: Quarterly

SONOMA COUNTY:

Leaking Underground Storage Tank Sites

A listing of leaking underground storage tank sites located in Sonoma county.

Date of Government Version: 04/05/2011
 Date Data Arrived at EDR: 04/06/2011
 Date Made Active in Reports: 05/12/2011
 Number of Days to Update: 36

Source: Department of Health Services
 Telephone: 707-565-6565
 Last EDR Contact: 07/05/2011
 Next Scheduled EDR Contact: 10/17/2011
 Data Release Frequency: Quarterly

VENTURA COUNTY:

TC3139641.1s Page GR-12

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land
 LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 05/10/2011
 Date Data Arrived at EDR: 05/11/2011
 Date Made Active in Reports: 06/14/2011
 Number of Days to Update: 34

Source: EPA Region 6
 Telephone: 214-665-6597
 Last EDR Contact: 08/01/2011
 Next Scheduled EDR Contact: 11/14/2011
 Data Release Frequency: Varies

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 02/25/2011
 Date Data Arrived at EDR: 04/05/2011
 Date Made Active in Reports: 06/14/2011
 Number of Days to Update: 70

Source: EPA, Region 1
 Telephone: 617-918-1102
 Last EDR Contact: 07/05/2011
 Next Scheduled EDR Contact: 10/17/2011
 Data Release Frequency: Varies

INDIAN VCP R7: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
 Date Data Arrived at EDR: 04/22/2008
 Date Made Active in Reports: 05/17/2008
 Number of Days to Update: 27

Source: EPA, Region 7
 Telephone: 913-551-7365
 Last EDR Contact: 04/20/2009
 Next Scheduled EDR Contact: 07/20/2009
 Data Release Frequency: Varies

COUNTY RECORDS

NAPA COUNTY:

Sites With Reported Contamination

A listing of leaking underground storage tank sites located in Napa county.

Date of Government Version: 07/09/2008
 Date Data Arrived at EDR: 07/09/2008
 Date Made Active in Reports: 07/31/2008
 Number of Days to Update: 22

Source: Napa County Department of Environmental Management
 Telephone: 707-253-4269
 Last EDR Contact: 03/07/2011
 Next Scheduled EDR Contact: 06/20/2011
 Data Release Frequency: No Update Planned

ORANGE COUNTY:

List of Underground Storage Tank Cleanups

Orange County Underground Storage Tank Cleanups (LUST).

Date of Government Version: 05/05/2011
 Date Data Arrived at EDR: 05/20/2011
 Date Made Active in Reports: 06/15/2011
 Number of Days to Update: 26

Source: Health Care Agency
 Telephone: 714-834-3446
 Last EDR Contact: 05/16/2011
 Next Scheduled EDR Contact: 08/29/2011
 Data Release Frequency: Quarterly

RIVERSIDE COUNTY:

Listing of Underground Tank Cleanup Sites

Riverside County Underground Storage Tank Cleanup Sites (LUST).

Date of Government Version: 04/26/2011
 Date Data Arrived at EDR: 04/28/2011
 Date Made Active in Reports: 05/17/2011
 Number of Days to Update: 19

Source: Department of Environmental Health
 Telephone: 951-358-5055
 Last EDR Contact: 06/27/2011
 Next Scheduled EDR Contact: 10/10/2011
 Data Release Frequency: Quarterly

SAN FRANCISCO COUNTY:

TC3139641.1s Page GR-11

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Listing of Underground Tank Cleanup Sites

Ventura County Underground Storage Tank Cleanup Sites (LUST).

Date of Government Version: 05/29/2008
 Date Data Arrived at EDR: 06/24/2008
 Date Made Active in Reports: 07/31/2008
 Number of Days to Update: 37

Source: Environmental Health Division
 Telephone: 805-654-2813
 Last EDR Contact: 05/24/2011
 Next Scheduled EDR Contact: 09/05/2011
 Data Release Frequency: Quarterly

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

Oil/Gas Pipelines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical

database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Licensed Facilities

Source: Department of Social Services

Telephone: 916-657-4041

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2011 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

TC3139641.1s Page GR-13

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

